





CALIFORNIA DEPARTMENT OF FORESTRY AND FIRE PROTECTION SAN BERNARDINO UNIT

3800 N. Sierra Way San Bernardino, CA 92405

INVESTIGATION REPORT

CASE NUMBER: 15CABDU001662

CASE NAME: ROUND

DATE: February 6, 2015

INCIDENT TYPE: Wildland Fire

INCIDENT INVESTIGATORS: Brian TOMINAGA, Fire Captain Specialist – BDU

Brandon SMITH, Fire Captain Specialist - RRU

Byron DARRINGTON, Battalion - CSR

Kelly GALLAHER, Fire Captain Specialist – MVU Matt ELLINGTON, Law Enforcement Officer – INF Nathan DERR, Deputy Sheriff – Inyo County


Ron ELDRIDGE, Battalion Chief - CSR

Shannan HARRIS, Fire Captain Specialist – FKU Shane SCOTT, Deputy Sheriff – Inyo County



1	1 -	VIO	LAT	IONS	:

None



2	CI	IRAR	MADV	٧.
	JU) IVIIY	IARY	

2 On Friday, February 6, 2015 at approximately 2:38 PM, a wildland fire started West of


3 Highway 395 at Sherwin Grade approximately 9 miles West of Bishop in Inyo County,

4 California. The fire, named the ROUND incident, burned approximately 7000 acres in

Inyo and Mono Counties. A total of 53 structures were destroyed or damaged by the

fire. Investigators determined an electrical arc from a downed power line caused the

fire. Strong winds caused the tree to fall which failed the power lines.



1	3 - SUBJECT:	
2	SB-1: Southern California Edison	
3	2244 Walnut Grove Avenue	
4	Rosemead, California 91770	
5	(800) 655-4555 Business Phone	
6		
7		
8		
9		
10		
11		
12		
13		
14		
15		
16		
17		
18		
19		
20		
21		
22		
23		
24		
25		
26		
27		
28		
29		



1 4 - WITNESSES:

2 W-1 Donald Wayne PEREA Jr

3 4

5 DOB:

6 Driver's License:

7 Phone:

8 PEREA can testify conditions and events prior to seeing the initial fire.

10 W-2 Jeremy MITCHELL

9

17

- 11 Battalion Chief CAL FIRE San Bernardino Unit
- 12 3800 North Sierra Way
- 13 San Bernardino, CA 92405
- 14 Office: (909) 881-6900
- 15 MITCHELL was the Operations Chief for the ROUND Incident and can testify to initial
- 16 fire conditions and fire suppression actions.

18 W-3 Paul MELENDREZ

- 19 Assistant Chief CAL FIRE San Bernardino Unit
- 20 3800 North Sierra Way
- 21 San Bernardino, CA 92405
- 22 Office: (909) 881-6900
- 23 MELENDREZ was the Incident Commander for the ROUND incident and can testify to
- 24 overall fire suppression operations

25

26

27

28

29

- 1 W-4 Nathan DERR
- 2 Deputy, Inyo County Sheriff
- 3 301 West Line Street
- 4 Bishop, CA 93514
- 5 Office: (760) 878-0383
- 6 DERR was the first arriving law enforcement at the fire and assigned to the fire
- 7 investigation. DERR can testify to initial fire conditions and location in addition to
- 8 witness interviews.

- 10 W-5 Wayne DENGAL
- 11 Bureau of Land Management Law Enforcement Officer
- 12 300 S. Richmond Rd.
- 13 Ridgecrest, CA 93555
- 14 Office: (760) 384-5499
- 15 DENGAL was assigned to the fire investigation team and can testify to scene security.

16

- 17 W-6 Shannan HARRIS
- 18 Fire Captain Specialist CAL FIRE Fresno Kings Unit
- 19 210 S. Academy Ave.
- 20 Sanger, CA 93657
- 21 Office: (559) 493-4300
- 22 HARRIS was assigned to the fire investigation team and can testify to the origin and
- 23 cause.

24

25

26

27

28

29

30

- 1 W-7 Kelley GALLAHER
- 2 Fire Captain Specialist CAL FIRE San Diego Unit
- 3 2249 Jamacha Road
- 4 El Cajon, CA 92019
- 5 Office: (619) 590-3100
- 6 GALLAHER was assigned to the fire investigation team and can testify to photographic
- 7 evidence.

- 9 W-8 Branden SMITH
- 10 Fire Captain Specialist CAL FIRE Riverside Unit
- 11 210 W San Jacinto
- 12 Perris, CA 92570
- 13 Office: (951) 940-6900
- 14 SMITH was assigned to the fire investigation team and can testify to evidence
- 15 collection.

16

- 17 W-9 Jen RICCI
- 18 Battalion Chief CAL FIRE San Bernardino Unit
- 19 3800 North Sierra Way
- 20 San Bernardino, CA 92405
- 21 Office: (909) 881-6900
- 22 RICCI was assigned to the fire investigation team and can testify to evidence transport
- 23 and documentation.

24

25

26

27

28

29

30

- 1 W-10 Josh WILLIAMS
- 2 Firefighter I CAL FIRE San Bernardino Unit
- 3 3800 North Sierra Way
- 4 San Bernardino, CA 92405
- 5 Office: (909) 881-6900
- 6 WILLIAMS assisted with the transportation of evidence to CALFIRE San Bernardino
- 7 Headquarters.

- 9 W-11 Shane SCOTT
- 10 Sergeant, Inyo County Sheriff
- 11 301 West Line Street
- 12 Bishop, CA 93514
- 13 Office: (760) 878-0383
- 14 SCOTT can testify to witness interviews

15

- 16 W-12 Matt ELLINGTON
- 17 Law Enforcement Officer USFS Inyo National Forest
- 18 351 Pacu Lane, Suite 200
- 19 Bishop, CA 93514
- 20 Office: (760) 873-2538
- 21 ELLINGTON was assigned to the investigation team and can testify to witness
- 22 interviews.

23

- 24 W-13 Ray SEGUINE
- 25 Bishop Fire Chief
- 26 209 West Line Street
- 27 Bishop, CA 93514
- 28 Office: (760) 873-5485
- 29 SEGUINE can testify to initial fire conditions.

30

31

LE80 (Rev. 7/2011)

- W-14 Steve LINDERMAN
 Bishop Firefighter
- 3 209 West Line Street
- 4 Bishop, CA 93514
- 5 Office: (760) 873-5485
- 6 LINDERMAN can testify to initial fire conditions.

- 8 W-15 David KAROLY
- 9 Evidence Mapping Specialist CAL FIRE Sacramento Headquarters
- 10 1300 U Street
- 11 Sacramento, CA 95818
- 12 Office: (916) 324-1635

13

- 14 W-16 Dan GREGORY
- 15 Evidence Mapping Specialist CAL FIRE Sacramento Headquarters
- 16 1300 U Street
- 17 Sacramento, CA 95818
- 18 Office: (916) 324-1635

19

- 20 W-17 Jeffery GAWRONSKI
- 21 Evidence Mapping Specialist CAL FIRE Sacramento Headquarters
- 22 1300 U Street
- 23 Sacramento, CA 95818
- 24 Office: (916) 324-1635

25


26

27

28

29 30

- 1 W-18 Brian TOMINAGA
- 2 Fire Captain Specialist CAL FIRE San Bernardino Unit
- 3 3800 North Sierra Way
- 4 San Bernardino, CA 92405
- 5 Office: (909) 881-6900
- 6 TOMINAGA was assigned to the fire investigation team as the lead investigator.
- 7 TOMINAGA can testify to the overall fire investigation.



1 5 - EVIDEN	ICE
--------------	-----

2 The investigation team collected a total of 22 items of evidence which was documented

3 on an LE-75e Evidence Log (see attachment #22). The evidence collected from near


the origin included power line equipment and sections of tree. SMITH supervised the

5 collection of evidence. RICCI documented the evidence collection and supervised the

transport of evidence to CAL FIRE San Bernardino Unit Headquarters for storage.

Details of the evidence collection process are documented in SMITH'S supplemental

report (see attachment#3) and RICCI'S supplemental report (see attachment#20).



6 - CONDITIONS:

- 2 Bishop and Owens Valley has an arid climate, getting an average rainfall of 5.18
- 3 inches, and an average snowfall of 6.8 inches annually. The majority of the area's
- 4 precipitation occurs in December, January and February. Bishop typically receives
- 5 approximately 3 inches of precipitation during the winter months, but there had been
- 6 less than 0.2 inches to date at the time of the fire. The average high temperatures for
- 7 February are 57.9 degree Fahrenheit, while the average lows are 26 degree
- 8 Fahrenheit. During the week leading up to the fire, the RAWS weather data shows the
- 9 maximum air temperatures had been in the low 60's and average relative humidity was
- around 30%. No significant rainfall had occurred since Friday, December 12, 2014,
- when 0.13 inches was recorded by Owens Valley RAWS. On Friday, February 6th the
- 12 average relative humidity was 31%; the temperature peaked at 65 degrees Fahrenheit.
- 13 Average wind speeds were around 7MPH earlier in the day, but began picking up with
- 14 gusts peaking around 8:00 PM, recorded at up to 51 MPH at the Rock Creek RAWs,
- although there is anecdotal evidence that they reached up to 70 MPH. The initial attack
- 16 fire suppression unit reported south to southeast winds of approximately 70 MPH.

17

18 19

20

21

22

23

24


25

2627

28

29

30



7 – EQUIPMENT:

- 2 I located damaged power lines within the initially reported fire area. The lines were on
- 3 the ground beneath and tangled in a fallen tree. The lines were part of a tap line off the
- 4 main north-south power lines. The tap line ran to the east and terminated behind the
- 5 residence located at 2164 Old Sherwin Road. During the origin and cause W-6 Fire
- 6 Captain Specialist Shannan HARRIS found a portion of the lines to be within the
- 7 specific origin area (SOA) and associated with the fire ignition. The power lines were
- 8 collected as evidence and are owned by Southern California Edison (SCE). SCE
- 9 Edison investigators were allowed to inspect and document the scene before any
- 10 evidence was moved or collected. SCE equipment seized as evidence was
- documented on a LE-92 Property Report (see attachment#21).

12

13

14 15

16

17 18

19

20

21

2223

24


25

26

27

28

29



1 8 - PROPERTY:

- 2 The fire destroyed 3475 acres of Federal Responsibility Area (FRA) and 3425 acres of
- 3 State Responsibility Area (SRA) for a total of 6900 acres in Inyo and Mono Counties.
- 4 During the fire, 35 residential structures and 18 nonresidential structures were damaged
- 5 or destroyed for a total of 53 structures. Two of the fire structures were in Inyo County
- 6 with the remaining 51 structures in Mono County (see attachment #9).

7

- 8 The residence located at 2164 Old Sherwin Grade Road was nearest to the fire origin.
- 9 The home was undamaged by fire but a small shed on the property was completely
- 10 destroyed. The roof did appear to have wind damage and a shingle debris field was
- found on the ground to the north of the house. Numerous trees on the property
- 12 appeared to have been damaged by wind.

13

14 15

16

17 18

19

20

21

22

23

24

25

26

27

28 29



1 9 - NARRATIVE:

- 2 RESPONSE
- 3 On Friday, February 6, 2015 at approximately 2:38 PM, I responded to a wildland fire
- 4 West of Highway 395 at Sherwin Grade approximately 9 miles West of Bishop in Inyo
- 5 County, California. The fire, named the ROUND incident, burned approximately 7000
- 6 acres in Inyo and Mono Counties. A total of 53 structures were destroyed or damaged
- 7 by the fire (see attachment #9). I arrived on scene at approximately 7:38 PM.

8

- 9 INITIAL BRIEFING
- 10 At approximately 7:41 PM, I contacted the Operations, W-2 Battalion Chief Jeremy
- 11 MITCHELL. MITCHELL told me the fire started near the Talbot Ranch on Lower Rock
- 12 Creek Road which is also known as Old Sherwin Road. He told me W-4 Inyo Sheriff
- 13 Deputy Nathan DERR had additional information about the initial fire area and possible
- 14 fire cause. I asked MITCHELL about the fire origin area. MITCHELL told me there
- were numerous downed power lines in the area and the Sheriff had the fire area
- 16 evacuated with a staffed road closure. We agreed to stay out of the area until daylight.
- 17 MITCHELL told me he had previously directed fire suppression units to stay out initial
- 18 fire area which had been flagged by the first arriving units.

19

- 20 INVESTIGATION
- 21 At approximately 7:52 PM, I contacted Incident Commander, W-3 Assistant Chief Paul
- 22 MELENDREZ and Unit Duty Chief, Assistant Chief Jeff VEIK by phone to request
- 23 additional officers to support the fire investigation. At approximately 8:22 PM, I
- 24 attempted to contact DERR by phone without success and left a voice mail. At
- 25 approximately 8:26 PM, I contacted California Southern Region (CSR) Law
- 26 Enforcement Assistant Chief Andy ANDERSEN by phone to request additional officers
- 27 to support the fire investigation. At approximately 9:30 PM, I traveled to CAL FIRE
- 28 Owens Valley Camp to brief CAL FIRE San Bernardino Unit Executive Staff on the fire
- 29 investigation expected commitments and support needs.

- 1 SATURDAY, FEBRUARY 7, 2015
- 2 At Owens Valley Camp at approximately 6:30 AM, I briefed MELENDREZ on the status
- 3 fire investigation and requested additional personnel to assist with the investigation.
- 4 MELENDREZ told me to order who I needed from the Emergency Command Center
- 5 and requested additional assistance from cooperating agencies. W-12 US Forest
- 6 Service Law Enforcement Officer Matt ELLINGTON, W-5 Bureau of Land Management
- 7 Law Enforcement Officer Wayne DENGAL and Inyo Sheriff Deputy DERR were at the
- 8 camp and agreed to assist with the investigation. We traveled to 2164 Old Sherwin
- 9 Road to continue the investigation.

- 11 DERR told me at 2:05 PM he was dispatched to the fire. He responded to 2164 Old
- 12 Sherwin Road to evacuate the home. After clearing the home, he looked behind the
- home. He found power lines and a tree down on the ground. The top of the tree was on
- 14 fire and the grass was back burning near the base of the tree. The fire was
- 15 approximately three to five acres and had not crossed Lower Rock Creek Road which is
- 16 also known as Old Sherwin Road. DERR told me he left the residence when fire
- 17 personnel arrived and spent the remainder of his shift conducting evacuations. I placed
- 18 additional to further protect the fire area identified by DERR. I assigned DERR to
- 19 witness interviews of residents in the area. I assigned ELLINGTON to witness
- 20 interviews of initial attack fire suppression personnel and reporting parties. I assigned
- 21 DENGAL to night security and asked him to return at 5:00 PM to secure the scene.

22

- 23 At approximately 9:36 AM, DERR contacted W-1 Donald PEREA at
- 24 approximately 1/4 mile northwest of the initial fire area. During the interview,
- 25 PEREA told DERR he was working near his shop on Friday, February 6, 2015 when his
- 26 radio and work light went out at about 2:00 PM. PEREA looked to the south towards
- 27 Walter SCHOBER'S residence located at

PEREA saw a

- 28 "flash" then "ten foot flames" behind the residence. PEREA called 911 on his cell
- 29 phone at approximately 2:02 PM. PEREA quickly drove to inform SCHOBER who was
- 30 not home. PEREA saw the trees behind the residence on fire and feared the residence

- would burn. PEREA returned to his residence and began evacuating livestock. DERR
- 2 identified PEREA as the original reporting party to the Sheriff's Office at 2:03 PM on
- 3 Friday, February 6, 2015.

- 5 SUNDAY, FEBRUARY 8, 2015
- 6 At approximately 7:00 AM, we had a team briefing at the US Forest Service Visitor
- 7 Center in Bishop, CA. I assigned W-6 Fire Captain-Specialist Shannan HARRIS to the
- 8 origin and cause investigation. I assigned ELLINGTON to assist HARRIS with the
- 9 origin and cause investigation (O&C). W-7 Fire Captain-Specialist Kelly GALLAHER
- was traveling from CALFIRE San Diego Unit and would be arriving later that day. We
- 11 traveled to the scene located at 2164 Old Sherwin Road.

12

- 13 At approximately 8:30 AM, DERR briefed HARRIS on the initial fire area. HARRIS
- began the O&C at approximately 9:00 AM by walking the perimeter of an approximately
- seven to ten acre area completely encompassing the fire area described by DERR.
- During the investigation, HARRIS was able to determine a general origin area (GOA) of
- 17 approximately 80 feet by 50 feet. HARRIS located a tree approximately 70 feet in
- height and power lines within the GOA. HARRIS narrowed the GOA down to a specific
- origin area (SOA) approximately 10 feet by 10 feet. HARRIS located two power lines
- 20 underneath and tangled in the fallen tree within the SOA. Within the SOA, HARRIS
- 21 located an ignition area approximately eight feet by eight feet. HARRIS located multiple
- 22 spots on the ground consistent with power line arcing. HARRIS located metal
- 23 fragments consistent with power line arcing.

- 25 At approximately 10:30 AM, DERR contacted SCHOBER. During the interview,
- 26 SCHOBER said he left his residence at about 1:30 PM on Friday, February 6, 2015.
- 27 SCHOBER said he drove to Bishop, CA to pick up his dogs from the groomer and to go
- the hardware store. While driving home, SCHOBER noticed the smoke and emergency
- 29 vehicles. As he drove closer he noticed the fire was at his residence. SCHOBER
- 30 noticed several trees down on his property but did not have any further information.

- 1 At approximately 3:00 PM, GALLAHER arrived at the incident. I directed her to Owens
- 2 Valley Camp to assist HARRIS with aerial photos. At approximately 4:00 PM, HARRIS
- 3 and GALLAHER flew in CAL FIRE Helicopter 305 to photograph the fire and origin
- 4 area.

- 6 At approximately 5:00 PM, DENGAL reported to the scene to assume night security.
- 7 The remainder of the investigation team departed for the night.

8

- 9 IMONDAY, FEBRUARY 9, 2015
- 10 At approximately 7:30 AM the team arrived at the scene to continue the investigation.
- 11 GALLAHER reviewed the O&C completed the previous day. GALLAHER observed the
- 12 burn indicator flags placed by HARRIS and concurred with his findings. HARRIS and
- 13 GALLAHER systematically walked the GOA photographing burn indicators and areas
- 14 pertinent to the O&C. At approximately 1:00 PM, HARRIS and GALLAHER flew in
- 15 Helicopter 305 to take additional aerial photographs.

16

- 17 At approximately 12:05 PM, Ellington contacted W-13 Bishop Fire Chief Ray SEGUINE
- 18 and W-14 Bishop Firefighter Steve LINDERMAN. SEGUINE and LINDERMAN placed
- 19 the fire near the SCHOBER residence when they arrived at the incident. LINDERMAN
- 20 noticed a large tree had knocked down a power line west of the house. They could not
- 21 provide any further information.

22

- 23 At approximately 5:00 PM, DENGAL reported to the scene to assume night security.
- 24 The remainder of the investigation team departed for the night.

- 26 TUESDAY, FEBRUARY 10, 2015
- 27 At approximately 7:30 AM the team arrived at the scene to continue the investigation.
- 28 assigned W-15 David KAROLY, W-16 Dan GREGORY and W-17 Jeffery GAWRONSKI
- 29 to document the scene. KAROLY, GREGORY and GAWRONSKI are CAL FIRE
- 30 professional surveyors and were assigned as an evidence mapping team. The

1 evidence mapping team conducted geospatial scene documentation of the origin area 2 including a LiDAR scan. After they had completed, the SCE investigation team was 3 allowed access to complete a LiDAR scan prior to continuing with the investigation. 4 5 Michael MAHONEY, a certified arborist, inspected the trees near the origin area. 6 MAHONEY told me there was a number of trees which showed signed of significant 7 wind damage. For the tree that fell into the power lines, MAHONEY determined one of 8 the three main root stems of the tree had decayed. The decayed stem happened to be 9 in alignment with the direction of the wind. The weakness in the tree and the high 10 winds combined to cause the tree to fail. MAHONEY told me the weakness would not 11 have been visible prior to the event. 12 13 At approximately 11:30 AM, I was contacted by SCHOBER who came by his residence 14 to pick up some personal items. SCHOBER told me a SCE vegetation management 15 crew had trimmed the trees near the power lines approximately 2 to 3 weeks ago. He 16 pointed out small piles of tree trimmings that the crew had left. SCHOBER told me 17 there were no problems with the power lines or the electrical service to his knowledge. 18 19 At approximately 2:00 PM, I was contacted by PEREA. PEREA gave me a written 20 statement he had completed at the request of DERR (see attachment #15). After 21 reviewing the written statement, I noticed inconsistencies between his written statement 22 and the interview conducted by DERR. I assigned SMITH to conduct a follow up 23 interview with PEREA at his residence. I assigned GALLAHER to assist SMITH and 24 photograph the view from PEREA's residence. At approximately 2:37 PM, SMITH and GALLAHER interviewed PEREA at his residence located at 25 26 During the interview, PEREA located the fire start near Edison Pole #1854105E, which 27 was the third pole west of 2164 Old Sherwin Road. 28 29 At approximately 5:00 PM, DENGAL reported to the scene to assume night security.

30

The remainder of the investigation team departed for the night.

to continue the investigation.

1	INVESTIGATION WEDNESDAY, FEBRUARY 11, 2015
2	At approximately 7:30 AM the team arrived at the scene

3 SMITH examined the burned area where PEREA indicated he saw the fire start.

4 SMITH determined fire indicators were not consistent with a fire start in the area

5 indicated by PEREA the previous day.

6

7 At approximately 9:30 AM, I assigned SMITH to supervise the collection of evidence at

8 the origin. SMITH was assisted by RICCI, GALLAHER, and HARRIS. RICCI

9 documented the evidence and transported the evidence to the evidence locker at San

Bernardino Unit Headquarters. GALLAHER photographed the evidence and collection

process.

12

10

11

13

14

SOUTHERN CALIFORNIA EDISON CONCURRENT INVESTIGATION

15 During the investigation, I was contacted by Scott HAYASHI of Southern California

16 Edison (SCE). HAYASHI requested entry into the scene to conduct his own

17 investigation as the fire involved SCE power lines. I told HAYASHI this was currently a

18 potential criminal investigation and there would be a delay until the scene was

19 documented including a LiDAR scan of the origin area. HAYASHI said his investigation

would also include a LiDAR of the origin area. The SCE LiDAR team was allowed to

complete a scan immediately after CAL FIRE team. SCE was provided access to

22 conduct their concurrent investigation after both LiDAR scans were completed. SCE

23 was allowed to document the evidence collection process.

24

20

21

2526

27

28

29

1	CONCLUSION
2	Extreme winds caused a tree near the power lines to fall. The tree contacted and then
3	caused the power lines to break. As the tree fell, pulling down the power lines,
4	electrical arcing ignited ground vegetation. Strong, erratic winds and dry conditions
5	allowed for rapid fire development. The investigation determined SCE had maintained
6	tree clearance of the power lines and the tree could not have been identified as a
7	hazard tree prior to the incident. No violations were noted and the case is closed with
8	no further action.
9	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	B June 922245
21	12 - Jman 422-24
22	Signature Date
23	
24	Brian Tominaga
25	CAL FIRE Battalion Chief

26


27

29

30

California Southern Region

Cost Recovery



10 - ATTACHMENTS:

- 1. LE-71 Supplemental Report HARRIS
- 2. Inyo Sheriff Supplemental Report DERR
- 3. LE-71 Supplemental Report SMITH
- 4. LE-71 Supplemental Report GALLAHER
- 5. Inyo Sheriff Supplemental Report SCOTT
- 6. CALFIRE FC-34 Dispatch Report
- 7. CALFIRE CAIRS Incident Report
- 8. CALFIRE LE-66 Preliminary Fire Investigation
- 9. Damage Summary
- 10. Reporting Party Email Request
- 11. Federal Owens Valley Command Center CAD Report
- 12. Lightning Map
- 13. Inyo Sheriff CAD Report
- 14. Origin Diagram
- 15. Witness Written Statement PEREA
- 16. Origin Video
- 17. CHP Incident Report
- 18. CHP 911 System Audio
- 19. Inyo Sheriff Fax HOLLOWELL
- 20.LE-71 Supplemental Report RICCI
- 21.LE-92 Property Report
- 22.LE-75e Evidence Log
- 23. LE-76 Custody Report
- 24. Photos Index
- 25. Photos

10.1 - LE-71 Supplemental Report HARRIS



SUPPLEMENTARY INVESTIGATION REPORT

STATE OF CALIFORNIA
DEPARTMENT OF FORESTRY AND FIRE PROTECTION
LE 71 (REV. 4/2011)

15CABDU001662

CASE NAME

ROUND

LINIT CASE NUMBER

						ROOND	
DAY	MONTH	DATE	YEAR	COUNTY	REGION	UNIT	CASE NUMBER
FRI	FEB	6	2015	INYO	CSR	BDU	15-001662

Investigation:

On Saturday, February 7, 2015, at approximately 10:30 AM, I was contacted by Fresno Emergency Command Center (ECC) and was advised to respond to a wildland fire in Inyo County near the Community of Bishop. I responded at approximately 12:30 PM, and arrived at approximately 6:00 PM, at the United States Forest Service (USFS) visitor center for a briefing with the other fire investigators to assist with the origin and cause fire investigation. Upon my arrival I contacted Fire Captain Brian TOMINAGA who gave me a brief synopsis of what took place when he arrived at scene. TOMINAGA assigned me to conduct the origin and cause fire investigation, along with CAL FIRE, Fire Investigator Kelly GALAHER to assist me.

. ~

On Sunday, February 8, 2015, at approximately 7:00 AM, the team met for a briefing at the USFS visitor center minus GALAHER who was enroute from CAL FIRE San Diego Unit. After briefing we met at the fire at approximately 8:30 AM, along with Inyo County Sheriff Deputy Nate DERR, who was the first one at scene the day the fire started. DERR briefed me on what he saw, and told me where he saw the fire. DERR told me it was behind the house located at 2164 Old Sherwin Grade Road and approximately 3-5 acres in size, and pushing toward Old Sherwin Grade Road. I took some overall photos of the fire area where DERR told me the fire was at when he arrived at scene.

I started my origin and cause investigation at approximately 9:00 AM. I started at the house and walked up the left flank of the fire in a north westerly direction of the fire working clockwise and read fire indicators such as, charring, protection areas, sooting and staining. I walked into the burn and worked my way to the right flank of the fire, as I was walking I continued to observe fire indicators. I started to work down the right flank of the fire until I reached the spot where I started walking from. I walked approximately 7-10 acres encompassing the 3-5 acres where DERR first saw the fire. I took overall photos of the area I walked. I walked again starting at house and started walking up the right flank in a counter clockwise direction. I walked the same path as I did before

continuing to read fire indicators. I continued to walk counter clockwise direction until I reached the house.

1

2

2

4

5

6

7

8

9

10

11

12

13

14

15

16

17

40

19

20

21

22

23

24

25

26

27

28

29

30

31

32

34

I walked back up the right side of the fire and crossed into the burned area where I observed the most destructive area due to the fire. As I was walking in the fire area I observed a large amount of asphalt shingles. I also observed a small piece of what appeared to be a power line clamp. I placed a tag labeled number one at the location to identify the clamp. I also place number two. three, four, and number five tags to identifying asphalt shingles, and to identify how far they were blown from the roof of the house. I continued to work from side to side in a west and east direction observing macro and micro fire indicators such as charring, protection areas, sooting, staining and damage differential. I worked from the most destructive to the least destructive. As I was walking, I was observing advancing movement of the fire and placed red flags indicating the advancement of the fire. I also observed lateral movement of the fire and place yellow flags indicating such. I continued to work toward the heel of the fire in a south direction. The advancement of the fire narrowed to approximately 25 feet wide area, advancing to the north. I continued to observe lateral movement on both sides (west and east) of the advancement of the fire. I walked around the heel of the fire in a counter clockwise direction and observed backing burn indicators. I continued to walk until I started to observe lateral movement of the fire and no more backing indicators. I stopped and walked back around the heel of the fire in a clockwise direction and observed backing burn. indicators. I placed blue flags indicating backing burn indicators. I walked into the burned area where I showed advancing and lateral movement. I continued to work in a south direction: I was able to narrow the fire down to a general origin area (GOA). The GOA was approximately 80 feet by 50 feet. Within the GOA I observed a large tree approximately 70 feet in height that had fallen. Within the fallen tree, I observed a power line wrapped in a smaller tree that was still standing. Also within the GOA. I observed a small branch with two small burn marks that are inconsistent with the direction of the fire. I place tags six and seven at the burn marks location on the branch. The two small burn marks are approximately one inch by two inches in size. I also observed a power pole (1854 107E) approximately 40 feet east of the GOA and another power pole (1854 106E) west of the GOA at approximately 150 feet. I observed part of the north power line that had broke at the cross arm insulator from the power pole to the east of the GOA. I also observed the south power line broken at mid span. Also within the GOA, I located what appeared to be two types of phone cables. One section of one of the cables was still connected to the east pole and under the fallen tree. The other section was found on the west side of the GOA. The other cable was found in two sections, one on the east side of the GOA and the other section was found on the west side of the GOA. I continued to work and observe micro and macro burn indicators within the GOA. I was able to

2 OF 5

OFFICERS INITIALS

narrow the GOA down to a specific origin area (SOA) of 10 feet by10 feet by reading micro burn indicators. The indicators I observed were charring, sooting, cupping, protection areas and low in high out on saw grass. Within the SOA I located two power lines lying on the ground and wrapped in the fallen tree and under the tree. With the power lines wrapped in the tree and underneath the tree tells me the tree had fallen into the power lines causing both north and south power lines to break. Within the SOA I located an ignition area approximately eight feet by eight feet. Within the ignition area I located multiple spots where both north and south power lines appeared to have arced on the ground. I also located multiple metal fragments that appear to be from the power lines. At approximately 4:00 PM, myself GALAHER flew in CAL FIRE helicopter to take aerial photos of the fire.

On Monday, February 9, 2015 at approximately 10:00 AM, fire investigator GALAHER took photos of the fire. GALAHER took photos of the GOA, SOA, burn indicators and overall fire (see GALAHER'S photo log). Also GALAHER conducted a sketch of the GOA. AT approximately 2:00 PM, Southern California Edison (SCE) was allowed to have their Laser Imaging Detection and Ranging (LIDAR) team in the fire scene to take measurements.

On Tuesday, February 10, 2015 at approximately 8:00 AM, SCE, LIDAR team returned to complete their measurements and was finished at approximately 10:00 AM. At 10:00 AM, Southern California Edison (SCE) employees were allowed in the fire scene to inspect their power lines and power poles. Also SCE employees were allowed to conduct their own fire investigation. SCE finished there fire investigation at approximately 4:00 PM. At approximately 4:15 PM I spoke to Steve LINDERMAN who is with the Volunteer fire company out of Bishop, and was the first fire suppression equipment at the fire's origin. LINDERMAN told me when he arrive at scene he observed fire with in the fallen tree and two out building on fire. LINDERMAN told me the fire was pushing to the north, and he and his crew of three where doing fire suppression on the two building. LINDERMAN also told me, after the fire was contained at the heel of the fire he started to mop up hot spots around the GOA including the fallen tree and that's when he observed the power lines. LINDERMAN told me he flagged off the area for firefighter safety. LINDERMAN also told me while they were in conducting fire suppression and mopping up the fire, trees continued to fall with the heavy wind.

On Wednesday, February 11, 2015, CAL FIRE, Fire Investigator Branden SMITH was
assigned to collect evidence within the GOA and SOA. SMITH collected the north power line that
had what appeared to be arc marks. SMITH also collected metal prices that appeared to be splatter
coming from the arcing of the north power line. SMITH also collected the south power line; it too
appeared to have arc marks. SMITH also collected metal prices that appeared to be splatter coming
from the arcing of the south power line. SMITH also collected prices of the tree that were in contact
with both the north and south power lines. SMITH also collected the branch that was identified as
tags six and seven; the branch has two burn marks on it. SMITH also collected what appeared to be
a power line clap that was identified as tag number 1. SMITH also collected two what appeared to
be phone cables, which were located within the SOA and GOA. See SMITHS report to get correct
times of evidence collection.

12 The following sources of ignition were ruled out as a cause for this fire:

- 14 Lightning -No lightning activity reported in the area and the sky was clear. A search Bureau of Land
- 15 Management (BLM) lightning detection map shows no strikes in the prior 72 hours.
- 16 Smoking No cigarettes or other smoking materials were located in the GOA and SOA.
- 17 Debris Burning I did not locate any debris burning within the GOA and SOA.
- Vehicles I did not locate any vehicles at or near the GOA and SOA.
- 19 Equipment use There were no signs of equipment use in the GOA and SOA.
- 20 Railroad There are no railroad tracks on the property.
- 21 Fireworks No remnants of fireworks were observed in the GOA and SOA. There were no fireworks
- 22 wrappers, or other signs of fireworks activities in the area.
- 23 Spontaneous Combustion Within the GOA and SOA there were no piled organic debris such as
- 24 grass or hay and no oily rags which would support a spontaneous combustion caused fire.
- 25 Campfire There was no signs of a campfire in or near the GOA or SOA.
- 26 Shooting I did not locate any shell casings or bullet fragment associated with shooting.
- 27 Equipment I did not located any equipment in or around the GOA and SOA
- 28 Arson I did not locate and incendiary devices, or arson paraphernalia with in the GOA and SOA.
- 29 Playing with fire I did not locate any activities associated with someone playing with fire. The
- 30 residents were not home at the time of the fire. There are no kids living on the property.

31 32

1

2

4

5

6

7

8

9

10

11

13

34

OFFICERS INITIALS

Opinion & Conclusion

Based on my training, education, experience, knowledge and statements from DERR and the first arriving fire suppression equipment operator LINDERMAN; I was able to rule out all other possible causes of a fire starting with the exception of power lines. It was apparent that the fire started with in the ignition area that I located. I found multiple spots within the ignition area where it appeared the power line had arced and splattered metal. The cause of the fire is due to a fallen tree into power lines and the power lines arcing and started a fire in the vegetation.

PRINTED NAME	SIGNATURE /	BADGE NUMBER	DATE
Shannan Harris	Mum Hen	3932	02-12-2014

10.2 - Inyo Sheriff Supplementa	al Report DERR



550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 760-878-0383 Page 1 Case

ASSIST OTHER AGENCY REPORT Description

15-02-021

	Offenses Brush Fire	Description Fire Investigation					Fel/Misd	Date Occurs 02/06/15-0		Time (Oceurred	Ineid 150	ent # 2060023
S								Date Report 02/06/201:		Time F 1405	Reported		
OFFENSES								Related Cas	es				
OFF								Date Printed 02/09/2013		Time F 09:26		Print SNI	ed By
								Latitude 37.453390		Longit	ude 583650		
	Location Ranch Land, 2180	Old Sherwin Road, Ro	ound Valley, C	CA 93514	X () () () () () () () () () (Beat 200	Arca 201	Disposition Referred to	Other A	gency			Date 18/2015
	Location Type Other	Location of Entry	Method of I	Entry	Point o	f Entry		Alarm Syste	m	Means	of Attack	(Robb	ery)
	Victim		1	Drivers	License		Cell Phon	e	Email				
	Residence Address			Notified	of Victin	n Rights	Residence	Phone	DOB		Age	Sex	Race
	Business Name and A	ddress	- 6 <u>- 9</u>				Business 1	hone	Height		Wt	Hair	Eyes
	Assistance Rendered/	ssistance Rendered/Victim Disposition					Transpor	orting Agency Means of Attack (Assault			ts)		
	Description of Injurie	es					Other Inf	ormation					
	Witness Perea, Donald			Drivers	License	ľ	Cell Phon	e	Email				
	Residence Address			,			Residence	Phone	DOB		Age	Sex M	Raec
	Business Name and A Talbot Ranch	ddress					Business I	Phone	Height 5'8"		Wt 165	Hair BRO	Eyes BRO
	Suspect Name		7500				Action Ta	ken	Charge	es			
	Residence Address						Residence	Phone	DOB		Age	Sex	Race
	Business Name and A	ddress					Business 1	Phone	Height		Wt	Hair	Eyes
	Identifying Features						Cell Phone Drivers I			License Arrest Number			
	Aliases												
VEHICLES	Status	Veh	icic Make and	Model			License/S	tate	Vehicle	Турс			
	Prepared By SND1 - Derr, Natha	Date 02	e A	Assisted By	/ /			pproved By SDC1 - Carte	r, Donny	y		D яtc 02/09	/2015
EPUTIES	Routed To Cal Fire	Date	Routed To		D	ate	Notes				-18 11 1		
J													

X

INYO COUNTY SHERIFF'S DEPARTMENT

Page 2 Case 15-02-021

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 760-878-0383 ASSIST OTHER AGENCY REPORT

Cell Phone Email Witness Drivers License Schober, Walter Residence Address Residence Phone DOB Age Sex Raee 70 M W Business Name and Address **Business Phone** Height Wt Hair Eyes 6'1" 220 **BRO BRO** Cell Phone Involved **Drivers License** Email Bishop Volunteer Fire Department Residence Phone DOB Residence Address Age Sex Racc 207 W. Line St, Bishop, CA 93514 Wt **Business Name and Address Business Phone** Height Hair Eyes Involved **Drivers License** Cell Phone Email Cal Fire Residence Address DOB Residence Phone Age Sex Race San Bernardino Business Name and Address **Business Phone** Wt Height Hair Eyes Involved Drivers License Cell Phone Email CHP Residence Address Residence Phone DOB Age Sex Race Business Name and Address **Business Phone** Wt Hair Height Eyes Involved Drivers License Cell Phone Email Fish And Game Residence Address Residence Phone DOB Age Sex Race 407 Line St W, Bishop Wt **Business Name and Address Business Phone** Hair Height Eyes Involved Cell Phone Drivers Lieense Email Mono County Sheriff Department Residence Address Residence Phone DOB Age Sex Race Bridgeport, CA 93517 Business Name and Address **Business Phone** Height Wt Hair Eyes Involved Drivers License Cell Phone Email Us Forest Service Residence Address DOB Residence Phone Age Sex Race Hwy 136 & 395, Lone Pine, CA 93514 Business Name and Address **Business Phone** Height Wt Hair Eyes Officer Involved **Drivers License** Cell Phone Email Frew, Kevin Residence Address Residence Phone DOB Racc Age Sex 157 E Pavilion St, Independence **Business Name and Address Business Phone** Height Wt Hair Eyes

Inyo County Sheriff's Department, 550 S. Clay Street, Independence, CA 93526

760-878-0383

Case

Page 3

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 ASSIST OTHER AGENCY REPORT

15-02-021

Officer Involved Tominaga, Brian	Drivers License	Cell Phone	Email			
Residence Address 3800 N. Sierra Way, San Bernardino, CA 93	3405	Residence Phone	DOB	Age	Sex M	Race
Business Name and Address Cal-Fire, 3800 N. Sierra Way, San Bernardino, CA 92405		Business Phone	Height	Wt	Hair	Eyes



Page 4

15-02-021

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 760-878-0383 ASSIST OTHER AGENCY REPORT - PROPERTY

ID No.	Status/Disposition	Property Description	Value	Val Recovered
1	Evidence	2 Items - Audio cd's		ACCOUNT TO THE PROPERTY OF THE PARTY OF THE
	Evidence	2 Items - Addio cu s		
		1		
		1		



550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 NARRATIVE

760-878-0383

15-02-021

Page 1

Attachments:

Item#A- Sketch of approximate location of fire on my arrival with digital image from google earth.

Item#B- Sketch of approximate location of fire on my arrival on a digital topographic map.

Item#C- Inyo County Sheriff's Department CAD Incident Report for Incident# 1502060023.

Evidence:

Item#1- Audio CD containing interview with Donald Perea.

Item#2- Audio CD containing Donald Perea's initial 911 call.

Chain of Evidence:

Item#1- On 02-07-2015, at about 0936 hours, I recorded my interview with Perea with my personal digital audio recorder. On 02-09-2015, at about 0800 hours, I downloaded and burned the audio recording onto a Compact Disc. On 02-09-2015, I forwarded the compact disc to Cal-Fire investigator Tominaga.

Item#2- On 02-08-2015, I received a digital copy of Perea's 911 call from Dispatcher Frew. On 02-08-2015, at about 0800 hours, I downloaded the digital copy onto a compact disc and forwarded to compact disc to Cal-Fire investigator Tominaga.

Details:

On 02-06-2015, at about 1405 hours, I was dispatched with fire personnel to a vegetation fire near the Talbot Ranch on Lower Rock Creek Road (AKA Old Sherwin Road).

I arrived on scene and began evacuation proceedures at the Schober residence located at

The residence is further described as a white single story ranch style home with several wood outbuildings to the north and east of the main residence. I cleared the main residence attempting to evacuate any occupant's. No occupants were located inside the main residence.

I walked around the exterior of the main residence looking for garden hoses or sprinklers which could be used to keep the fire from burning the residence, with negative results. As I walked around the southwest corner of the residence I saw power lines hanging down to the ground from the wood telephone pole next to the residence. The power lines continued west along the ground where they intersected with a down tree. The tree was lying on the ground with the top pointing to the north east, directly at Lower Rock Creek Road. At that time the fire was burning north / northeast toward Lower Creek Road. The southern flank of the fire was approximately 150 feet from the back of the residence. The top portion of the tree was of fire and the grass under the tree was back burning near the base of the tree. From my vantage point the north flank of the fire had not crossed Rock Creek (Rock creek runs west to east approximately 100 yards from the residence). The head of the fire was already burning on the west shoulder of Lower Rock Creek Road. Due to rapid fire spread

Prepared By:	Date:	Approved By:	Date:
SND1 DERR, NATHANIEL	02/07/2015	SDC1 CARTER, DONNY	02/09/2015

NARRATIVE



550 SOUTH CLAY STREET INDEPENDENCE, CA 93526

760-878-0383

15-02-021

Page 2

and heavy wind driven smoke I was unable to gather more precise distances. Refer to Attachment #A.

As I walked back to my patrol vehicle I contacted Walter "Walt" Schober, who had pulled into the driveway while I was conducting my evacuation procedure. I spoke briefly with Schober who verbally identified himself as the residence of the house. Schober said he was going to move his vehicle out of its wood parking structure and then leave the area.

Fire personnel arrived at the residence and I proceeded approximately one quarter of a mile north to 2180 Old Sherwin Road. As I drove to 2180 Old Sherwin Road, I noticed the fire had jumped Lower Rock Creek Road and was burning on the east shoulder of Lower Rock Creek Road.

After conducting evacuation proceedures at 2180 Old Sherwin Road the wind shifted to the north and the fire began heading north along Lower Rock Creek Road. I spent the remainder of my shift conducting evacuation proceedures.

On 02-07-2015, I was assigned to assist Fire Prevention Officer Tominaga with fire investigation.

On 02-07-2015, at about 0936 hours, I contacted Donald "Don" Perea, who resides at

Perea told me the following in summary:

On 02-06-2015, He was working near his shop using a light and listening to the radio. At about 1400 hours, Perea said his radio stopped playing and his work light went out. Perea then looked to the south toward "Walt's" place (referencing Walter Schober's residence at Perea saw a "flash" then "ten foot flames" behind Schober residence. Perea used his cellular telephone to call 911 since his land line telephone was not working. The call record from Perea's cellular telephone showed a 911 call at 1402 hours, on 02-06-2015. Perea quickly drove to to inform

Schober. Schober was not at the residence. Perea saw the trees behind Schober's residence on fire and feared Schober's residence would be burned. Perea returned to his residence and began evacuating livestock at the ranch.

I ended my interview with Perea and requested him to complete a written statement form.

I attempted to contact Schober through-out the day with negative results.

I checked the Inyo County Sheriff dispatch incident log to find the original reporting party. The incident report showed Don Perea as the original reporting party to the Sheriff's Office at 1403 hours, on 02-06-2015. I spoke with dispatcher Frew who stated there were two calls following Perea reporting the fire. No information for the callers was gathered, due to the incident previously being reported. Frew noted that the two following calls had no pertinent information and the callers could only inform him of smoke in north end of Round Valley.

On 02-08-2015, at about 1030 hours, I contacted Schober near the road closer for the fire on Lower Rock Creek

Prepared By:	Date:	Approved By:	Date:
SND1 DERR, NATHANIEL	02/07/2015	SDC1 CARTER, DONNY	02/09/2015



550 SOUTH CLAY STREET

INDEPENDENCE, CA 93526 NARRATIVE 760-878-0383

15-02-021

Page 3

Road.

Schober told me the following in summary:

On 02-06-2015, at 1330 hours, he left his residence and drove to into town (Bishop) to pick-up his dogs from the groomers. After retrieving his dogs and running to the hardware store he began returning to his residence. While driving to his residence he was passed by emergency personnel. Schober then saw the smoke column and though it might be on the "mesa" a nearby housing community. As Schober drove closer he noticed the fire to be at his residence. Schober noticed several trees down on his property but did not know where the fire started. Prior to leaving his residence Schober did not notice anything unusual. Schober had no further information.

I ended my interview with Schober.

As of this report I have not received a written statement from Perea.

I was unable to locate any further witnesses at the time of this report.

Case Status:


Open / Forwarded to CAL-Fire.

 Prepared By:
 Date:
 Approved By:
 Date:

 SND1
 DERR, NATHANIEL
 02/07/2015
 SDC1
 CARTER, DONNY
 02/09/2015



ATTACHMENT#B

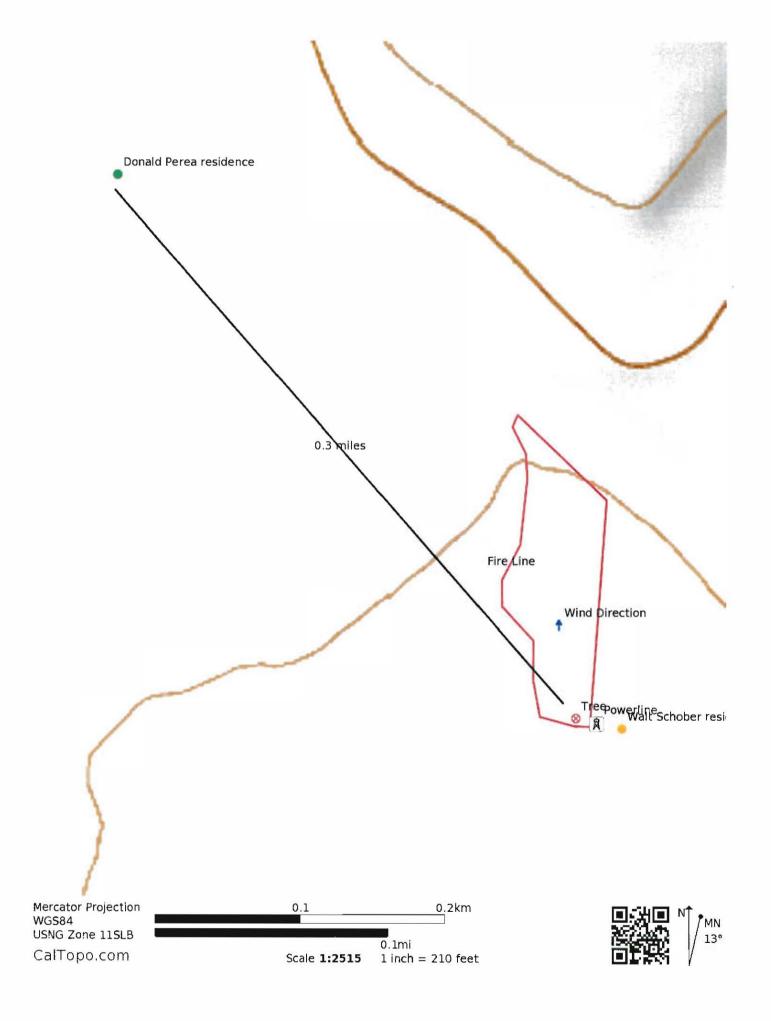

*

INYO COUNTY SHERIFF'S DEPARTMENT

CAD INCIDENT REPORT 1502060023

Page 1

02/07/2015

ATTACHWENT C

Location TALBOT RANCH AREA/					Cro	ss Stree	ts			City				
Incident Type BRUSH - BRUSH FIRE					Call Taker FREW, KEVIN			Dispateher FREW, KEVIN						
Datc 02/06/2015	Priority 1	17 0.532		eat 00	Fire	e Zone	Area 201	41.2	Мар	Source				
Caller Name PEREA, D			,	(Caller Ad	ldress						Ca	aller P	hone
Dispositions Assisted Other Agency					Wea	роп		Aln	n Leve		ase Nn 5-02-0			
Vehicles						Asso	ciated	Incidents						
Incident Tim	14:03:12	Special C	ircumstances											
Created Dispatched En Route On Scene Closed Rcvd-Close	14:06:29 14:16:46	Persons												
Unit Times			Dispatche			On Se		Clear 19:1			Scene	On Seene-C		
	Derr, Nathaniel		14:05:49		:06:29	14:16				10:57		4:57:59		:08:56
	Howard, Brian		14:05:50		:07:24 :06:43	14:23		00:5: 15:3		18:04 24:43		10:29:54 1:04:45		0:47:58
2164	Carton Done		14:06:43			14:31				16:26				:29:28
	Carter, Donny Hollowell, Jeff		14:07:35		:07:39	14:24	.01	19:14		16:26 N/A		4:50:16 N/A		:06:42 :45:18
	Lutze, Bill		14:14:25 14:17:04		:14:40 :17:15	14:53	.27	19:59		36:23		N/A 10:00:26		0:36:49
	Baldwin, Paul		14:17:04	14	.1.12	14:36		20:0		00:04		5:26:50		:26:54
	Obayashi, Edward	4	14:40:15	1.4	:40:28	14:59		18:3:		18:54		3:36:14		:55:08
SAM3	Bachman, Tim	a.	15:05:24		:05:26	15:13		18:1		07:53		2:57:53		:05:46
BPVFD	Dactimal, Till		15:13:43		:21:49	(3, (3	.17	12:13		N/A		N/A		I/A
	Hoodman, Chris		15:15:24		:15:30			19:14		N/A		N/A		:59:25
IVFD	. 1500man, Cinis		15:15:49		:21:53			10:4:		N/A		N/A		1/A
	Johnston, Kelvin		15:19:34			15:19	:36	19:14		00:02		3:54:54		:54:56
	Pritchard, Erie		15:22:50			15:23	7000	17:0		00:15		1:38:05		:38:20
LPVFD			15:24:03	15	:36:56			10:53		N/A		N/A		√A
	Landaverde, Fran	klin	15:25:27			15:25	:32	18:33		00:05		3:07:20		:07:25
NORA4	Marsh, Andrew		15:50:04					18:5				N/A		:04:34
	iviaisii, Andrew			21	45:58	22:42	:40	23:2		4:43:10		39:07		:22:17
LINCI	and the second second		17:59:30			20:51		00:42		1:53:50		3:50:13		:44:03
LINCI PAULII	Bradley, Reuben Rogers, Steve		18:58:04	20	25:28	-0.0.		20:0		AT/A		N/A		1:24
LINCI PAULII PAUL34	Bradley, Reuben				:25:28	20.0.		20.0	1.05	N/A				
LINCI PAULII PAUL34 ADAM2	Bradley, Reuben Rogers, Steve		18:58:04			21:23	:28	00:43		N/A 1:16:19		3:19:30		:35:49
LINCI PAUL11 PAUL34 ADAM2 ADAM2	Bradley, Reuben Rogers, Steve Hollowell, Jeff		18:58:04 20:05:41	20					2:58				4	
LINCI PAUL11 PAUL34 ADAM2 ADAM2	Bradley, Reuben Rogers, Steve Hollowell, Jeff Hollowell, Jeff		18:58:04 20:05:41 20:07:09	20 21	:06:00	21:23	:49	00:43	2:58 7:54	1:16:19		3:19:30	4	:35:49
PAUL11 PAUL34 ADAM2 ADAM2 CHRLS3 PAUL9	Bradley, Reuben Rogers, Steve Hollowell, Jeff Hollowell, Jeff Connolly, Chris		18:58:04 20:05:41 20:07:09 21:23:12	20 21 21	:06:00	21:23 22:42	:49	00:42 23:2	2:58 7:54 5:35	1:16:19 1:19:37		3:19:30 45:05	4 2 3	:35:49 ::04:42
PAUL11 PAUL34 ADAM2 ADAM2 CHRLS3 PAUL9	Bradley, Reuben Rogers, Steve Hollowell, Jeff Hollowell, Jeff Connolly, Chris Walston, Chris		18:58:04 20:05:41 20:07:09 21:23:12 21:47:48	20 21 21 06	:06:00 :23:19 :47:57	21:23 22:42	:49	00:42 23:22 00:53	2:58 7:54 5:35 2:03	1:16:19 1:19:37 52:21		3:19:30 45:05 2:15:26	4 2 3 4	:35:49 ::04:42 ::07:47
LINC1 PAUL11 PAUL34 ADAM2 ADAM2 CHRLS3 PAUL9 ADAM2 2201	Bradley, Reuben Rogers, Steve Hollowell, Jeff Hollowell, Jeff Connolly, Chris Walston, Chris		18:58:04 20:05:41 20:07:09 21:23:12 21:47:48 06:48:36	20 21 21 06	:06:00 :23:19 :47:57 :48:44	21:23 22:42	:49	00;43 23:2 00;5; 10:53	2:58 7:54 5:35 2:03 6:45	1:16:19 1:19:37 52:21 N/A		3:19:30 45:05 2:15:26 N/A	4 2 3 4 3	:35:49 :04:42 :07:47 :03:27

Incident Comments

Celiular E911 Call:

Lat:37.45339 Lon:-118.58365

Service Class: WPH2 brush fire, lines down, talbot ranch on old sherwin rd, structures threatened, high winds

n.		1
Pa	ge	2

TIME	#	EVENT	BY
14:05:23	1 1	Ineident initiated at Talbot Raneh Area/, Rndvly	K. Frew
14:05:23	2	Unverified location: Talbot Ranch Area/,	K. Frew
14:05:49	3	PAUL12 DISP. Talbot Ranch Area/, Rndvly	K. Frew
14:05:50	4	PAUL2 DISP. Talbot Ranch Area/, Rndvly	K. Frew
14:06:29	5	PAUL12 ENRT.	K. Frew
14:06:43	6	2164 ENRT. Talbot Ranch Area/, Rndvly	K. Frew
14:07:24	7	PAUL2 ENRT.	K. Frew
14:07:35	8	SAM2 DISP. Talbot Ranch Area/, Rndvly	K. Frew
14:07:39	9	SAM2 ENRT.	K. Frew
14:12:22	10	mono county requesting paradise volunteers for mutual aid	K. Frew
14:13:00	11	cal fire sending BC, dozer, 2 eng, crew	K. Frew
14:13:19	12	byfd responding	K. Frew
14:14:25	13	ADAM2 DISP. Talbot Ranch Area/, Rndvly	K. Frew
14:14:23	14	ADAM2 ENRT.	K. Frew
	15	w wind, 5 acre, rapid spread, several structures threatened	K. Frew
14:15:15		visibility is an issue on 395	K. Frew
14:15:46	16	A SECOND CONTRACTOR AND ADDRESS OF THE PROPERTY OF THE PROPERT	1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2
14:16:06	17	fire has jumped 395	K. Frew
14:16:22	18	winds at 10mph, gusts of 30-40 mph	K. Frew
14:16:46	19	PAUL12 10-97.	K. Frew
14:16:46	20	neg paradise evac at this time	K. Frew
14:17:04	21	ADAMI DISP. Talbot Ranch Area/, Rndvly	K. Frew
14:17:15	22	ADAM1 ENRT.	K. Frew
14:18:12	23	sam 2 req paul 15 early	K. Frew
14:19:01	24	paul12 checking residence down dirt d/w	K. Frew
14:23:54	25	PAUL2 10-97.	K. Frew
14:23:56	26	visibility on 395 manageable at this time	K. Frew
14:24:01	27	SAM2 10-97.	K. Frew
14:29:04	28	chp reqstd for traffic control on lwr rck crk rd at gorge rd	K. Frew
14:31:26	29	2164 10-97.	K. Frew
14:31:31	30	2164 10-6.	K. Frew
14:32:15	31	PAUL12 10-6.	K. Frew
14:32:18	32	SAM2 10-6.	K. Frew
14:32:46	33	PAUL2 10-6.	K. Frew
14:34:26	34	cng 32, patrol 32	K. Frew
14:34:56	35	are 97	K. Frew
14:36:51	36	LINC3 DISP. Talbot Ranch Area/, Rndvly	K. Frew
14:36:55	37	LINC3 10-97.	K. Frew
14:38:27	38	LINC3 10-6.	K. Frew
14:40:15	39	PAUL19 DISP. Talbot Ranch Area/, Rndvly	K. Frew
14:40:28	40	PAUL19 ENRT.	K. Frew
14:40:51	41	closures rgstd to road dept	K. Frew
14:46:03	42	SAM2 10-6. N END PARADISE	K. Frew
14:46:25	43	forestry has n end closed	K. Frew
14:48:40	44	mono s.o. enrt to paradise	K. Frew
	45	paul2 at conty line, fire jumped twrd disposal ctr	K. Frew
14:49:04			K. Frew
14:49:05	46	North shift of fire to disposal site into Mono Co.	26223.000 9234007
14:49:34	47	LPG tank in Waste transfer site	K. Frew
14:53:27	48	ADAMI 10-97.	K. Frew
14:54:45	49	evac started for paradise	K. Frew
14:55:17	50	several units from meso enrt	K. Frew
14:56:44	51	Paul II change to North per Sam3.	K. Frew
14:58:26	52	ADAM2 ENRT. PARADISE	K. Frew
14:59:09	53	PAUL19 10-97.	K. Frew
15:00:10	54	PAUL19 ENRT. PARADISE	K. Frew
15:00:10	55	CHP to assit with evac on Westridge Rd	K. Frew
15:00:24	56	PAUL12 10-6. PARADISE EVAC	K. Frew
15:00:55	57	icso x 7 working paradise evac	K. Frew

TIME	#	EVENT	BY
15:05:24	1	SAM3 DISP. Talbot Ranch Area/, Rndvly	K. Frew
15:05:26	2	SAM3 ENRT.	K. Frew
15:05:35	3	MSCO to call adam2 asap	K. Frew
15:09:18	4	adam2, sam3, adam1 comming in from Toms to evac paradise	K. Frew
15:11:28	5	Sam2 starting evac Westridge Rd at paradise Rd	K. Frew
15:13:17	6	SAM3 10-97. AREA	K. Frew
15:13:35	7	bpvfd dispatched for mutual aid	K. Frew
15:13:43	8	BPVFD DISP. Talbot Ranch Area/, Rndvly	K. Frew
	9		K. Frew
15:14:09		bpvfd paged	100,000,000,000
15:15:24	10	PAUL17 DISP. Talbot Ranch Area/, Rndvly	K. Frew
15:15:30	11	PAULI7 ENRT.	K. Frew
15:15:49	12	IVFD DISP. Talbot Ranch Area/, Rndvly	K. Frew
15:16:24	13	2201 is 10-8	K. Frew
15:19:34	14	DAVID1 DISP. Talbot Ranch Area/, Rndvly	K. Frew
15:19:36	15	DAVID1 10-97.	K. Frew
15:20:07	16	ADAM2 10-6. PARADISE FIRE DEPT	K. Frew
15:21:49	17	BPVFD ENRT.	K. Frew
15:21:53	18	IVFD ENRT.	K. Frew
15:22:50	19	LINC2 DISP. Talbot Ranch Area/, Rndvly	K. Frew
15:23:05	20	LINC2 10-97. WITH LINC 3	K. Frew
The second second second	21		K. Frew
15:24:03		LPVFD DISP. Talbot Ranch Arca/, Rndvly	
15:24:16	22	DAVIDI 10-6.	K. Frew
15:24:59	23	PAUL 17 ENRT. PARADISE FIRE STATION	K. Frew
15:25:05	24	SAM3 10-6.	K. Frew
15:25:27	25	NORA4 DISP. Talbot Ranch Area/, Rndvly	K. Frew
15:25:32	26	NORA4 10-97.	K. Frew
15:26:05	27	NORA4 ENRT. PARADISE FIRE STATION	K. Frew
15:27:20	28	BPVFD ENRT. I STRUCTURE, I TENDER	K. Frew
15:27:44	29	mono phone lines down, inyo taking 911 calls	K. Frew
15:32:40	30	call sign for mutual aid	K. Frew
1210-111	31	bpvfd engine 2312 tender 2313	
	32	ivfd engine 2215	
	33	lpvfd 2430	
15:36:02	34	PAUL17 10-6.	K. Frew
	140		K. Frew
15:36:11	35	2164 10-8.	
15:36:22	36	ADAM1 10-6.	K. Frew
15:36:36	37	LINC2 10-6.	K, Frew
15:36:44	38	PAUL19 10-97.	K. Frew
15:36:50	39	PAUL19 10-6.	K. Frew
15:36:56	40	LPVFD ENRT.	K. Frew
15:41:58	41	SAM2 10-6. FOR FUEL	K. Frew
15:42:28	42	Ip tender dispatched	K. Frew
15:50:04	43	LINCI DISP. Talbot Ranch Area/, Rndvly	K. Frew
15:50:16	44	LINCI 10-6. LATE ENTRY	K. Frew
15:56:24	45	Fire approaching residences with LPG tanks	K. Frew
10.50.27	46	Parties refusing to leave	AM NAMED
16:01:32	47	Swall Meadows to be evac	K. Frew
		All units to clear out of the lower end of the fire.	K. Frew
16:01:58	48		K. Frew
16:10:25	49	code red message sent	N 10 Hz. W
16:10:48	50	code red for swall meadows evacuation	K. Frew
16:16:46	51	Confirmed mandatory evac swall meadows.	K. Frew
16:20:48	52	PAUL19 TSPRT. 1 X TO ROCK CREEK RD 719	K. Frew
16:21:05	53	PAUL2 ENRT. SWALL MEADOWS	K. Frew
16:27:24	54	PAUL2 10-6.	K. Frew
16:30:40	55	Per Paul 17 refusal to leave 101 Mountain View Swall Vaughan Res	K. Frew
16:32:27	56	IVFD 2215 on scene	K. Frew
16:43:41	57	per paul 17: refusal to leave 87 Min View	K. Frew
19110114	1 -	First Frank a transformation to secure the first transformation of the secure to the s	and the second s

TIME	#	EVENT	BY
16:44:35	1	per paul 17 group of people on back road Swall Meadows attempting to return	K. Frew
16:45:13	2	NORA4 10-6.	K. Frew
16:48:06	3	PAUL19 10-6.	K. Frew
16:48:18	4	per chp 59 valley view refusing to evac	K. Frew
17:00:58	5	sam 2 reqst all patrol units 98 on pine crk rd	K. Frew
17:01:10	6	LINC2 10-8.	K. Frew
17:32:57	7	13-39 paul 10	K. Frew
17:33:06	8	message left for paul 18	K. Frew
17:59:30	9	PAUL11 DISP. Talbot Ranch Area/, Rndvly	K. Frew
17:59:37	10	PAULI1 10-6.	K. Frew
18:07:35	11	PAUL2 10-6. BIRCHIM RD	K. Frew
18:07:41	12	PAUL17 10-6. N RV RD & BIRCHIM LANE	K. Frew
18:07:48	13	SAM2 10-6. BIRCHIM	K. Frew
18:07:56	14	PAUL11 10-6. BIRCHIM	K. Frew
18:08:03	15	PAUL19 10-6. N RV RD & BIRCHIM	K. Frew
18:11:10	16	SAM3 10-8.	K. Frew
18:14:38	17	Linc1 regnest reserves to respond for security purposes	K. Frew
18:19:34	18	ADAM2 ENRT. FUEL	K. Frew
18:32:52	19	NORA4 10-8.	K. Frew
18:35:23	20	PAUL19 10-8.	K. Frew
18:38:16	21	ADAM2 10-6.	K. Frew
18:54:38	22	LINC1 10-8.	K. Frew
18:57:04	23	paul34	K. Frew
18:58:04	24	PAUL34 DISP. Talbot Ranch Area/, Rndvly	K. Frew
19:14:17	25	SAM2 10-8.	K. Frew
19:14:30	26	DAVID1 10-8.	K. Frew
19:14:45	27	PAUL12 10-8.	K. Frew
19:14:49	28	PAULI7 10-8.	K. Frew
19:59:43	29	ADAM2 10-8.	M. Marsh
20:03:45	30	LINC3 10-8.	M. Marsh
20:05:41	31	ADAM2 DISP. Talbot Ranch Area/, Rndvly	M. Marsh
20:06:00	32	ADAM2 ENRT. N RV AND BIRCHIM LANE	M. Marsh
20:07:05	33	ADAM2 10-8. Freed	K. Frew
20:07:09	34	ADAM2 DISP. Talbot Ranch Area/, Rndvly	K. Frew
20:07:12	35	ADAM2 10-6.	K. Frew
20:25:28	36	PAUL34 ENRT.	M. Marsh
20:51:54	37	PAUL34 10-97. BIRCHIM & N RV RD	M. Marsh
20:58:55	38	salvation army in bishop opening for shelter, food, beverage, etc	K. Frew
21:22:58	39	need codered for Rock Creek Lake area & Lodge,	M. Marsh
21:23:08	40	PAUL2 ENRT. ROCK CREEK	M. Marsh
21:23:12	41	CHRLS3 DISP. Talbot Ranch Area/, Rndvly	M. Marsh
21:23:19	42	CHRLS3 ENRT. ROCK CREEK	M. Marsh
21:23:28	43	ADAM2 10-97. ROCK CREEK	M. Marsh
21:40:08	44	CODE RED ISSUED FOR ROCK CREEK AREA	M. Marsh
21:45:06	45	ADAM1 ENRT. ROCK CREEK	M. Marsh
21:45:58	46	PAUL 11 ENRT. ROCK CREEK FOR EVAC NOTICE	M. Marsh
21:46:55	47	CHRLS3 10-6. TOMS PLACE	K. Frew
21:47:22	48	PAULII ENRT. RCK CRK LODGE	K. Frew
21:47:47	49	PAUL2 ENRT. RCK CRK LODGE	K. Frew
21:47:48	50	PAUL9 DISP. Talbot Ranch Area/, Rndvly	M. Marsh
21:47:57	51	PAUL9 ENRT. ROUND VALLEY	M. Marsh
	52	code red for rock creek unsuccessful	K. Frew
21:50:34	53	Mono Connty issuing Code Red evac advisory for Sunny Slopes	K. Frew
21:56:16			K. Frew
22:03:20	54	Chp closing 395: SB at Toms Place, NB at Gorge Rd	K. Frew
22:23:48	55	PAUL 1 10-6.	K. Frew
22:23:51	56	PAUL2 10-6.	K. Frew
22:23:59	57	ADAMI 10-6.	IX. I ICW

TIME	ш	EVENT	DV
TIME	#	EVENT	BY
22:40:09	1	PAUL9 10-97.	M. Marsh
22:42:40	2	PAUL 11 10-97. TOM'S PLACE	M. Marsh
22:42:49	3	CHRLS3 10-97. TOM'S PLACE	M. Marsh
23:21:47	4	PAUL 11 10-8.	M. Marsh
23:22:12	5	PAUL2 ENRT. BIRCHIM & ROUND VALLEY RD	M. Marsh
23:27:54	6	CHRLS3 10-8.	M. Marsh
[02/07/2015]		Intell diplet Sent	24500 St 20 10
00:26:03	7	Hwy 395 is open	M. Marsh
00:42:07	8	PAUL34 10-8.	M. Marsh
00:42:58	9	ADAM2 10-8.	M. Marsh
00:53:48	10	PAUL2 10-8 Disposition AO	M. Marsh
00:53:53	11	ADAMI 10-8 Disposition AO	M. Marsh
00:55:35	12	PAUL9 10-8 Disposition AO	M. Marsh
05:51:42	13	BPVFD 10-6.	K. Frew
05:51:44	14	IVFD 10-6.	K. Frew
05:51:48	15	LPVFD 10-6.	K. Frew
06:48:36	16	ADAM2 DISP. Talbot Ranch Area/, Rndvly	K. Frew
06:48:44	17	ADAM2 ENRT. CAMP 26	K. Frew
06:49:23	18	ADAM2 10-6. CAMP 26	K. Frew
07:00:14	19	2201 DISP. Talbot Ranch Area/, Rndvly	K. Frew
07:00:19	20	2201 ENRT.	K. Frew
07:56:25	21	PAUL12 DISP. Talbot Ranch Area/, Rndvly	K. Frew
07:56:33	22	PAUL12 10-6.	K. Frew
08:53:12	23	PAUL12 Case number 15-02-021 assigned to 1502060023	K. Frew
08:54:51	24	ADAM2 10-6. SWALL MEADOWS	K. Frew
09:04:24	25	IVFD RETURN.	K. Frew
09:04:24	26	2201 10-6.	K. Frew
09:04:32	27	LPVFD RETURN.	K. Frew
			K. Frew
10:24:57	28	LPVFD 10-6. STATION	1.00 0.000 0.000 0.000 0.000
10:45:47	29	IVFD 10-8 Disposition AO	K. Frew
10:46:45	30	2201 10-8 Disposition AO	K. Frew
10:52:03	31	ADAM2 10-8 Disposition AO	K. Frew
10:53:15	32	LPVFD 10-8 Disposition AO	K. Frew
11:10:40	33	BPVFD RETURN.	K. Frew
12:18:33	34	BPVFD 10-8 Disposition AO	K. Frew
13:02:22	35	PAUL12 10-8. Freed	K. Frew
13:02:22	36	PAUL12 Incident returned to pending status	K. Frew
13:33:21	37	PAUL12 DISP. Talbot Ranch Area/, Rndvly	K. Frew
13:33:30	38	PAUL 12 10-6. FOLLOW UP	K. Frew
			1
			i i
	1 1		

10.3 - LE-71 Supplemental Report SMITH



SUPPLEMENTARY INVESTIGATION REPORT

STATE OF CALIFORNIA
DEPARTMENT OF FORESTRY AND FIRE PROTECTION
LE 71 (REV. 7/2011)

INCIDENT NUMBER

15CABDU001662

CASE NAME

ROUND

UNIT CASE NUMBER

							NOOND
DAY	MONTH	DATE	YEAR	COUNTY	REGION	UNIT	CASE NUMBER
Fri	Feb	6	2015	Inyo	CSR	BDU	15CABDU001662

On February 10, 2015, at approximately 2:00 PM, while assigned to the Round Fire as a fire investigator, Fire Captain Specialist Brian TOMINAGA assigned me to obtain witness statements from Donald PEREA. PEREA handed TOMINAGA a written statement that PEREA wrote.

4 5

6

7

8

9

10

11

12

14

15

16

17

18

19

20

21

22

23

24

25

26

27

I met with PEREA, who I identified by his CDL, at approximately 2:37 PM, at his home located at County of Invo. PEREA resides about a guarter of a mile northwest from the ignition area. Fire Captain Specialist Kelly GALLAHER attended the interview as well. PEREA walked me to his back patio where he first saw the fire. PEREA told me he was working on his property and noticed the wind started to blow around 10:00 AM. At about 12:30 PM, PEREA told me the wind conditions worsened to the point where PEREA could no longer work in, PEREA began to eat lunch at about 1:30 PM, when he noticed strong gusts of wind rattle the house. PEREA went out back and tied down his patio furniture and spa cover. PEREA noted the wind was a south wind. At about 1:45 PM, PEREA was inside his home and looking south through his glass rear door. PEREA saw a bright flash of light off to the left or southeast area. PEREA looked back at his kitchen light and realized the electrical power went out. PEREA turned back and then noticed a small fire burning in the open pasture approximately 1200' to 1500' southeast of him. PEREA described this fire to be small with about two (2) foot flame lengths. Within seconds PEREA noticed the fire grew substantially and the fire was then producing about "10' to 12', if not more", vertical flame lengths. PEREA told me the dry grass in the pasture was about six (6) inches or less. PEREA also told me the wind was extremely strong to about the strongest he had felt in the 30 plus years he had lived in the area. PEREA set up his spotting scope to the location he believed he first saw a fire. I observed this area through the spotting scope and noticed he placed the fire at about Edison Pole # 1854105E, which was the third pole west of the home located at 2164 Old Sherwin Road. The ignition area was later determined to be to the west of the home located at 2164 Old Sherwin Road. There were two (2), 12KV power lines routing east and west through this pasture; one (1) north power line and one (1) south power line. PEREA attempted to call 911, but was not able to connect the call.

OFFICERS INITIALS

- 1 PEREA drove his pickup to the home located at 2164 Old Sherwin Road to help evacuate. PEREA
- drove west on the dirt driveway, did not observed any fire on the south side of the house, and parked
- on the east side of the home. PEREA told me as he ran across the foot bridge towards the front
- 4 door, which was on the east side of the home, when he observed the entire backyard "engulfed in
- 5 flames." PEREA only saw fire on the north side of the house, but never walked around the
- 6 residence. PEREA described "all the trees" between both ranches were engulfed in flames. PEREA
- 7 discovered no one was home. PEREA called 911 again at 2:02 PM, and was able to report the fire.
- 8 PEREA left the property and returned home to provide protection against the flames. PEREA told me
- 9 he drove through walls of fire along Old Sherwin Road. The fire was on both sides of the road and
- moving in a northwest direction. PEREA told me the pastures burned later in the incident and after
- 11 the main fire passed his house.

12

- 13 PEREA walked GALLAHER and I to the spot he first saw a fire. PEREA walked us to about 50' north
- 14 of the third power pole as mentioned above. I noted the south power line lying on the ground
- 15 between the Edison Pole #1854106E and Edison Pole #1854105E, but the power line remained
- attached to both poles. The section of power line lying on the floor was about 85'. PEREA told me he
- 17 only saw one fire and it was at the location we were standing. PEREA could not correlate the bright
- flash of light to the location he saw a fire start. I looked back towards PEREA's home and noticed a
- 19 culvert between us and the home. PEREA described the culvert was overgrown with trees, brush,
- 20 and wild rose bushes. I noticed the burned trees stood taller than PEREA's house when looking
- 21 northwest from my position.

22

- 23 Continued Investigation:
- 24 On Wednesday, February 11, 2015, I examined the burned wild land fuels in the area where PEREA
- 25 indicated he saw a fire start. I noted the brown grass was about two (2) inches to six (6) inches, I
- took photographs illustrating the fire pattern which indicated the fire's forward movement came from
- 27 the southeast, east direction. More specifically, the majority of the individual indicators illustrated the
- 28 fire moved towards, not away from, the area PEREA saw a fire start. The burn indicators showed low
- in and high out, cupping, white ash, and protection, refer to photographs P-BS-01 through P-BS-15.

30

- 31 On Wednesday, February 11, 2015, at about 09:30 AM, TOMINAGA assigned me to document and
- 32 collect the materials or evidence involved in the ignition of the fire. Fire Captain Specialist Shannan
- HARRIS and GALLAHER, and Battalion Chief Jennifer RICCI assisted me in marking, labeling, and

1 collecting the evidence. I assigned RICCI to complete the evidence log and property receipt as we 2 collected each item. Previously, TOMINAGA assigned HARRIS to conduct the fire's origin and cause

investigation and GALLAHER was assigned to photograph. HARRIS identified the Specific Origin

- 4 Area (SOA) and the potential ignition source, the power lines, found within. HARRIS told me two (2),
- 5 12KV power lines were lying beneath an approximately 70' tree in the SOA. I also observed the
- 6 power lines and the down tree. The two power lines routed east and west and terminated behind the
- 7 home located at 2164 Old Sherwin Road. HARRIS had marked evidence and items of interest one
- 8 (1) through seven (7). HARRIS used his evidence markers for labeling. I walked the GOA and the
- 9 SOA while HARRIS showed me each item he marked. HARRIS told me items two (2) through five
- 10 (5) are photographed and not considered factors in the ignition sequence and therefore not
- 11 collected. I did not collect items 2 through 5. I assigned GALLAHER to photograph the process of
- 12 collection and preservation of evidence. Refer to her photographs.

14 TOMINAGA told me Edison Representatives would be accompanying me during the collection of

15 evidence. TOMINAGA told me they would be observing and photographing the evidence collected. I

was introduced to three (3) Edison Representatives by their first name only; Greg, Scott, and Tom.

Tom told me he was Edison's fire investigator. Greg and Scott told me they were Edison's claims

investigators.

13

16

17

19

21

22

25

27

29

31

32

20 At approximately 10:00 AM, I started to collect and tag each item collected. Having items labeled 1

through 7 already by HARRIS, I stated with evidence label #8. I identified the north power line as

item 8. However, the power line was not intact as it suffered significant arc and mechanical damage.

23 An approximately 70' tree collapsed on the two, 12KV power lines. The entire north power line

remained as item 8, but each section collected was given an alphabetical number as well (8a, 8b, 8c,

etc...). I identified the south power line as item 9. The south power line also suffered the same

damage. The entire south power line remained as item 9, but each section collected was given an

alphabetical number as well (9a, 9b, 9c, etc...). Greg, Scott, and Tom agreed to this system. I

28 started to collect items which were affixed to Edison Pole 1854107E. GALLAHER and an Edison

linesman were lifted up in a boom and bucket to disconnect the remaining power lines sections from

30 Edison Pole 1854107E. The entire first span, north power line was collected first. The entire first

span, south phase power line was collected second. Greg, Scott, and Tom agreed to this process as

well. The first span routed from Edison #1854107E to #1854106E. The first span of power lines suffered the most damage in and around the 70' tree. To preserve the damaged power lines as

- 1 much as possible, the power lines were cut using bolt cutters. Greg, Scott, and Tom all agreed to cut
- the power lines and they specifically designated or concurred to the cutting location. I labeled each end of power line with a corresponding number to ensure the ends will be matched up at a later date.
- The ends of the north power line (Items 8a thru 8e) were labeled 1 through 9. The ends of the south
- 5 power line (Items 9a thru 9g) were labeled 1 through 14.

6

- 7 The second span, north and south, was pulled and collected by Edison Linesman's after I collected
- 8 the first span. A small section of the first span, north power line was pulled and collected by Edison
- 9 linesman's as well. TOMINAGA stood and observed their process. I later took possession of the
- small section of the first span, north power line, and the second span of both north and south power
- 11 lines.

12

- 13 After collecting items 8 and 9, I returned to item 1 and 6 and 7. Items 6 and 7 were actually one item,
- 14 a tree branch, but the two numbers illustrated the burned marks on the branch. The tree was also cut
- 15 at sections were the power lines, telephone and cable lines and the tree rested on each other. The
- 16 tree sections were marked and collected as evidence item 10a, 10b, 10c, and 11. I then collected the
- telephone and cable lines as well. I labeled the telephone and cable lines as item 12a, 12b, 12c, and
- 12d.

19

- 20 HARRIS assigned me to use a magnet in the SOA in attempts to locate any ferrous metal. I did not
- 21 locate any ferrous metal.

22

- 23 ATTACHMENTS:
- A Photographs P-BS-01 thru P-BS-15
- 25 B –Donald PEREA's written witness statements

26 27

28

29 30

31

PRINTED NAME	SIGNATURE	BADGE NUMBER	DATE
Branden P Smith	SNO	3574	02/12/15

10.4 - LE-71 Supplemental Report GALLAHER



SUPPLEMENTARY INVESTIGATION REPORT

STATE OF CALIFORNIA
DEPARTMENT OF FORESTRY AND FIRE PROTECTION
LE 71 (REV. 7/2011)

INCIDENT NUMBER

15CABDU001662

CASE NAME

ROUND

UNIT CASE NUMBER

DAY	MONTH	DATE	YEAR	COUNTY	REGION	UNIT	CASE NUMBER
FRI	FEB	6	2015	Inyo	CSR	BDU	15CABDU001662

NARRATIVE:

On Sunday, February 8, 2015, at approximately 6:30 AM, I responded to the Round fire, near the community of Bishop, California.

At approximately 3:00 PM, I arrived on scene of the fire. Fire Captain Specialist Brian TOMINAGA assigned me to take photographs pertaining to the origin and cause investigation.

At approximately 3:45 PM, Fire Captain Specialist Shannan HARRIS and I flew in CAL FIRE Helicopter 305 (H305). I took photographs during the flight (see attachment #1 and #2; photographs P-KG-001 thru P-KG-033).

On Monday, February 9, 2015, at approximately 7:30 AM, I arrived near the origin of the fire. I observed the burn indicator flags previously placed by HARRIS and I concurred with his findings. I took a video of the GOA. The video is time stamped on February 9, 2015 at 8:57:42 AM. The date is correct although the clock was fast by 56 minutes. The approximate time the video was taken was at 8:01 AM. I took overall photographs of the general origin area (GOA). HARRIS and I systematically walked the GOA from advancing burn indicators, to lateral burn indicators and to backing burn indicators. I took photographs of burn indicators and the area pertaining to origin and cause investigation (see attachment #1 and #2; Photographs P-KG-034 thru P-KG-0216).

At approximately 1:00 PM, HARRIS and I flew in H305. I took photographs during the flight (see attachment #1 and #2; photographs P-KG-217 thru P-KG-237).

On Tuesday, February 10, 2015, at approximately 7:30 AM, I arrived near the origin of the fire. I took a photograph during a witness interview conducted by Officer Branden SMITH (see attachment #1 and #2; photograph P-KG-238).

On Wednesday, February 11, 2015, at approximately 7:25 AM, I arrived near the origin of the fire. At the direction of Fire Captain Specialist Branden SMITH, I assisted with evidence collection and took photographs throughout the evidence collection process (see attachments #1 and #2; photographs P-KG-239 thru P-KG-425).

ATTACHMENTS:

PRINTED NAME	SIGNATURE	BADGE NUMBER	DATE
Kelly L GALLAHER	Line	2712	2-12-2015

GALLAHER Case Photographs

Video on DVD-R

GALLAHER Thumbnail Photographs

0.5 - Inyo Sheriff Supplemental Report SCOTT	



760-878-0383

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 INFORMATION ONLY REPORT

Case 15-03-009

Page 1

0	Offenses Information Report	Description Information Re	eport				Fel/Misd	02/06/15-0		Unkn	Jee urred own		ent# 3030001	
S								Date Report 03/03/2015		Time I 0844	Reported			
OFFENSES								Related Cas	es					
OFF								Date Printed 03/04/2015		Time I 13:41	Printed:43	Print SSD	ed By	
								Latitude 0.000000		Longit 0.000				
	Location Talbot Ranch, 2180	Old Sherwin Rd,	Round Valley, (CA 93514		Beat 201	Area 200	Disposition Informatio	n Only				Date 03/2015	
	Location Type	Location of En	Method of	Entry	Point o	of Entry		Alarm Syste	m	Means	οΓAttac	k (Robb	ery)	
	Victim	1		Drivers	License		Cell Pho	ne	Email					
	Residence Address			Notified	of Viction	m Rights	Residence	e Phone	DOB		Age	Sex	Race	
	Business Name and A	ddress					Business	Phone	Height		Wt	Hair	Eyes	
	Assistance Rendered/	Victim Disposition					Transpo	rting Agency	Means	of Attack (Assaults)				
	Description of Injurie	s				_	Other In	formation			_			
\overline{a}	Contacted Beaver, Earlene Elizabeth Drivers License Cell Phone Email						***************************************							
	Residence Address	i					Residence	c Phone	DOB		Age	Sex Race		
	Business Name and A Browns Recycling,		ishop, CA 93514	4			Business 760-872		Height 5'8"		Wt 140	Hair BLN	Eyes BLU	
	Suspect Name		-0				Action T	aken	Charge	es				
	Residence Address						Residenc	e Phone	DOB		Age	Sex	Race	
	Business Name and A	ddress					Business	Phone	Height	8	Wt	Hair	Eyes	
	Identifying Features						Cell Pho	ne	Drivers	s Licens	e	Arrest	Number	
	Aliases					,								
VEHICLES	Status		Vehiele Make and	d Model			License/S	State	Vehicle	е Туре				
ES =	Prepared By SSS2 - Scott, Shane		Date 03/03/2015	Assisted B	у			Approved By SKJ1 - Johns	ton, Kel	vin		Date 03/03	/2015	
SPUTIES	Routed To Cal Fire	Date 03/04/20	Routed To		I	Date	Note	s				4		



INFORMATION ONLY REPORT

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526

760-878-0383

Case

Page 2

15-03-009

	Contacted Brown, Burt	Drivers License	Cell Phone	Email				
	Residence Address Brown's Salvage Yard, Bishop		Residence Phone	DOB	Age	Sex	Race	
	Business Name and Address		Business Phone	Height	Wt	Hair	Eyes	
	Contacted Hoersting, Cherie Leanne	Drivers License	Cell Phone	Email			_	
	Residence Address		Residence Phone	DOB	Age	Sex F	Race W	
	Business Name and Address Brown's Town, Hwy 395		Business Phone	Height 5'8"	Wt 155	Hair BLN	Eyes BLU	
	Contacted Mendiburu, Joseph Charles	Drivers License	Cell Phone	Email			· DEC	
	Residence Address		Residence Phone	DOB	Age	Sex M	Raee W	
	Business Name and Address Flying M Cattle Company, 397 S. Round Vall	ey Road, Bishop, CA 93514	Business Phone 661-979-2214	Height 5'10"	Wt 210	Hair BRO	Eyes GRN	
	Contacted Perea, Donald	Drivers Lieense	Cell Phone	Email				
	Residence Address		Residence Phone	DOB	Age	Sex M	Race X	
	Business Name and Address Talbot Ranch, 2180 Old Sherwin Road, Round	d Valley, CA 93514	Business Phone	Height 5'8"	Wt 165	Hair BRO	Eyes BRC	
	Contacted Schober. Walter	Drivers License	Cell Phone	Email	-			
	Residence Address		Residence Phone	DOB	Age	Sex M	Race	
	Business Name and Address	<u> </u>	Business Phone	Height 6'1"	Wt 220	Hair BRO	Eyes BRC	
	Contacted Talbot, William	Drivers License	Cell Phone	Email				
ì	Residence Address		Residence Phone	DOB	Age	Sex M	Raee	
	Business Name and Address		Business Phone	Height 5'11"	Wt 160	Hair	Eyes BLU	
	Mentioned Brown, Nicholas "Nick" Lloyd	Drivers Lieense	Cell Phone	Email				
	Residence Address		Residence Phone	DOB	Age	Sex M	Raee W	
	Business Name and Address Flying "M" Ranch, 395 S Round Valley Road,	, Bishop, CA 93514	Business Phone	Height 5'11"	Wt 180	Hair BRO	Eyes BRC	
	Mentioned Dobranzski, Nicole Louise	Drivers License	Cell Phone	Email	1	100		
	Residence Address	1	Residence Phone	DOB	Age	Sex F	Race	
	Business Name and Address Flying M Cattle Co		Business Phone	Height 5`4"	Wt 130	Hair BRO	Eyes BRC	



Case 15-03-009

Page 3

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 760-878-0383 INFORMATION ONLY REPORT

	Mentioned Flying M Cattle, Inc.	Drivers License	Cell Phone	Email					
	Residence Address	,	Residence Phone	DOB	Age	Sex	Race		
	Business Name and Address		Business Phone	Height	Wt	Hair	Eyes		
	Mentioned	Drivers License	Cell Phone	Email					
	Foot, Kami Residence Address		Residence Phone	DOB	Age	Sex	Race		
	Business Name and Address		Dunings Dhone	Malaka	Wt	F	Fire		
	Inyo County, Independence, CA 93526	100	760.878.0224	Height		Hair	Eyes		
	Mentioned Goodman, Bill	Drivers License	Cell Phone	Email					
	Residence Address		Residence Phone	DOB	Age	Sex M	Rac		
	Business Name and Address		Business Phone	Height	Wt	Hair	Eye		
	Mentioned Hollowell, Jeff	Cell Phone	Email						
	Residence Address		Residence Phone	DOB	Age	Sex	Rac		
	Business Name and Address Inyo County Sheriff's Department, 550 S. Clay S	St, Independence, CA 93526	Business Phone 760-878-0383	Height	Wt Hair		Eyes		
	Mentioned Jarvis, George Michael (Mickey)	Cell Phone	Email						
	Residence Address	-	Residence Phone	DOB	Age	Sex M	Rac		
	Business Name and Address Mendiburu Ranch, 395 Round Valley Rd S, Bis	hop, CA 93514	Business Phone 760-937-2381	Height 6'2"	Wt 210	Hair GRY	Eye		
	Mentioned Mendiburu, Danielle Louise	Drivers Lieense	Cell Phone	Email					
	Residence Address		Residence Phone	DOB	Age	Sex F	Rae		
	Business Name and Address Flying M Cattle Co. 325 Round Valley Road. B	ishop, CA 93514	Business Phone	Height 5'10"	Wt 135	Hair BRO	Eye		
	Mentioned Sparrow, Stacy Renee	Drivers Lieense	Cell Phone	Email					
ħ	Residence Address		Residence Phone	DOB	Age	Sex F	Rac		
	Business Name and Address Browns Millpound		Business Phone	Height 5'6"	Wt 115	Hair BLN	Eyes		
	Mentioned Drivers License Sparrow, Tyson		Cell Phone	Email					
	Residence Address		Residence Phone	DOB	Age	Sex M	Rae		
	Business Name and Address Aspen Construction, Benton, CA 93512		Business Phone 760-872-1342	Height	Wt	Hair	Eye		



760-878-0383

Page 4

Case 15-03-009

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 INFORMATION ONLY REPORT

Mentioned Talbot, Thomas Joseph	Drive	ers License	Cell Phone	Email					
Residence Address		V -	Residence Phone	DOB	Age	Sex M	Race		
Business Name and Address Bishop Vet Hospital, 1650	N Sierra Hwy, Bishop, CA 93514		Business Phone 760-873-5801	Height 5'10"	Wt 180	Hair BRO	Eyes BR(
Meutioned Weller, Dick	Drive	ers License	Cell Phone	Email			•		
Residence Address			Residence Phone	DOB	Age	Sex M	Race		
Business Name and Address	<u> </u>	-	Business Phoue	Height	Wt	Hair	Eyes		
Officer Involved Baldwin, Paul	Drive	ers License	Cell Phone	Email					
Residence Address			Residence Phone	DOB	Age	Sex	Race		
Business Name and Address Inyo County Sheriff Depar	rtment, 301 W Line St, Bishop, CA	93514	Business Phone 760-873-7887	Height	Wt Hair		Eyes		
Officer Involved Derr, Nate				Email					
Residence Address			Residence Phone	DOB	Age	Sex	Race		
Business Name and Address Inyo County Sheriff, 301	West Line Street, Bishop, CA 9351	4	Business Phone 760-873-7887	Height	Wt	Hair	Eyes		
Officer Involved Smith, Mark	Drive	ers License	Cell Phone	Email					
Residence Address			Residence Phone	DOB	Age	Sex	Race		
Business Name and Address Inyo County Sheriff's Dep	t, 726 North Main Street, Lone Pin	e, CA 93545	Business Phone 760-876-5606	Height	Wt	Hair	Eyes		
Officer Involved Tominaga, Brian	Drive	ers License	Cell Phone	Email					
Residence Address 3800 N. Sierra Way. San I	Bernardino, CA 93405		Residence Phone	DOB	Age	Sex M	Raee		
Business Name and Address Cal-Fire, 3800 N. Sierra V	√ay, San Bernardino, CA 92405		Business Phone	Height	Wt	Hair	Eyes		

NARRATIVE



550 SOUTH CLAY STREET INDEPENDENCE, CA 93526

760-878-0383

15-03-009

Page 1

Physical Evidence

(28) Twenty-eight digital photographs of the Talbot Ranch.

Two Compact Discs containing audio recordings of the 28 digital photographs, my interviews with Bill Talbot, Don Perea, Walt Schober, Joe Mendiburu, Earlene Beaver, and Bert Brown. I was unable to record my entire interview with Mendiburu due to my audio recorder malfunctioning. I was unable to record my interview with Cherie Hoersting due to my audio recorder malfunctioning.

Chain of Evidence

I downloaded the photographs and my interviews onto my computer and onto two Compact Discs. I attached one Compact Disc to this report to be forwarded to Cal-Fire Investigator Brian Tominaga. The second Compact Disc is and will remain with this case file.

Attachments

- (1) One Compact Disc
- (1) One page containing Mendiburu's visitation log from Sunday, February 1, 2015 to Sunday, February 15, 2015.
- (1) One Inyo County Sheriff's Department fax coversheet to Tominaga from Undersheriff Hollowell.
- (1) One Written Statement from Mendiburu

ICSD Case Number 10-05-026

ICSD Case Number 15-02-021

Details

On Wednesday, February 18, 2015, at about 1245 hours, Lieutenant Baldwin advised me Joseph Mendiburu who is currently incarcerated at the Inyo County Jail, wrote Jail Staff a note stating his girlfriend Cherie saw Mickey Jarvis and Nick Brown on the Talbot Ranch welding prior to the "Round Fire". Lieutenant Baldwin told me Cherie is claiming Jarvis and Brown started the fire due to them welding.

Lieutenant Baldwin assigned me to investigate Cherie's claim and advised me to contact CAL-Fire Investigator Brian Tominaga who was assigned to investigate the "Round Fire". Lieutenant Baldwin told me he did not know

Prepared E	Ву:	Date:	Approve	d By:	Date:
SSS2	SCOTT, SHANE	03/03/2015	SKJI	JOHNSTON, KELVIN	03/03/2015



550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 NARRATIVE

760-878-0383

15-03-009

Page 2

Cherie's last name.

I have knowledge of a land dispute between Mendiburu and his two sisters, Nicole Dobranzski and Danielle Mendiburu regarding the Flying M Cattle Ranch. I know Jarvis and Brown to work for the Flying M Cattle Ranch, (Refer to 10-05-026 for further information).

At about 1300 hours, I spoke to Tominaga on the telephone and asked him if he was aware of Cherie stating she saw Jarvis and Brown welding on the Talbot Ranch. Tominaga told me he was. I advised Tominaga, I was assigned to investigate Cherie's allegations. Tominaga told me through his investigation he determined the fire was caused by a tree behind a residence on the Talbot Ranch falling down on power lines due to the high winds. Due to Tominaga being out of the area, I advised him I would be in contact with him by telephone.

At about 1250 hours, I telephoned the Inyo County Jail and spoke to Corporal Smith. I asked Corporal Smith to check Mendiburu's visiting log and see if there was a Cherie who visited Mendiburu. Corporal Smith told me he was the one who Mendiburu gave the note to and he gave Mendiburu a written statement form which he filled out and returned to him. Corporal Smith advised me he gave Mendiburu's written statement to Undersheriff Hollowell.

Corporal Smith checked Mendiburu's visiting log and told me Cherie Hoersting visited Mendiburu on Sunday, February 1, 2015 and Sunday, February 15, 2015.

I reviewed Deputy Derr's report regarding the "Round Fire" and saw he briefly spoke to Walter Schober and Donald Perea who reside in two separate residence's on the Talbot Ranch, (Refer to Deputy Derr's Report, CR# 15-02-021 for further information).

Telephone Interview with Bill Talbot

On Thursday, February 19, 2015, at about 0818 hours, I spoke to Bill Talbot on the telephone. Bill and his brother, Tom Talbot both own the Talbot Ranch. I advised Bill, I was calling him to talk about the "Round Fire". I asked Bill who resides at the residence Jarvis use to live at (the north residence on the Talbot Ranch). Bill told resides at the residence. I asked Bill if Perea was doing any type of work with a welder the day of the fire. Bill told me Perea was not and Perea was inside of his residence at the time the fire started.

Bill told me the following in essence.

On Friday, February 6, 2015, sometime between 1330 hours and 1400 hours, he was driving to his ranch and from Pine Creek Road he saw smoke. The second residence south of the residence Jarvis use to live at is

Prepared By:	Date:	Approved By:	Date:
SSS2 SCOTT, SHANE	03/03/2015	SKJI JOHNSTON, KELVIN	03/03/2015



550 SOUTH CLAY STREET

INDEPENDENCE, CA 93526 76
NARRATIVE

760-878-0383

15-03-009

Page 3

currently occupied by Walt Schober. Schober was in town at the time of the fire.

He (Bill) got to the fire before any fire equipment arrived. I asked Bill where the fire started at, he told me "just north of Schober's house." Bill told me when he arrived the wind was blowing from the northwest from Pine Creek Canyon.

Bill told me Perea stated when his power went off he looked out and saw flames near Schober's residence. Perea went to Schober's residence and went into the residence to see if anyone was home, but there was not. I asked Bill if the fire appeared to be between the two residences, he told me it did. Bill told me it appeared the fire started near the power lines going to Schober's residence.

I asked Bill if he knows if Perea was welding prior to the fire starting. Bill told me Perea was not and he was in town when the fire started. I asked Bill if he has Jarvis and Brown do any work around his ranch. Bill told me they only help them with the cattle once a year. I asked Bill if there was a reason for Jarvis and/or Brown to be at either of the residence on his (Bill's) Ranch, he told me there would not. Bill told me Jarvis came to help fight the fire. I asked Bill as far as he knew Jarvis or Brown were not at either ranch house, he told me they were not. I asked Bill if anybody was welding the day of the fire, he told me there was not.

I asked Bill how far from Old Sherwin Road was the fire. Bill told me 200 to 300 yards from the road. Bill told me there was some discrepancy in where Perea thought the fire started and where Cal-Fire thought the fire started.

Bill Talbot did not have any further information and I ended my interview.

Telephone Interview with Don Perea

On Thursday, February 19, 2015, at about 1008 hours, I spoke to Don Perea on the telephone. I advised Perea, I was contacting him regarding the "Round Fire". I asked Perea if he remembers what day the fire started. Perea told me the following in essence.

On Friday, February 6, 2015, at about 1345 hours, he was standing in his dining room looking out his back patio windows. He saw a "flash" near what is known as "Diversion 40" his residence and Schober's residence in a pasture with a telephone pole in the pasture. The power went off at his residence and he saw flames in the pasture. He telephoned 911 and it did not go through.

He drove to Schober's residence to let them know about the fire. After they did not answer the door he went inside to make sure they were not there and to make sure their pets were not in the residence. As he looked to the back of the residence he saw the fire was on the north side of the creek that runs next to the residence. He called 911 again and reported the fire. As he was leaving a white truck pulled into Schober's driveway. The unknown driver of the white truck with a camper shell pulled up next to Bill Goodman's dump truck. He

Prepared By:	Date:	Approved By:	Date:
SSS2 SCOTT, SHANE	03/03/2015	SKJ1 JOHNSTON, KELVIN	03/03/2015



550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 NARRATIVE

760-878-0383

15-03-009

Page 4

believes the unknown male moved Goodman's dump truck because it was no longer on Schober's property.

He went back to his residence, driving through flames. While driving back to his residence Bill Talbot called him and he told Bill about the fire. I asked Perea if anyone was working at the ranch at the time of the fire, he told me, "No". I asked Perea what he was doing prior to the fire. Perea told me he and Dick Weller were loading scrap metal into a roll off bin near the main hay barn which is located on the north end of the property.

When the wind picked up they stopped and Weller left. When Weller left he (Perea) went inside of his residence to eat lunch and that was when he saw the "flash" and the fire. I asked Perea if anyone else was there, he told me, "No". I asked Perea if he saw anyone at Schober's, he told me, "No".

I asked Perea if he saw Nick Brown or Mickey Jarvis on the property. Perea told me long after the fire started Jarvis and Brown came over with a water tank and pump in the back of Jarvis' truck to help fight the fire at the hay barn. I asked Perea if he saw them prior to the fire, he told me, "No". I asked Perea if Brown and Jarvis were welding on the Talbot Ranch, he told me, "No". Perea told me he and Weller were the only one out there the day the fire started. I asked Perea if he saw anyone at Schober's residence from his residence, he told me, "No".

Lasked Perea not to discuss this investigation with anyone, he agreed. Perea told me he has heard stories about how the fire started. I asked Perea what he heard. Perea told me he heard the fire was started by tree's falling on power lines and arching power lines. I asked Perea if he had heard of anyone actually starting the fire, he told me he did not.

I asked Perea what the distance was from his residence to where he saw the "flash" and the fire starting. Perea estimated the distance to be between 300 to 400 yards.

Perea did not have any further information and I ended my telephone interview.

Telephone Interview with Walt Schober

On Thursday, February 19, 2015, at about 1033 hours, I spoke to Walt Schober on the telephone. I advised Schober, I had some questions regarding the "Round Fire". I asked Schober if he was at his residence when the fire started.

Schober told me the following in essence.

On Friday, February 6, 2015, at about 0830 hours, he and his wife left their residence to take their dog to the groomer. They returned at about 1000 hours.

At about 1300 hours, he and his wife left their residence to pick up their dog from the groomer. They went to

Prepared By:	Date:	Approved By:	Date:
SSS2 SCOTT, SHANE	03/03/2015	SKJI JOHNSTON, KELVIN	03/03/2015



550 SOUTH CLAY STREET INDE

INDEPENDENCE, CA 93526 760-87 NARRATIVE

60-878-0383

15-03-009

Page 5

the hardware store and began driving back to their residence. Emergency vehicles began to pass him.

I asked Schober if anyone was at his residence while he was away, Schober told me there was not. I asked Schober if he or anyone else were at his residence working outside, he told me there were not. I asked Schober if Brown or Jarvis might have been at his property doing any type of work, he told me they were not. Schober told me he heard Brown and Jarvis were trying to fight the fire with a water tank in the back of a truck to save the hay stack.

I asked Schober if Brown or Jarvis have done any type of work on the Talbot Ranch within the past 6 months. Schober told me he would not know because he no longer ranches and referred me to contact Talbot's.

I asked Schober what he saw when he returned to his residence. Schober told me he saw flames and fireman fighting the fire. He spoke to an unknown fireman and asked if a tree fell onto the power lines. The unknown fireman told him, "Yes". He did not see the fallen tree or the fallen power lines. I asked Schober how close the fire was to his residence. Schober told me it was about 50 feet.

I advised Schober, I might be coming onto his property within the next couple of days and told him I would contact him when I do.

Schober did not have any further information and I ended my telephone interview.

On Thursday, February 19, 2015, at about 1145 hours, Deputy Derr and I went to Schober's residence located at Deputy Derr showed me where Cal-Fire Investigators believe the fire started. I placed a yellow colored fire jacket on the tree that was suspected of falling due to the high winds that fell onto the power lines and photographed the area.

At about 1211 hours, I went to Perea's residence located at asked Perea if I could take photographs from where he was at when he saw the flash and the fire. Perea agreed and escorted me to the inside of his residence. We went in the back door to the dining room area. Perea showed me where he was standing and showed me the direction where he saw the flash and the fire start. I took photographs of the area.

Telephone Interview with Joe Mendiburu

On Friday, February 20, 2015, at about 0830 hours, I spoke to Joe Mendiburu on the telephone. Mendiburu was in custody at the Inyo County Jail. I told Mendiburu, I heard he might know something about the "Round Fire". Mendiburu told me he does and told me the following in essence.

His girlfriend, Cherie Hoersting, who is Nick Brown's cousin, told him on the day the fire started Brown and

Prepared By:	Date:	Approved By:	Date:
SSS2 SCOTT, SHANE	03/03/2015	SKJI JOHNSTON, KELVIN	03/03/2015



550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 NARRATIVE

15-03-009

Page 6

Jarvis were cutting scrap metal and that is how the fire started. I asked Mendiburu if he knows any details regarding where and the time frame. Mendiburu told me to contact Hoersting for additional information.

I asked Mendiburu where Hoersting heard this information. Mendiburu told me Weller went into Brown's Supply and told Hoersting's mother, Earlene Beaver.

Mendiburu did not have any further information and I ended my telephone interview.

On Friday, February 20, 2015, at about 0835 hours, I telephoned Hoersting and left a message for her to contact me.

On Friday, February 20, 2015, at about 0922 hours, I went to Brown's Supply in an attempt to contact Beaver and Hoersting.

Interview with Earlene Hoersting and Burt Brown

I asked Burt if Cherie was in, Burt told me Cherie was usually at Brown's Campground. Earlene told me Cherie should be working at Millpond today. I told Earlene, I needed to talk to her (Earlene) too, about the fire in Round Valley.

I asked Earlene if Weller came in on February 6, 2015, she told me Burt knows more about Weller coming in. I asked Earlene and Burt what Weller told them about the fire. Earlene and Burt told me the following in essence.

About a week prior to the fire they took a scrap metal bin to the Talbot Ranch. Sometime after the fire during the following week, Weller came in. Weller told them he was out working with Perea on the Talbot Ranch cleaning up scrap metal. The wind began blowing really bad and he left. Weller told them what Perea told him about how the fire started. Weller didn't say anything about Nick Brown or Jarvis being out there helping them.

I asked Earlene if she told Cherie about Weller coming in and telling them about the fire. Earlene told me she may have told Cherie about Weller coming in. I told Earlene and Burt about Cherie claiming Nick and Jarvis being out on Talbot's Ranch cutting scrap metal. Earlene told me Cherie knew they took a scrap metal bin to the Talbot's Ranch, but they did not know anything about Nick and Jarvis.

While at Brown's Supply, Earlene called Cherie and told her, I needed to talk to her. I spoke to Cherie on the telephone and told her to call me at my Office, Cherie agreed.

Earlene and Burt did not have any further information and I ended my interview.

Prepared By:	Date:	Approved By:	Date:
SSS2 SCOTT, SHANE	03/03/2015	SKJ1 JOHNSTON, KELVIN	03/03/2015



550 SOUTH CLAY STREET

INDEPENDENCE, CA 93526 NARRATIVE

760-878-0383

15-03-009

Page 7

At an unknown time after I returned to my Office, I received a telephone call from Earlene. Earlene told me she did tell Cherie what Weller told them, but nothing was said about Nick or Jarvis. Earlene told me her other daughter, Kami (Foot) heard something from someone who came into her Office, but she did not know any further.

I ended my telephone conversation with Earlene.

Telephone Interview with Cherie Hoersting

On Friday, February 20, 2015, at about 1100 hours, I telephoned Cherie on her cellular telephone. I advised Cherie, I spoke to Mendiburu about the fire in Round Valley and he stated I should talk to her. I asked Cherie what she knows about the fire. Cherie told me she knows a scrap metal bin was placed on the Talbot Ranch and she heard Nick and Jarvis caused the fire due to them cutting scrap metal. I asked Cherie how she knows this information, she told me someone told her. I asked Cherie who told her, she told me she did not know.

I told her I have talked to several people during this investigation and no one told me they saw Nick or Jarvis on the Talbot Ranch prior to the fire. I told Cherie the people I have talked to told me Nick and Jarvis were fighting the fire trying to save a hay stack.

Cherie told me someone told her sister, Kami (Foot) they saw Nick and Jarvis cutting scrap metal. I asked Cherie if Kami told her about Nick and Jarvis. Cherie told me her sister, Stacie Sparrow told her about Nick and Jarvis cutting scrap metal. Cherie told me Stacie's husband, Tyson Sparrow from Aspen Construction was working near Lower Rock Creek prior to the fire too. I asked Cherie if Tyson saw Nick and Jarvis, she told me she did not know. I asked Cherie who Stacie heard this information from, she told me Kami. I asked Cherie who Kami heard this information from, she told me she did not know. Cheri then told me Kami heard the information from someone who came into her Office.

I asked Cherie where she was prior to the fire, she told me she was working at Millpond at the time and at about 1300 hours, she saw the smoke. I asked Cherie if she was out at Round Valley at any time during Friday, February 6, 2015, she told me she was not. I asked Cherie if she saw Nick or Jarvis at any time during the day of the fire, she told me she did not.

I asked Cherie if her mother, Earlene told her about Weller coming into Brown's Supply, Cherie told me she did. I asked Cherie what Earlene told her. Cherie told me Weller, Nick, and Jarvis were cutting scrap metal and after Weller left the fire started. I told Cherie, I spoke to Weller, Bill Talbot and Perea and neither of them told me Nick or Jarvis were at the Ranch helping with the scrap metal. Cherie told me they were all lying. I asked Cherie if they were all lying, she told me she does not trust any of them except Weller.

Prepared	By:	Date:	Approved	i By:	Date:
SSS2	SCOTT, SHANE	03/03/2015	SKJI	JOHNSTON, KELVIN	03/03/2015



550 SOUTH CLAY STREET

INDEPENDENCE, CA 93526 760-878-0383 NARRATIVE

378-0383

15-03-009

Page 8

I asked Cherie if anyone was telling her to say Nick and Jarvis started the fire, she told me there was not. Cherie became upset with me for asking the question. I told Cherie again about everyone I spoke to did not see Nick or Jarvis on the Talbot Ranch prior to the fire. I told Cherie, I knew about the issues between Mendiburu, Nick and Jarvis. Cherie told me no one told her to say Nick and Jarvis started the fire.

Cherie did not have any further information and I ended my telephone interview.

On Monday, February 23, 2015, at about 1100 hours, I received Mendiburu's written statement in my Departmental Traffic Box, (See attached).

Case Status

Unfounded / Information Only.

Copies to:

Cal-Fire Investigator Brian Tominaga

San Bernardino Unit

3800 N. Sierra Way

San Bernardino, CA 92405

03/03/2015

SKJI

JOE MENDIBORY

Visitor's Printed name	Visitor's Signature	Address :	Phone Number	Drivers License Or ID Number and State	Date
HERE HEISESTIZ	2 Conoff				
CHECKESTY	to Church			•	3
			,,*		
And the second s					
	The state of the s	,			
		The state of the s	 		
		:			
- Administration of the second					
		· · · · · · · · · · · · · · · · · · ·			

CR#15-03-009

I-448 ADD, PG, 03/02 -

Sheriff's Department County of Inyo 550 South Clay Street P.O. Box "S" Independence, California 93526

WILLIAM R. LUTZE SHERIFF

TELEPHONE (760) 878-0383

ADMINISTRATIVE FAX (760) 878-0389

DATE: 2/18/15
TO: BRIAN TOMINALIA
DEPARTMENT: CAL FIRE ARSON ZNUESFILLATIONS
PHONE #:
FROM: JEFF HOLLOWEL UNDERSHERIFF
DEPARTMENT: ECSU
PHONE:
NUMBER OF PAGES SENT (INCLUDING COVER PAGE): 2
COMMENTS: SURPRISE - HE NAMED THE RANCH MALL
" FOREMON FROM THE RANCH HE LOST IN
THE CRIMINAL CONVICTION.
PLEASE ACKNOWLEDGE: YES: NO:
WHEN ACKNOWLEDGEMENT IS REQUESTED, PLEASE FILL OUT THE PORTION BELOW AND SEND BACK THROUGH FAX. THANK YOU.
RECEIVED BY:
DATE:

LT PAUL BALDWIN WILL ASSIGN AN ZNUSTIGATOR

INYO COUNTY SHERIFF'S DEPARTMENT VICTIM/WITNESS STATEMENT FORM 11:50 am TYPE OF INCIDENT CI# DOB BUSINESS ADDRESS DETAILS: (List all witnesses, times, dates, places, etc.)

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 FELONY REPORT

760-878-0383

Case 10-05-026

Page 1

Fel/Misd Date Occurred Time Occurred Incident# Offenses Description 503 PC 10/20/09-03/31/10 0001 - 2359 1005080009 Embezzlement Date Reported Time Reported 05/08/2010 1020 OFFENSES Related Cases Date Printed Time Printed Printed By 02/19/2015 09:20:58 SSS2 Latitude Longitude 0.000000 0.000000 Disposition Location Beat Area Dispo Date Bishop Sub, (Unknown Address), 200 220 Pending Location Type Method of Entry Point of Entry Alarm System Means of Attack (Robbery) Location of Entry Cell Phone Victim Drivers License Email Flying M Cattle, Inc. DOB Residence Address Notified of Victim Rights Residence Phone Sex Race Age 1031 A Street, Bakersfield, CA 93304 No Business Name and Address **Business Phone** Wt Height Hair Eyes Assistance Rendered/Victim Disposition Transporting Agency Means of Attack (Assaults) Property Crime Does Not Apply Description of Injuries Other Information Drivers License Cell Phone Reporting Party Email Dobranzski, Nicole Louise Residence Address Residence Phone DOB Age Sex Race W **Business Name and Address Business Phone** Height Wt Hair Eyes 5'4" 130 Flying M Cattle Co **BRO** BRO Action Taken Charges Mendiburu, Joseph Charles 503 PC Residence Address Residence Phone DOB Age Sex Race M W Business Name and Address **Business Phone** Height Wt Hair Eyes Flying M Cattle Company, 397 S. Round Valley Road, Bishop, CA 93514 661-979-2214 5'10" 210 BRO GRN Identifying Features Cell Phone Drivers License Arrest Number Speech: Mad, loud Build: Average Complexion: Clear Facial Hair: Beard & Mustache Aliases Status Vehicle Make and Model License/State Vehicle Type Prepared By Date Assisted By Approved By Date SCC1 - Connolly, Chris 05/08/2010 SCC1 - Connolly, Chris 05/21/2010 Routed To Date Routed To Date Notes 05/22/2010 Investigations

X

INYO COUNTY SHERIFF'S DEPARTMENT

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 FELONY REPORT

760-878-0383

Case 10-05-026

Page 2

Cell Phone Email Drivers License Reporting Party Mendiburu, Danielle Louise Residence Address Residence Phone Sex Race F W **Business Name and Address Business Phone** Height Hair Eyes Flying M Cattle Co, 325 Round Valley Road, Bishop, CA 93514 5'10" 135 **BRO** HAZ Drivers License Cell Phone Email Braden, Suzanne Louise Residence Address Residence Phone DOB Sex Race F W **Business Phone** Height Wt Hair Eyes **Business Name and Address** 5`6" 127 **GRY** GRY Cell Phone Contacted **Drivers License** Email Harriman, Sue Residence Address Residence Phone DOB Sex Race Age F **Business Phone** Wt Hair **Business Name and Address** Height Eyes 775-423-9586 5'2" 130 BRO GRN First Independent Bank Of Nevada, 2061 W. Williams Street, Fallon, NV 89406 Drivers License Cell Phone Email Contacted Kasinger, Kathleen DOB Residence Address Residence Phone Age Sex Race F W **Business Name and Address Business Phone** Height Wt Hair Eyes 200 Peppermill Casino, 2707 South Virginia Street, Reno, NV 89502 866-821-9996 5'3" BRO BRO Cell Phone Contacted **Drivers License** Email Mendiburu, Lee Cathrine Residence Address Residence Phone DOB Sex Race Age F W **Business Name and Address Business Phone** Height Wt Hair Eves 5'5" 137 BLN BLU Involved Drivers License Cell Phone Email Helfrich, John Residence Address Residence Phone DOB Age Şex Race M Wt **Business Phone Business Name and Address** Height Hair Eyes State Of California Cell Phone Involved **Drivers License** Email Suther, John Residence Address Residence Phone DOB Sex Race Age M W Business Name and Address **Business Phone** Height Wt Hair Eyes State Of California, 1220 N Street Room A-130, Sacramento, CA 95814 916-654-0889 Mentioned Drivers License Cell Phone Email Collado, Emilio DOR Residence Address Residence Phone Age Sex Race M H **Business Name and Address Business Phone** Hair Eyes Wt 0 Birchim Lane, Rovana, CA 93514 5'10" 180 BLK BRO

550 SOUTH CLAY STREET

INDEPENDENCE, CA 93526 760-FELONY REPORT

760-878-0383

Case 10-05-026

Page 3

11.4-12-W 3-UU-1

Mentioned Drivers License Cell Phone Email Mendiburu, George Louis Residence Address DOB Residence Phone Sex Race M W Business Name and Address **Business Phone** Height Wt Hair Eyes 5'9" Mendiburu Ranch, 395 S. Roundvalley Road, Bishop, CA 93514 260 GRY BRO Drivers License Mentioned Cell Phone Email Shallcross And Associates DOB Residence Address Residence Phone Age Sex Race 250 Snceden, Bishop, CA 93514 Business Name and Address **Business Phone** Height Wt Hair Eyes

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 FELONY REPORT - PROPERTY

760-878-0383

Page 4

10-05-026

ID No.	Status/Disposition	Property Description	Value Val Recove	red
10 10.	Stolen	1 Us Сиптепсу - 71,899.26	\$71,899.26	
,	Stoleii	1 03 Currency 71,000.20	\$71,899.26	
			\$71,899.26	
			40	
			1	

CK# 15-03-009



INYO COUNTY SHERIFF'S DEPARTMENT

550 SOUTH CLAY STREET

INDEPENDENCE, CA 93526 NARRATIVE 760-878-0383

10-05-026

Page 1

Attachments:

- 1- Copy of Death Certificate of George Mendiburu
- 1- Photocopy of Company Minutes dated 02/06/2009
- 1- Copy of Company Minutes dated 10/16/2010
- 1- Copy of Inyo Superior Court Civil Proceeding dated 10/20/2009
- 1- copy of bill and check dated 01/26/2010
- 1- copy of bill and check dated 02/09/2010
- 1- copy of bill and check dated 03/30/2010
- 1- copy of check dated 12/08/2009 (#028486)
- 1- copy of check dated 12/08/2009(#028...)
- 1- copy of check dated 12/08/2009 (#028485)
- 1- Copy of check dated 11/30/2009 (#11875)
- 1- Bank of America Statement (6 Pages)
- 1- Written statement signed by Dobrzanski, Danielle Mendiburu.

Details:

On 05/08/2010, I was contacted by Danielle Mendiburu and Nicole Dobrzanski at the Bishop Substation regarding a possible embezzlement.

Mendiburu and Dobrzanski told me they control the finances and operations of the Fl;flying M Cattle Company. The company was previously owned and operated by George Mendiburu, Nichole and Danielle's father.

George passed away on 12/25/2008. George did not leave a will or trust so the company and all of George's assets went into Probate.

On 02/06/2009, Danielle Mendiburu, Nichole Dobrzanski, Joe Mendiburu (brother to Danielle and Nichole) and Lee Mendiburu (Joe's Wife) were appointed positions acting as a board of Director's for the Flying M Cattle Company.

During the end of September, Lee called Nicole and told her Joe spent almost all of the company's

Prepared By:	Date:	Approved	l By:	Date:
SCCI CONNOLLY, CHR	05/08/2010	SCC1	CONNOLLY, CHRIS	05/21/2010

CR#15-03-009



INYO COUNTY SHERIFF'S DEPARTMENT

INDEPENDENCE, CA 93526 NARRATIVE

760-878-0383

10-05-026

Page 2

money on drugs and gambling.

550 SOUTH CLAY STREET

Between 09/01/2009 and 09/30/2009, there were several purchases made on the company account. These purchases were made on online gambling sites. Joe was in charge of protecting the company's money. These purchases were about \$80,000.00. Dobrzanski questioned Joe about the purchases. Joe told Dobrzanski he made the purchases from online gambling sites. Danielle and Dobrzanski froze the bank account.

On 10/20/2009, Joe was removed as the Administer from George's estate, which included the operation of the company. Nichole and Dobrzanski assumed all responsibility and control of the company's account.

on or about 11/01/2009, Nichole and Dobrzanski told Joe he would still be in charge of day to day operations. they advised Joe if he stole anymore money from the company, they would sell the company and file charges of embezzlement. Joe told Nichole he received about 15,000.00 from Emilio Collado. Collado owed the company 30,000.00 for a loan. Joe attempted to go inside Shalcross and associates, the company's book keeper, and tell Shalcross to remove the debt from Collado.

Nichole and Dobrzanski were allowing Joe to put an offer together to buy the company from them. Nichole and Dobrzanski hired a Private Investigator to look into the company's operations. The investigator found that Joe sold cattle and sheep to agencies in Nevada. Joe took the checks, made out to Flying M Cattle Co, and had the checks re-issued as cashier's checks and remitted to Joe Mendiburu. The total of these checks were \$71,899.00.

Nichole and Dobrzanski told me the money was never deposited into the company account.

On 05/06/2010, Nichole and Dobrzanski informed Joe he was fired from the company and that the company would be sold.

At the request of Investigators, I have not contacted Mendiburu.

Case Status:

Referred to Investigations.

Prepared	By:	Date:	Approved By:	Date:
SCC1	CONNOLLY, CHRIS	05/08/2010	SCC1 CONNOLLY, CHRIS	05/21/2010





550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 760-878-0383 SUPPLEMENT 1

10-05-026

Page 1

Synopsis:

On 05-08-2010, Corporal Connolly was contacted by Danielle Mendiburu and Nicole Dobrzanski at the Bishop Sheriff's Substation regarding an embezzlement from the Flying-M ranch. The suspect was identified as Joe Mendiburu and the victim was the Flying-M ranch.

Evidence:

Item 1. I took digital photographs of the welder as it was parked inside Collado's garage.

Chain of Evidence:

I kept the photographs in my possession until I downloaded them to my computer and burned them to a CD-R. The CD-R containing the photographs was attached to the case file.

Attachments:

- A- One copy of Flying M- cattle sales (142 pages)
- B- One copy of Flying M- accounting records (43 pages)
- C- One copy of Flying M- new bank account (start Oct09) (15 pages)
- D- One copy of Flying M- original bank account (end Sept09) (66 pages)
- E- One type written statement from Nicole Dobrzanski and Danielle Mendiburu (5 pages)
- F- One copy of bank records covering the months and years of December 2008 to September 2009 with debits highlighted by Nicole Dobrzanski (44 pages)
- G- One copy of an invoice from Bishop Veterinary Hospital with the pregnancy check examinations highlighted (12 pages)
- H- One copy of Acknowledgement And Agreement By Heirs To Acts, Accounting And Other Matters Relating To The Administration Of the Estate Of George L. Mendiburu (29 pages)
- I- One copy of a written agreement signed by Emilio Collado and Joe Mendiburu (1 page)
- J- One copy of Senior Special Investigator John Suther's report (2 pages)
- K- One copy of a termination letter to Joseph Charles Mendiburu from Danielle Louise Mendiburu (1 page)

Details:

On 06-02-2010, at about 1201 hours I contacted Danielle Mendiburu and Nicole Dobrzanski at the Bishop Sheriff's Substation and collected documents from them. Danielle and Nicole told me their brother Joe Mendiburu has embezzled money from the Flying M cattle company either by accessing

Prepared I	By:	Date:	Approved	d By:	Date:
SDWI	WILLIAMS, DAN	08/24/2010	SJH1	HOLLOWELL, JEFF	10/13/2010

CR#15-03-009

760-878-0383



INYO COUNTY SHERIFF'S DEPARTMENT

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 SUPPLEMENT 1 Page 1

10-05-026

Flying M bank accounts or selling cattle and misappropriating the proceeds. Danielle also noted Joe sold a welder mounted on a trailer that belonged to the ranch to Emilio Collado.

On 06-03-2010 at about 0900 hours Danielle and Nicole provided me with a type written statement concerning check number 11875 from Nevada Livestock Marketing LLC to the Flying M Cattle Co. in the amount of \$34,221.44.

I asked Danielle about repayment of the money Joe stole from the Flying M ranch. Danielle said she said and her sister Nicole made an agreement with Joe for the money to come out of Joe's portion of the inheritance when the estate settled.

On 08-27-2010, at about 1400 hours I received an E-mail from Danielle Mendiburu. The E-mail was a copy of Acknowledgement And Agreement By Heirs To Acts, Accounting And Other Matters Relating To The Administration Of the Estate Of George L. Mendiburu. I spoke with Danielle Mendiburu and confirmed she sent the E-mail to me. I attached a copy of the E-mail to this report.

Corporal Connolly attached four photocopies of checks to his report:

One was from the account of Nevada Livestock Marketing; LLC issued by First Independent Bank of Nevada to be paid to the Flying M Cattle Co. check number 11875, in the amount of \$34,221.44 The check from Nevada Livestock Marketing LLC numbered 11875 to the Flying M Cattle Co. was for payment of 74 head of cattle sold on 11-30-2009.

Three checks were Cashiers Checks with the remitter listed as Joseph C Mendiburu issued by the First Independent Bank of Nevada to be paid to the Flying M Cattle Co. The check numbers and amounts were as follows, #028486 in the amount of \$24,221.44, #028484 in the amount of \$5,000.00 and #028485 in the amount of \$5,000.00.

Kathleen Kasinger interview:

On 05-26-2010, at about 1130 hours I spoke with Kathleen Kasinger who is the day shift cage manager at the Peppermill Hotel/Casino in Reno Nevada. I asked Kasinger about the entries on the cashier's checks numbered 028484, 02485 and 028486. Kasinger said it was the policy of the casino to obtain photo identification (normally a drivers license) and to compare the photo to the person at the cashier's cage. Kasinger said the cashier then writes the information from the identification card on the front of the check.

I asked Kasinger about a fingerprint I observed on checks numbered 028484 and 028485 issued by First Independent bank of Nevada. Kasinger said a fingerprint is obtained from the person who presents the check at the cage during the check cashing transaction.

I observed the number 12604383 on the front of the checks and Kasinger said the number is normally the players club tracking number of the person cashing the check.

I asked Kasinger about a mark that looked like it was possibly someone's initials on the face of checks numbered 028484 and 028485. Kasinger said the cage cashier normally puts their initials on the check during the transaction

Prepared By:	Date:	Approved By:	Date:
SDW1 WILLIAMS, DAN	08/24/2010	SJH1 HOLLOWELL, JEFF	10/13/2010

CH#15-03-009



INYO COUNTY SHERIFF'S DEPARTMENT

550 SOUTH CLAY STREET

760-878-0383 INDEPENDENCE, CA 93526 SUPPLEMENT 1

10-05-026

Page 1

I asked Kasinger about the stamp on the back of the checks and she said the stamp was applied by an employee of the Peppermill Hotel/Casino. Kasinger said the "#12# at the top of the stamp identified the cage the check was cashed at. The next number "4159-584822" identified the Peppermill's account at Wells Fargo bank, I asked Kasinger about the date portion of the stamp "2009 NOV 39." Kasinger said the month portion of the date was not reset thereby allowing the day number to continue to count up. Kasinger said the date stamp "2009 NOV 39" actually was December 9 2009. The next portion of the stamp read "FOR DEPOSIT ONLY WELLS FARGO BANK" with the numbers 121000248. Kasinger said the numbers 121000248 identified the local Wells Fargo branch the Peppermill Casino conducted their business at.

On 05-27-2010, at about 1019 hours I re contacted Kasinger in regard to First Independent Bank of Nevada cashiers check number 028486. I noticed the check did not have all of the same information the other checks had hand written on the front. Kasinger said often times when a person cashes a check and returns to cash more checks and is recognized by the cashier cage staff, identification formalities are bypassed.

Total misappropriation for cattle sales at Nevada Livestock Marketing LLC was \$34,221.44

On 05-27-2010, at about 1350 hours I received an e-mail from a sender indicated as Danielle Mendiburu. I contacted Mendiburu and confirmed she sent the e-mails. The attachments were entitled as follows:

- *Flying M- cattle sales,
- *Flying M-accounting records,
- *Flying M, new bank account (start Oct09)
- *Flying M original bank account (end Sept09)

On 06-07-2010, at about 0914 hours I met with Nicole at the Bishop Sheriff's Substation. Nicole provided me account records for Flying M Cattle, Inc from Bank of America. Nicole highlighted debits made to the account that she said Joe Mendiburu made that were for Joe's benefit and not for the operation of the Flying M Cattle Company. (See attachment "F")

September 01 through September 30, 2009 \$ 48,206.69

August 01 through August 31, 2009

\$ 15,868.02

May 01 through May 29, 2009

\$ 1,000.00

Total:

\$ 65,074.71

Sue Harriman interview:

On 06-18-2010, at about 1028 hours I conducted a telephone interview with Sue Harriman of the Fallon

Prepare	d By:	Date:	Approve	d By:	Date:
SDW1	WILLIAMS, DAN	08/24/2010	SJH1	HOLLOWELL, JEFF	10/13/2010

CA# 15-03-00



INYO COUNTY SHERIFF'S DEPARTMENT

760-878-0383 550 SOUTH CLAY STREET **INDEPENDENCE, CA 93526** SUPPLEMENT 1

Page 1

10-05-026

Nevada branch of First Independent Bank of Nevada. Harriman said she recalled the transaction with Joe Mendiburu when Mendiburu converted a check from Nevada Livestock Marketing LLC. in the amount of \$34,221.44, to three cashiers checks with Joe Mendiburu listed as the remitter and the payee as the Flying M Cattle Co. Harriman said she assisted the bank teller because the transaction was out of the ordinary.

Harriman said on 12-08-2009, a bank teller contacted her and told her a man was at the bank and wanted to cash a check made out to a business. Harriman said she assisted the teller and found the man was Joe Mendiburu as identified by his driver's license. Harriman said it is bank procedure in that situation to identify the customer by a valid form of photo identification Harriman said the check was from Nevada Livestock Marketing LLC made out to the Flying M Cattle Co. Harriman said Mendiburu wanted to cash the check which was against bank policy. Harriman said bank policy allowed Mendiburu to convert the checks to cashiers checks with the payee listed as the same payee as on the original check and the remitter as Joe Mendiburu instead of Nevada Livestock Marketing LLC.

Harriman said Mendiburu converted the Nevada Livestock Marketing LLC check to three cashiers checks with the remitter listed as Joe Mendiburu and the payee listed as Flying M Cattle Co. Harriman said video surveillance is available from the date of the transaction and a subpoena would be necessary to obtain a copy of it.

Lee Mendiburu interview:

On 06-30-2010, at about 1004 hours I contacted Lee Mendiburu via the telephone. I told Lee Mendiburu I wanted to ask her about a report made by Nicole Dobranski and Danielle Mendiburu involving her ex husband Joe Mendiburu. Lee told me the following in essence.

I asked Lee if she knew if Joe has a computer in his home and she said "yes." I asked Lee if she was sure of that and she said she was positive. I asked Lee she could be positive Joe owns a computer and she said her kids told her Joe has a computer and she has seen it for herself. I asked Lee when the last time she saw the computer was and she said in September 2009 when she moved out. Lee said her kids saw a computer in Joe's residence two weeks ago when they were visiting Joe. I asked Lee how long Joe has owned the computer and she said since his Dad died. I asked Lee if it was the same computer and she said it was. I asked Lee where Joe got the computer and she said it was his father's. Lee said her kids told her they played on a computer at Joe's residence the last time they visited Joe two weeks ago.

I asked Lee if she was aware of Joe misappropriating money from the sale of Flying M livestock sales. Lee said well yeah, I think that happened quite a bit. Lee said she witnessed that for sure although she could not provide specific information. I asked Lee if Joe ever commented about it and Lee said no, he did not want to comment about it.

I asked Lee about the company bank accounts and Lee said the only times she used the accounts was to pay bills. Lee said she began to notice there was a lot of money missing from the accounts was when her and Joe's marriage began to fall apart.

I asked Lee how she knew money was missing from the ranch and she said the bank accounts. I asked Lee if when she saw the bank statements she knew the balances had dropped without a reason or could not be accounted for and she said yes. Lee said she handled the bank statements for the ranch after Joe's

Prepared By:	Date:	Approved By:	Date:
SDWI WILLIAMS, DAN	08/24/2010	SJH1 HOLLOWELL, JEFF	10/13/2010

CN# 15-03-009



INYO COUNTY SHERIFF'S DEPARTMENT

760-878-0383 550 SOUTH CLAY STREET **INDEPENDENCE, CA 93526** SUPPLEMENT 1

Page 1

10-05-026

father died was able to see the balances when she was delivering them to the ranch's accountant.

I asked Lee if she ever saw Joe gamble on-line and she said she saw Joe playing poker on line. I asked Lee how many times she saw Joe playing poker and she said many times. Lee said she saw Joe playing at least 3 times a week before she moved out. I asked Lee if she knew if Joe was playing for money and she said one time she saw Joe playing and asked him about it. Lee said Joe told her he only had twenty dollars in the account he was using. Lee speculated Joe played poker online more frequently than what she observed and that he did it when she was away from the residence or was asleep in the early morning hours.

Emilio Collado interview:

On 07-20-2010, at about 1419 hours I contacted Emilio Collado at 275 Pine Creek road in Bishop California and spoke to him about this report. Collado told me the following in essence. I advised I wished to speak with regarding a report of theft made at the Flying M cattle company. I told Collado I was told he might have purchased livestock and a welder from Joe Mendiburu, that Mendiburu did not have the right to sell.

Collado said he has purchased cattle from Joe Mendiburu in the past and said they were Joe's cattle. I asked Collado when the last time he purchased cattle from Joe Mendiburu was and Collado said it was a long time ago. Collado said he purchased nineteen cows in 2009.

I asked Collado if he purchased a welder from Joe Mendiburu and Collado said yes. I asked Collado if Joe Mendiburu told him it was his and Collado said Joe Mendiburu told him he needed money for a lawyer. Collado said Joe Mendiburu did not sell it to him rather he loaned Joe Mendiburu money and Joe Mendiburu used the welder as collateral. Collado said when Joe Mendiburu repays the money he will return the welder to Joe Mendiburu.

Collado said he loaned Joe Mendiburu fifteen hundred dollars. Collado said he has paperwork detailing the loan to Joe Mendiburu. I asked Collado if he would provide me with a copy of the paperwork he and Joe Mendiburu signed and he said he would.

I asked Collado about a payment he made to Joe Mendiburu for repayment of a loan. Collado said he borrowed thirty thousand in cash from George Mendiburu. Collado said it was a personal loan from George Mendiburu. Collado also said they did not fill out any paperwork on the loan. Collado said he spoke to Joe Mendiburu after George died and told Joe he owed him thirty thousand dollars. Collado said Joe Mendiburu gave him a paper and Joe said you pay me whenever you can. Collado said he paid Joe Mendiburu thirty thousand dollars and I said you paid him thirty thousand and Collado said "No I paid him fifteen thousand dollars." Collado said he told Joe Mendiburu he would pay him when he could and Joe Mendiburu told Collado to pay him whenever. Collado said the "sister's have tried to say it was a Flying M deal. Collado said it was not a Flying M deal, it was between George and me." Collado said he still owes fifteen thousand dollars. Collado said Joe Mendiburu told him to pay him in two years, three years or whenever.

I asked Collado if a welder I saw in his front yard was the welder Joe Mendiburu used as collateral and

Prepared By:	Date:	Approved By:	Date:
SDW1 WILLIAMS, DAN	08/24/2010	SJH1 HOLLOWELL, JEFF	10/13/2010

CA# 15-03-009



INYO COUNTY SHERIFF'S DEPARTMENT

INDEPENDENCE, CA 93526

760-878-0383

10-05-026

Page 1

550 SOUTH CLAY STREET

SUPPLEMENT 1

he said no, it was in the back. I asked Collado if the welder Joe Mendiburu used as collateral belonged to the ranch and he said the welder belonged to George Mendiburu. Collado said he was with George Mendiburu when George bought the welder.

I asked Collado if I could look at the welder and he said I could. Collado said it was in a shed to the north of his house and was painted blue. I told Collado I wanted to take a photograph of the welder and he said that would be okay.

I photographed the welder as it was parked inside of a shed before I left Collado's residence.

Joe Mendiburu interview:

On 07-13-2010, at about 1007 hours Joe Mendiburu contacted me via the telephone and told me to speak his attorney Ed Noriega of Bakersfield and that he did not have anything to say regarding this report at this time.

On 07-21-2010 at about 1443 hours I called Noriega's office and left a message for him to contact me regarding this case. I have not heard back from Noriega.

Additional Information:

On 09-08-2010, at about 0937 hours Investigator Martinez, State of California Brand Inspector Robert Helfrich, State of California Brand Senior Special Investigator John Suther and I contacted Emilio Collado at his residence located at 275 Pine road Bishop.

Suther interviewed Collado about the purchase of cows Collado made from Joe Mendiburu in November of 2009. Investigator Martinez and I stood by during Suther's interview.

On 09-20-2010, at about 1440 hours I spoke with Special Investigator Suther via the telephone. Suther said number of calves Collado sold was consistent with the number cows he had.

Refer to Senior Special Investigator John Suther's case number BLI-2010-0054, for further information.

On 09-13-2010, at about 1424 hours I collected a written agreement signed by Emilio Collado and Joe Mendiburu from Dorothy Collado

Case Disposition:

Referred to the Inyo County District Attorney's Office for review.

Prepared	By:	
SDW1	WILLIAMS, DAN	

08/24/2010

11-4-15-05-007



INYO COUNTY SHERIFF'S DEPARTMENT

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 760-878-03 SUPPLEMENT 2

10-05-026

Page 1

Synopsis:

On 05-08-2010, Corporal Connolly was contacted by Danielle Mendiburu and Nicole Dobrzanski at the Bishop Sheriff's Substation regarding an embezzlement from the Flying-M ranch. The suspect was identified as Joe Mendiburu and the victim was the Flying-M ranch.

Attachments:

Item 1. One copy of a handwritten letter addressed to Nicole and Danielle and signed by Joe.

Details:

On 09-30-2010, at about 1140 hours Danielle Mendiburu contacted me at the Bishop Sheriff's Substation. Mendiburu gave me a copy of a handwritten letter addressed to "Nicole and Danielle", and signed by "Joe." Danielle said the note was given to her by her mother Suzanne Braden. Danielle said her mother told her she was present when Joe wrote the letter. Danielle said her mother told her Joe told her to give the letter to Nicole and Danielle. Danielle said her mother gave her the letter in December of 2009.

Suzanne Braden interview:


On 09-30-2010, at about 1325 hours I spoke with Suzanne Braden via the telephone regarding the letter Danielle gave to me. I reviewed the letter with Braden and Braden said it was the same letter Joe wrote and gave to her. Braden said Joe wrote the letter to Danielle and Nicole apologizing for taking the ranch's money around either Thanksgiving or Christmas of 2009. Braden said she was visiting Joe at the time and told him he needed to apologize to his sisters. Braden said she gave Joe a pad of paper a couple of days before Joe wrote the letter. Braden said she was present with Joe when Joe wrote the letter.

Case Disposition:

Referred to the Inyo County District Attorney's office.

Prepared	By:	
200		

SJH1





550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 SUPPLEMENT 3

760-878-0383

10-05-026

Page 1

Synopsis:

On 05-08-2010, Corporal Connolly was contacted by Danielle Mendiburu and Nicole Dobrzanski at the Bishop Sheriff's Substation regarding an embezzlement from the Flying-M ranch. The suspect was identified as Joe Mendiburu and the victim was the Flying-M ranch.

Attachments:

Item A. One copy of a report written by John Suther case number BLI-2010-0054 (attachment "J").

Details:

On 10-18-2011, at about 0815 hours I met with California Brand Inspector John Suther at the C-Ranch located on the east side of US highway 395 about four miles south of Bishop. I reviewed Suther's report with him and he said except for one thing, his report was inclusive.

On 09-08-2010, California Brand Inspector John Suther, Brand Inspector Bob Helfrich and I went to 275 Pine Creek road in Bishop to meet with Emilio Collado. Suther said he wanted to talk to Collado because the Flying M ranch manager Mickey Jarvis told him cattle belonging to Collado (35 pairs and 85 yearlings) were being pastured on Flying M ranch property and only Flying M livestock were supposed to be on Flying M ranch property.

Suther said he asked Collado if he had purchased any cattle from Joe Mendiburu and Collado told him he purchased 19 pairs from Joe Mendiburu with the DJ brand. Suther said he asked Collado if he had bought any cattle from the Flying M ranch and Collado told him he had not. Suther said he asked if he had gotten a brand inspection for the cattle he purchased from Joe Mendiburu and Collado said he had not and that Joe Mendiburu said he would get it for him.

Suther said he asked Collado about the 85 yearlings he had pastured on Flying M ranch property and Collado told him he had 66 yearlings on the Flying M ranch. Suther said he went to the pasture where the yearlings were kept and counted 66 head. Suther said Collado told him he had about 350 cows of which 300 were kept around his house and 49 cows were kept in Long Valley with Cashbaugh cattle. Suther said Collado told him he was going to ship his calves and yearlings in September 11, 2010. Suther said they agreed to look at the cattle he purchased from Joe Mendiburu and count his cattle at that time. Suther said Collado told him he purchased the last of Joe Mendiburu's cattle in December of 2009.

Suther said on September 11, 2010, Brand Inspector Helfrich inspected 122 steer calves, 86 heifer calves, 51 yearling steers, 8 yearling heifers and 7 yearling cuts for a total of 274 head. Suther said the number Collado sold is close to the number he owns. Suther said a possible reason some of Collado's cattle look like Flying M ranch cattle is because some of the pairs on pasture were purchased from Joe Mendiburu. Suther said Collado supplied Brand Inspector Helfrich with paperwork for the purchase of 16 pair from Joe Mendiburu. Suther said that was consistent with the number of DJ branded cattle Brand Inspector Helfrich counted.

Prepared By:		Date:	Approved By:	Date:	
	SDWI	WILLIAMS, DAN	10/26/2011	SPB1 BALDWIN, PAUL	10/27/2011

14-15-03-009



INYO COUNTY SHERIFF'S DEPARTMENT

760-878-0383

10-05-026

Page 1

550 SOUTH CLAY STREET

INDEPENDENCE, CA 93526 SUPPLEMENT 3

Suther said he checked sale records for Joe Mendiburu at Western Stockman's Market and Nevada Livestock Marketing and found Joe Mendiburu sold approximately 20 less calves that he sold cows in 2009.

Suther said a brand inspection needs to be done at the time cattle are transacted.

Case Disposition:

Referred to the Inyo County District Attorney's Office for prosecution.

Prepared By:

SDWI WILLIAMS, DAN Date:

10/26/2011

Approved By:

SPBI BALDWIN, PAUL Date:

10/27/2011

X# 15-03-004



INYO COUNTY SHERIFF'S DEPARTMENT

760-878-0383

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 ASSIST OTHER AGENCY REPORT

8-0383 Case

Case 15-02-021

Page 1

	Offenses Brush Fire	Description Fire Investigat	tion				Fel/Misd	02/06/15-0		1405	Oeeurred		ent # 2060023
SS		·						Date Report 02/06/2015		Time I	Reported		
OFFENSES								Related Case	es				
OFF								Date Printed 02/18/2015		Time 1	Printed 1:56	Print SSS	ed By
S.				3				Latitude 37.453390		Longi	tude 583650		
Ö.	Location Ranch Land, 2180 C	old Sherwin Road	d, Round Vall	ey, CA 93514	Table and Table	Beat 200	Area 201	Dispositiou Referred to	Other A	geney			Date 8/2015
ŭ	Location Type Other	Location of En	try Metho	d of Entry	Point	of Entry		Alarm Syste	m	Means	of Attac	k (Robb	ery)
	Reporting Party Perea, Donald			Drivers	License		Cell Phor	ie	Email				
	Residence Address			Notified	of Victi	m Rights	Residence	e Phone	DOB		Age	Sex M	Race X
	Business Name and Address Talbot Ranch, 2180 Old Sherwin Road, Round Valley, CA 93514					Business	Phone	Height 5'8"		Wt 165	Hair BRO	Eyes BRO	
	Assistance Rendered/	Vietim Disposition	j				Transpor	ting Ageney	Means	of Atta	ek (Assaı	ılts)	
	Description of Injuries	5		(6)6			Other Inf	ormation		_			
X	Witness Schober, Walter Drivers License					Cell Phor	16	Email					
	Residence Address					Residence	e Phone	DOB		Age	Sex M	Race W	
7	Business Name and Ac	Idress					Business	Phone	Height 6'1"		Wt 220	Hair BRO	Eyes BRO
3V	Suspeet Name				-		Action Ta	iken	Charge	es	 	dry.	
	Residence Address						Residence	e Phone	DOB		Age	Sex	Race
14	Business Name and Ac	Idress		1			Business	Phone	Height		Wt	Hair	Eyes
*	Identifying Features						Cell Phor	ıe	Drivers	Licens	e	Arrest	Number
	Aliases									-			
LES	Status	***************************************	Vehicle Make	and Model			License/S	tate	Vehicle	Туре			
VEHICLES			50 (1)										
ES	Prepared By SND1 - Derr, Nathan	niel	Date 02/07/2015	Assisted By	1	211.7		pproved By SDC1 - Carte	r, Donny	/		Date 02/09/	2015
L . UTIES	Routed To Cal Fire	Date	Ronted 7	0	I	Date	Notes						

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 ASSIST OTHER AGENCY REPORT

760-878-0383

Case 15-02-021

Page 2

Drivers Lieense Cell Phone **Email** Witness Perea, Donald DOB Race Residence Address Sex M X Height Wt Hair Eyes **Business Name and Address Business Phone** Talbot Ranch, 2180 Old Sherwin Road, Round Valley, CA 93514 5`8" 165 BRO BRO Drivers License Cell Phone Email Bishop Volunteer Fire Department Residence Address Residence Phone DOB Age Sex Race 207 W. Line St, Bishop, CA 93514 **Business Name and Address** Wt **Business Phone** Height Hair Eyes Cell Phone Email Involved **Drivers License** Cal Fire Residence Address Residence Phone DOB Race Age Sex San Bernardino Wt **Business Name and Address Business Phone** Height Hair Eyes Involved Drivers License Cell Phone Email CHP Residence Address Residence Phone DOB Age Sex Race Wt **Business Name and Address Business Phone** Height Hair Eyes Involved **Drivers** License Cell Phone Email Fish And Game Residence Address DOB Sex Race Residence Phone Age 407 Line St W, Bishop Business Name and Address **Business Phone** Height Wt Hair Eyes Involved Drivers License Cell Phone Email Mono County Sheriff Department Residence Address Residence Phone DOB Age Sex Race Bridgeport, CA 93517 Wt **Business Name and Address Business Phone** Height Hair Eyes Cell Phone Involved Drivers License Email Us Forest Service Residence Address DOB Sex Race Residence Phone Age Hwy 136 & 395, Lone Pine, CA 93514 Wt Hair Business Name and Address **Business Phone** Height Eyes Officer Involved Drivers License Cell Phone Email Frew, Kevin DOB Residence Address Residence Phone Age Sex Race Wt Business Name and Address **Business Phone** Height Hair Eycs Inyo County Sheriff's Department, 550 S. Clay Street, Independence, CA 93526 760 878-0323



760-878-0383

550 SOUTH CLAY STREET **INDEPENDENCE, CA 93526** ASSIST OTHER AGENCY REPORT

Case 15-02-021

Page 3

Officer Involved Drivers License Tominaga, Brian		Cell Phone	Email			
Residence Address 3800 N. Sierra Way, San Bernardino, CA 93405		Residence Phone	DOB Age		Sex I	Racc
Business Name and Address Cal-Fire, 3800 N. Sierra Way, San Bernardino, CA 92	405	Business Phone	Height	Wt	Hair	Eyes



760-878-0383

15-02-021

Page 4

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 ASSIST OTHER AGENCY REPORT - PROPERTY

ID No.	Status/Disposition	Property Description	Value	Val Recovered	
1	Evidence	2 Items - Audio cd's			
	*				
					ļ
				1	1

17415-03-009



INYO COUNTY SHERIFF'S DEPARTMENT

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 NARRATIVE

Page 1

15-02-021

Attachments:

Item#A- Sketch of approximate location of fire on my arrival with digital image from google earth.

Item#B- Sketch of approximate location of fire on my arrival on a digital topographic map.

Item#C- Inyo County Sheriff's Department CAD Incident Report for Incident# 1502060023.

Evidence:

Item#1- Audio CD containing interview with Donald Perea.

Item#2- Audio CD containing Donald Perea's initial 911 call.

Chain of Evidence:

Item#1- On 02-07-2015, at about 0936 hours, I recorded my interview with Perea with my personal digital audio recorder. On 02-09-2015, at about 0800 hours, I downloaded and burned the audio recording onto a Compact Disc. On 02-09-2015, I forwarded the compact disc to Cal-Fire investigator Tominaga.

Item#2- On 02-08-2015, I received a digital copy of Perea's 911 call from Dispatcher Frew. On 02-08-2015, at about 0800 hours, I downloaded the digital copy onto a compact disc and forwarded to compact disc to Cal-Fire investigator Tominaga.

Details:

On 02-06-2015, at about 1405 hours, I was dispatched with fire personnel to a vegetation fire near the Talbot Ranch on Lower Rock Creek Road (AKA Old Sherwin Road).

I arrived on scene and began evacuation proceedures at the Schober residence located at The residence is further described as a white single story ranch style home with several wood outbuildings to the north and east of the main residence. I cleared the main residence attempting to evacuate any occupant's. No occupants were located inside the main residence.

I walked around the exterior of the main residence looking for garden hoses or sprinklers which could be used to keep the fire from burning the residence, with negative results. As I walked around the southwest corner of the residence I saw power lines hanging down to the ground from the wood telephone pole next to the residence. The power lines continued west along the ground where they intersected with a down tree. The tree was lying on the ground with the top pointing to the north east, directly at Lower Rock Creek Road. At that time the fire was burning north / northeast toward Lower Creek Road. The southern flank of the fire was approximately 150 feet from the back of the residence. The top portion of the tree was of fire and the grass under the tree was back burning near the base of the tree. From my vantage point the north flank of the fire had not crossed Rock Creek (Rock creek runs west to east approximately 100 yards from the residence). The head of the fire was already burning on the west shoulder of Lower Rock Creek Road. Due to rapid fire spread

Prepared By:		Date:	Approved	Date:	
SNDI	DERR, NATHANIEL	02/07/2015	SDC1	CARTER, DONNY	02/09/2015

R# 15-03-009



INYO COUNTY SHERIFF'S DEPARTMENT

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526

760-878-0383

15-02-021

Page 2

NARRATIVE

and heavy wind driven smoke I was unable to gather more precise distances. Refer to Attachment #A.

As I walked back to my patrol vehicle I contacted Walter "Walt" Schober, who had pulled into the driveway while I was conducting my evacuation procedure. I spoke briefly with Schober who verbally identified himself as the first of the house. Schober said he was going to move his vehicle out of its wood parking structure and then leave the area.

Fire personnel arrived at the residence and I proceeded approximately one quarter of a mile north to 2180 Old Sherwin Road. As I drove to 2180 Old Sherwin Road, I noticed the fire had jumped Lower Rock Creek Road and was burning on the east shoulder of Lower Rock Creek Road.

After conducting evacuation proceedures at 2180 Old Sherwin Road the wind shifted to the north and the fire began heading north along Lower Rock Creek Road. I spent the remainder of my shift conducting evacuation proceedures.

On 02-07-2015, I was assigned to assist Fire Prevention Officer Tominaga with fire investigation.

On 02-07-2015, at about 0936 hours, I contacted Donald "Don" Perea, who resides at

Perea told me the following in summary:

On 02-06-2015, He was working near his shop using a light and listening to the radio. At about 1400 hours, Perea said his radio stopped playing and his work light went out. Perea then looked to the south toward "Walt's" place (referencing Walter Schober's residence at telephone to call 911 since his land line telephone was not working. The call record from Perea's cellular telephone showed a 911 call at 1402 hours, on 02-06-2015. Perea guickly drove to the same was not working.

Schober. Schober was not at the residence. Perea saw the trees behind Schober's residence on fire and feared Schober's residence would be burned. Perea returned to his residence and began evacuating livestock at the ranch.

I ended my interview with Perea and requested him to complete a written statement form.

I attempted to contact Schober through-out the day with negative results.

I checked the Inyo County Sheriff dispatch incident log to find the original reporting party. The incident report showed Don Perea as the original reporting party to the Sheriff's Office at 1403 hours, on 02-06-2015. I spoke with dispatcher Frew who stated there were two calls following Perea reporting the fire. No information for the callers was gathered, due to the incident previously being reported. Frew noted that the two following calls had no pertinent information and the callers could only inform him of smoke in north end of Round Valley.

On 02-08-2015, at about 1030 hours, I contacted Schober near the road closer for the fire on Lower Rock Creek

Prepared 1	By:	Date:	Approved	l By:	Date:
SND1	DERR, NATHANIEL	02/07/2015	SDC1	CARTER, DONNY	02/09/2015

CR#15-03-009



INYO COUNTY SHERIFF'S DEPARTMENT

550 SOUTH CLAY STREET INDEPENDENCE, CA 93526 NARRATIVE

760-878-0383

15-02-021

Page 3

Road.

Schober told me the following in summary:

On 02-06-2015, at 1330 hours, he left his residence and drove to into town (Bishop) to pick-up his dogs from the groomers. After retrieving his dogs and running to the hardware store he began returning to his residence. While driving to his residence he was passed by emergency personnel. Schober then saw the smoke column and though it might be on the "mesa" a nearby housing community. As Schober drove closer he noticed the fire to be at his residence. Schober noticed several trees down on his property but did not know where the fire started. Prior to leaving his residence Schober did not notice anything unusual. Schober had no further information.

I ended my interview with Schober.

As of this report I have not received a written statement from Perea.

I was unable to locate any further witnesses at the time of this report.

Case Status:

Open / Forwarded to CAL-Fire.

Prepared By:

SND1 DERR, NATHANIEL

Date:

02/07/2015

Approved By:

SDCI CARTER, DONNY

Date:

02/09/2015

10.6 - CALFIRE FC-34 Dispatch Report



Incident Number: 15-CABDU 001662

Apartment:

Incident Name: ROUND Event Number: 15002006

Detail Report-All Segment

Incident Location Incident Status: CLS

Location: =L(37.453267,-118.581767) , ROUND_VALLEY_AREA

Hi Cross:

Lo Cross:

Map Page: 4919/4919 ROUND VALL INYO County:

City: Loc Com:

Latitude: 37.453267 CABDU Dispatch Zone: 4 Agency: Longitude: -118.581767 CABDU **B4** Jurisdiction: Battalion: 04 T06S R31E M CABDU P1 Resp. Area: Legal: DPA Agency: 11 360096 4146331 P1 UTM: Atom:

LEGAL

0 04_T06S R31E M

Reporting Party Information

Caller Name: Caller Phone: BUS Caller Loc: Call Source:

Incident Type/Response Information

Final Incident Type: FIRE, WILDLAND Initial Incident Type: FIRE, WILDLAND Response Plan: BDUD Dispatch Level: L Response Level: 1

Incident Date/Time Summary

Incident Call Rec.:

Incident Keystroke: 02/06/2015 14:05:27 Personnel ID CAD Workstation 02/06/2015 14:07:51 MALOT BDUCAD03 Incident Entry: 02/06/2015 14:07:57 WILSE BDUCAD02 fncident Dispatch: 02/16/2015 8:05:38 Incident Closed:

Fire Information

CTRL Contained: 02/12/2015 6:00:00 Controlled: 02/16/2015 7:00:00 Status:

FRANKLIN, MATTHEW Total Acres Burned: 6537 Fire Report Person:

Investigation Report Person:

Time Summary:						
IAW	DSP	ENR	ONS	AAC	CLS	WAI
14:07.51	14:07.57	14:08.32	14:16.29	15:00.22	15:00.30	18:01.52
DSP	AAC	CLS				
18:02.58	18:03.00	8:05.38	1			



Incident Number: 15-CABDU 001662

Incident Name: ROUND Event Number: 15002006

			—	3		
Unit Status I	Details .		; <u>; </u>		2.	
DSP 15:23:44	ENR 15:23:44	ONS 16:58:22	AOS 9:58:25	AIQ 17:46:48		
B3514B						
DSP 14:08:32	ENR 14:08:32	ONS 14:16:29	AOS 8:06:40	AV 16:24:22	ONS 16:39:59	DSP 16:39:59
AOS 16:40:03	AV 17:06:10					
B3516		-				
DSP 15:20:57	ENR 15:22:26	ONS 19:45:33	AIQ 16:28:20	DSP 16:38:05	ONS 16:38:05	RTQ 10:46:16
AIQ 14:27:50						
B3518	,					
DSP 15:20:57	ENR 15:22:26	ONS 19:45:33	RTQ 10:09:34	AIQ 14:10:20		
в3520						
ONS 8:00:00	DSP 8:00:00	AIQ 20:40:05				
C3500						
DSP 8:32:57	ONS 8:32:57	RTQ 18:11:02	AIQ 8:40:48			
D3502			-	•		
ONS 7:50:46	DSP 7:50:46	AIQ 18:10:57				
D3504A	•		•			
DSP 14:07:57	AIQ 14:09:08	DSP 14:25:53	AIQ 14:26:23	DSP 19:40:29	AIQ 19:40:33	
D3505		<u> </u>				* :
DSP 14:13:43	ENR 14:13:43	ONS 16:58:50	AIQ 15:00:22			
DOZ3540			ol .			
DSP 15:25:28	ENR 15:25:28	ONS 20:36:17	RTQ 12:20:26	AIQ 17:21:26		
DOZ3543						
DSP 14:10:29	ENR 14:13:52	ONS 14:19:50	AIQ 7:39:53			
E3557						
DSP 15:20:57	ENR 15:22:33	ONS 19:11:01	RTQ 8:51:21	AIQ 19:55:25		
E3558						
DSP 15:20:57	ENR 15:22:33	ONS 19:11:01	ENR 19:11:13	ONS 19:47:04	RTQ 12:44:03	AIQ 14:21:36
560	<u> </u>		v=5			· · · · · · · · · · · · · · · · · · ·
DSP 15:20:57	ENR 15:22:33	ONS 19:11:01	RTQ 12:44:03	AIQ 12:51:40		



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

DSP 14:07:57	ENR 14:10:40	ONS 14:20:23	AIQ 21:48:30	
E3564				
DSP 14:07:57	ENR 14:09:29	ONS 15:03:37	AIQ 21:48:30	
E3568			•	2
DSP 15:20:57	ENR 15:22:33	ONS 19:47:04	RTQ 8:51:21	AIQ 19:55:25
E3578				h.
DSP 15:20:57	ENR 15:22:33	ONS 19:11:08	RTQ 12:44:03	AIQ 12:44:51
E3632				
ENR 14:12:06	DSP 14:12:06	AIQ 14:33:59		
FCY3		•	,	
DSP 19:50:49	ENR 19:50:49	ONS 21:19:33	RTQ 9:11:51	AIQ 17:15:51
FCY6		•		
DSP 19:50:55	ENR 19:50:55	ONS 21:19:33	RTQ 9:11:51	AIQ 17:15:51
H305			•	
DSP 8:15:46	ENR 8:15:46	ONS 11:30:10	RTQ 14:52:02	AIQ 16:27:28
INFE41			·	
DSP 14:07:57	AIQ 16:58:59			
OVY1		1		
DSP 14:10:29	ENR 14:14:36	ONS 14:37:13	AIQ 7:39:59	
OVY2		<u> </u>		5
DSP 14:10:29	ENR 14:13:36	ONS 14:37:13	AIQ 7:39:59	
OAA3		-		•
DSP 14:10:30	ENR 14:14:31	ONS 14:37:13	AIQ 18:15:54	
OVY4				
DSP 14:10:30	ENR 14:21:46	ONS 14:37:13	AIQ 7:39:59	
OVY5		-		
DSP 14:10:30	ENR 14:18:02	ONS 14:37:13	AIQ 18:15:54	
P3522				
DSP 14:25:53	ENR 14:38:36	ONS 19:45:29	AIQ 20:41:46	
٥٥١				Pi
ENR 21:10:29	DSP 21:10:29	ONS 23:15:17	RTQ 14:44:58	AIQ 17:14:49
PDO2				
				*



Incident Number: 15-CABDU 001662

Incident Name: ROUND Event Number: 15002006

DSP	ACK	ENR	ONS	AIQ	
22:35:13	22:35:17	0:55:47	7:34:23	18:03:08	
PDO3			l		
PD03			20		
DSP	ACK	ENR	ONS	AIQ	
22:35:13	22:35:17	0:55:47	7:34:23	18:03:08	
PDO4					
ENR	DSP	ONS	RTQ	AIQ	
21:10:29	21:10:29	23:15:17	14:44:58	17:14:49	
PLT1					
DSP	ENR	ONS	RTQ	AIQ	
19:46:50	19:46:50	7:34:23	8:51:21	13:46:07	
PLT2					
ENR	DSP	ONS	RTQ	AIQ	
19:46:50	19:46:50	7:34:23	8:51:21	13:46:07	
PLT3					
PLT3					
DSP	ENR	ONS	RTQ	AIQ	
19:46:50	19:46:50	7:34:23	11:56:14	17:14:44	
PLT4					•
ENR	DSP	ONS	RTQ	AIQ	
19:46:50	19:46:50	7:34:23	11:56:14	17:14:44	
U3581					
DSP	ACK	QIA	ı		
9:21:49	9:21:57	17:32:32			
		300 00000000000000000000000000000000000	ļ		
USFS					
DSP	AIQ	DSP	AIQ	DSP	
14:07:57	14:09:10	14:25:53	14:30:20	18:02:58	
	L				



Incident Number: 15-CARDU 001662

Incident Name: ROUND
Event Number: 15002006

Incident Re	marks:		
02/06/2015	14:20:37	14b; ROUND IC / 3-5 ACRES / RAPID ROS / STR THREAT	BRUNR
02/06/2015	14:21:41	101: FIRE JUMP ROCK CRK / STRS INVOLVED /	BRUNR
02/06/2015	14:32:12	pwr lines down all units confirmed except doz3543, federal equip,	MALOT
02/06/2015	15:02:00	b3514b advised IC: LAT/LONG 37 27.196 - 118 34.906M	BRUNR
02/06/2015	15:33:08	IC: 12 ACRES / 1 ACRE SPOT FIRE / REQ 5 ADD ENGINES //	BRUNR
02/06/2015	15:34:07	IC: REQ 1 ST OF CREWS	BRUNR
02/06/2015	15:53:29	IC: 50 ACRES / 100 STR THREAT	BRUNR
02/06/2015	16:26:10	3505: UNIFIED CMND WITH MONO CO SO & INYO SO	BRUNR
02/06/2015	16:34:02	SWALL MEADOW SPOT FIRE APPX 3 ACRES / EVAC IN PROCESS OF SWALL MEADOWS	BRUNR
02/06/2015	17:20:05	IC: 1 STR LOSS / 4866 DEER PEAK TRL , ROUND_VALLEY_AREA	BRUNR
02/06/2015	17:53:44	3505 & 14B: FIRE RUNNING ONTO INF / INTER AGENCY ADVISE FOR UNIFIED	BRUNR
2/06/2015	21:27:56	AS OF 2100 D3505 WILL TAKE IC B3514B WILL BECOME DEP IC// UNIFIED COMMAND WITH INF AND BLM	FELDJ
02/06/2015	23:36:46	sce: powerline down in the road, valley view/wilson,,,, sce ref #:85-11431	WILSF
		req sce to confirm power is out to swall meadows as well as paradise,,,, sce ref: #	
		ic; winds 30 g50 from the south	
		0500 spot weather forecasts requested	
2/06/2015	23:45:40	per mcentosh at sce bishop contril; power is out to paradise and	WILSF
2/07/2015	9:08:02	swall meadows, also advised of line down at valley view/wilson edison sup and mono co rds notified to meet b3118 mcgough at ovy camp. no eta given	WILKJ
2/07/2015	10:04:08	OPS: REQ ALS AMB FOR FF ALOC / SYMONS ENROUTE	BRUNR
02/07/2015	10:26:13	SYMONS TRANSPORTING FF TO N INYO HOSP	BRUNR
2/07/2015	12:41:03	per ops: chp notified with hard closure @ lower rock creek to allow only edison through for mandatory work	WILKJ
02/10/2015	15:25:25	bennett milloy: civilian volunteers to contact local red cross. milloy's number: 909.965.3448. per bishop pd/ some civilian volunteers requesting assistance other than red cross. milloy will contact.	WILKJ
02/12/2015	16:43:10	update cont time per b3514b	WILKJ



Incident Number: 15-CABDU 001662

Incident Name: ROUND Event Number: 15002006

ENTRY 02/06/2015 14:07:51 MALOT BDUCAD03 FDID: 14555 SUGG 02/06/2015 14:07:55 Nearby: E3555[ENG3]#4 SUGDEF 02/06/2015 14:07:55	
FDID: 14555 SUGG 02/06/2015 14:07:55 Nearby: E3555[ENG3]#4	
SUGG 02/06/2015 14:07:55 Nearby: E3555[ENG3]#4	
Nearby: E3555[ENG3]#4	
SUGDER 02/06/2015 14:07:55	
00000E	_
SUGG 02/06/2015 14:07:55	
Primary: E3561.+[ENG3]#1, E3564.+[ENG3]#4, INFE41[ENG3]#5, USFS[OTH]#99, D3504A[BOT]#99	
SUGG 02/06/2015 14:07:55	
Nearby: E3555[ENG3]#4	
SUGDEF 02/06/2015 14:07:55	
SUGG 02/06/2015 14:07:55	_
Primary: E3561.+[ENG3]#1, E3564.+[ENG3]#4, INFE41[ENG3]#5, USFS[OTH]#99, D3504A[BOT]#99	
DSP 02/06/2015 14:07:57 MALOT BDUCAD03	
E3561 (ENG3) E3564 (ENG3) INFE41 (ENG3) USFS (OTH) D3504A (BOT) JURISDICTION NUMBER \$CABDU001662	
FREQA 02/06/2015 14:07:57 MALOT BDUCAD03	
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical:(none) Air to Air:AIR TAC 6	Ai:
to Ground:CDF ATG Victor:VICTOR FAT	
DSP 02/06/2015 14:07:57 MALOT BDUCAD03	
<none>> ROUND VALLEY ROUND_VALLEY</none>	
INCN 02/06/2015 14:07:57 MALOT BDUCAD03	
Fire Number \$ONE00091 Created	
UNCN 02/06/2015 14:07:57 MALOT BDUCAD03	
ite Number \$CABDU001662 Created	
TRNS 02/06/2015 14:07:58 MALOT BDUCAD03	
G/CMD	
FREQA 02/06/2015 14:08:32 BRUNR BDUCAD02	
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical:(none) Air to Air:AIR TAC 6	Ai:
to Ground:CDF ATG Victor:VICTOR FAT	
DE 02/06/2015 14:08:32 BRUNR BDUCAD02	
B3514B (BAT)	
AIQ 02/06/2015 14:09:08 BRUNR BDUCAD02	
D3504A	
AIQ 02/06/2015 14:09:10 BRUNR BDUCAD02	
USFS	
ENR 02/06/2015 14:09:29 BRUNR BDUCAD02	
E3564	
FREQA 02/06/2015 14:10:29 BRUNR BDUCAD02	
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical:(none) Air to Air:AIR TAC 6	Ai:
to Ground:CDF ATG Victor:VICTOR FAT	
DSP 02/06/2015 14:10:30 BRUNR BDUCAD02	
DOZ3543 (DOZ2) OVY1 (CRW1) OVY2 (CRW1) OVY3 (CRW1) OVY4 (CRW1) OVY5 (CRW1)	
ENR 02/06/2015 14:10:40 BRUNR BDUCAD02	
E3561	
FREQA 02/06/2015 14:12:06 MALOT BDUCAD03	
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical:(none) Air to Air:AIR TAC 6	Ai
to Ground:CDF ATG Victor:VICTOR FAT	
DE 02/06/2015 14:12:06 MALOT BDUCAD03	
%3632 (ENG3)	
STATUSX 02/06/2015 14:13:03	_
Unit INFE41 Status timer expired after 5 MIN	
STATUSX 02/06/2015 14:13:33	
0101000 AV AA AA 12 17 17 17 17 17 17 17 17 17 17 17 17 17	



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

<u> </u>	
ENR 02/06/2015 14:13:36	BRUNR BDUCAD02
OVY2	AND ALL OFFICE AND AL
FREQA 02/06/2015 14:13:42	BRUNR BDUCAD02
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical	: (none) Air to Air:AIR TAC 6 Air
to Ground:CDF ATG Victor:VICTOR FAT	
DE 02/06/2015 14:13:43	BRUNR BDUCAD 02
D3505 (DCH)	
ENR 02/06/2015 14:13:52	MALOT BDUCAD03
DOZ3543	
STATUSX 02/06/2015 14:14:28	
Unit E3564 Status timer expired after 5 MIN	anima and a Anima
ENR 02/06/2015 14:14:31 OVY3	BRUNR BDUCAD02
	DDIND DDIGADAA
ENR 02/06/2015 14:14:36 OVY1	BRUNR BDUCAD02
STATUSX 02/06/2015 14:15:29	
Unit OVY5 Status timer expired after 5 MIN	
STATUSX 02/06/2015 14:15:29	
Unit OVY4 Status timer expired after 5 MIN	
STATUSX 02/06/2015 14:15:41	
Unit E3561 Status timer expired after 5 MIN	
ONS 02/06/2015 14:16:29	BRUNR BDUCAD 02
B3514B	
STATUSX 02/06/2015 14:17:12	
Unit E3632 Status timer expired after 5 MIN	
INR 02/06/2015 14:18:02	BRUNR BDUCADO2
OVY5	
STATUSX 02/06/2015 14:18:38	
Unit OVY2 Status timer expired after 5 MIN	
STATUSX 02/06/2015 14:18:44	-
Unit D3505 Status timer expired after 5 MIN	
STATUSX 02/06/2015 14:18:56	
Unit DOZ3543 Status timer expired after 5 MIN	
STATUSX 02/06/2015 14:19:32	
Unit OVY3 Status timer expired after 5 MIN	
STATUSX 02/06/2015 14:19:38	
Unit OVY1 Status timer expired after 5 MIN	
ONS 02/06/2015 14:19:50	MALOT BDUCAD03
DOZ3543 FRPNAME 02/06/2015 14:20:23	MAT AM
<pre><pre></pre><pre><pre><pre><pre></pre><pre></pre><pre><pre><pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre><pre></pre></pre></pre></pre></pre></pre></pre></pre></pre>	MALOT BDUCAD03
ONS 02/06/2015 14:20:23	MALOT BDUCAD03
E3561	
CHNG 02/06/2015 14:20:37	BRUNR BDUCAD02
Remarks Entered;	: —— —— 5 — 5 —
CHNG 02/06/2015 14:21:41	BRUNR BDUCAD02
Remarks Entered;	
ENR 02/06/2015 14:21:46	BRUNR BDUCAD 02
OVY4	
STATUSX 02/06/2015 14:23:05	34 34 + 102 - 0
Unit OVY5 Status timer expired after 5 MIN	
CIN 02/06/2015 14:24:14	BRUNR BDUCADO2
COUND VALLEY ROUND_VALLEY> ROUND	
RSI 02/06/2015 14:24:38	BRUNR BDUCAD02
Incident sent to ROS.	(I)
SUGDEF 02/06/2015 14:25:45	
Level 1, Path: G 2 ENG*CDF, Path: G 1 ENG*USFS	



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		
SUGG 02/06/2015 14:25:45		
Primary: USFS[OTH]#99, D3504A[BOT]#99		
SUGG 02/06/2015 14:25:45		
Nearby: E3555[ENG3]#4		
DSP 02/06/2015 14:25:53	MALOT	BDUCAD03
USFS (OTH) D3504A (BOT) P3522 (PRV)		
FREQA 02/06/2015 14:25:53	MALOT	BDUCAD03
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 A	Alternate Tactical: (none)	Air to Air:AIR TAC 6 Ai
to Ground:CDF ATG Victor:VICTOR FAT		
AIQ 02/06/2015 14:26:23	BRUNR	BDUCAD02
D3504A		
STATUSX 02/06/2015 14:26:50		
Unit OVY4 Status timer expired after 5 MIN		
AIQ 02/06/2015 14:30:20	BRUNR	BDUCAD02
USFS		
STATUSX 02/06/2015 14:30:54		
Unit P3522 Status timer expired after 5 MIN		
CHNG 02/06/2015 14:32:12	MALOT	BDUCAD03
Remarks Entered;		
AIQ 02/06/2015 14:33:59	MALOT	BDUCAD03
E3632		
STATUSX 02/06/2015 14:36:35		
Unit B3514B Status timer expired after 20 MIN		
ONS 02/06/2015 14:37:13	BRUNR	BDUCAD02
OVY2		
)NS 02/06/2015 14:37:13	BRUNR	BDUCAD02
OVY3		NAME OF TAXABLE PARTY.
ONS 02/06/2015 14:37:13	BRUNR	BDUCAD02
OVY4		
ONS 02/06/2015 14:37:13	BRUNR	BDUCAD02
OVY5		
ONS 02/06/2015 14:37:13	BRUNR	BDUCAD02
OVY1		
ENR 02/06/2015 14:38:36	MALOT	BDUCAD03
P3522		
STATUSX 02/06/2015 14:39:55		
Unit DOZ3543 Status timer expired after 20 MIN		
STATUSX 02/06/2015 14:40:26		
Unit E3561 Status timer expired after 20 MIN		
STATUSX 02/06/2015 14:43:41		
Unit P3522 Status timer expired after 5 MIN		
STATUSX 02/06/2015 14:57:16		
Unit OVY1 Status timer expired after 20 MIN		
STATUSX 02/06/2015 14:57:16		
Unit OVY2 Status timer expired after 20 MIN		<u></u>
STATUSX 02/06/2015 14:57:16		
Unit OVY3 Status timer expired after 20 MIN		
STATUSX 02/06/2015 14:57:16		
Unit OVY4 Status timer expired after 20 MIN		
STATUSX 02/06/2015 14:57:16		
Unit OVY5 Status timer expired after 20 MIN		
HNG 02/06/2015 15:02:00	BRUNR	BDUCAD02
Aemarks Entered;		
CHNG 02/06/2015 15:02:21	BRUNR	BDUCAD02
Location: ROUND VALLEY @ =L(37.419444,-118.586666)	,ROUND_VALLEY_AREA ==>	=L(37.453267,-118.581767)
, ROUND_VALLEY_AREA ;		



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

CACPT 02/06/2015 15:02:21	BRUNR	BDUCAD02
[1568 BLK N ROUND VALLEY RD , ROUND VALLEY AREA] => [1604 BLK GORG	E RD , ROUND VALLEY	AREA]
ONS 02/06/2015 15:03:37	BRUNR	BDUCAD02
E3564		
PLCREQ 02/06/2015 15:17:58	BRUNR	BDUCAD02
Req#:TBA. Temporary ID:BDU06.005. Item:CRW1. Catalog:Crew, Type 1. W	hen Needed: 02/06/2	015-15:17:23.
Agency preference:. Place with: CABDCC. FAA:. ROS notified.		
PLCREQ 02/06/2015 15:17:58	BRUNR	BDUCAD02
Req#:TBA. Temporary ID:BDU06.006. Item:DOZ2. Catalog:Dozer, Type 2.	When Needed: 02/06/	2015-15:17:23.
Agency preference: Place with: CABDCC. FAA: ROS notified. PLCREO 02/06/2015 15:17:58	BRUNR	BDUCAD02
Secretary Comment Comments		
Req#:TBA. Temporary ID:BDU06.007. Item:ENG3. Catalog:Engine, Type 3. Agency preference: Place with:CABDCC. FAA:. ROS notified.	when Needed: 02/06	/2015-15:17:23
PLCREO 02/06/2015 15:17:58	BRUNR	BDUCAD02
Req#:TBA. Temporary ID:BDU06.008. Item:ENG3. Catalog:Engine, Type 3.		
Agency preference: Place with: CABDCC. FAA: ROS notified.		
ROSRFR 02/06/2015 15:17:58	BRUNR	BDUCAD02
Fill requests sent for: OVY1,0VY2,0VY3,0VY4,0VY5,DOZ3543,E3561,E3564	,B3514B	
PLCREQ 02/06/2015 15:17:58	BRUNR	BDUCAD02
Req#:TBA. Temporary ID:BDU06.004. Item:CRW1. Catalog:Crew, Type 1. W	hen Needed: 02/06/2	015-15:17:23.
Agency preference: Place with: CABDCC. FAA: ROS notified.		
PLCREQ 02/06/2015 15:17:58	BRUNR	BDUCAD02
Req#:TBA. Temporary ID:BDU06.001. Item:CRW1. Catalog:Crew, Type 1. W	hen Needed:02/06/2	015-15:17:23.
Agency preference: Place with: CABDCC. FAA: ROS notified.	BDIND	22222222
PLCREQ 02/06/2015 15:17:58	BRUNR	BDUCAD02
eq#:TBA. Temporary ID:BDU06.002. Item:CRW1. Catalog:Crew, Type 1. W	hen Needed:02/06/2	015-15:17:23.
Agency preference: Place with:CABDCC. FAA: ROS notified. PLCREQ 02/06/2015 15:17:58	BRUNR	BDUCAD02
Req#:TBA. Temporary ID:BDU06.003. Item:CRW1. Catalog:Crew, Type 1. W		
Agency preference: Place with: CABDCC. FAA: ROS notified.	nen needed. V2/ UU/ 2	VIJ 15.17.25.
PLCREQ 02/06/2015 15:17:58	BRUNR	BDUCAD02
Req#:TBA. Temporary ID:BDU06.009. Item:CHFO. Catalog:CHIEF OFFICER (CALIFORNIA ONLY).	When
Needed:02/06/2015-15:17:23. Agency preference:. Place with:CABDCC. F	AA: ROS notified.	
FREQA 02/06/2015 15:20:56	BRUNR	BDUCAD 02
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical:	(none) Air to Air	:AIR TAC 6 Ai:
to Ground:CDF ATG Victor:VICTOR FAT		
DSP 02/06/2015 15:20:57	BRUNR	BDUCAD02
B3516 (BAT) B3518 (BAT) E3557 (ENG3) E3558 (ENG3) E3578 (ENG3) E3568 ENR 02/06/2015 15:22:26		
220000000	MALOT	BDUCAD03
B3518 ENR 02/06/2015 15:22:26	MALOT	BDUCAD03
B3516	AMILY I	LIJOURD US
ENR 02/06/2015 15:22:33	MALOT	BDUCAD03
E3568		
ENR 02/06/2015 15:22:33	MALOT	BDUCAD03
E3578		
ENR 02/06/2015 15:22:33	MALOT	BDUCAD03
E3560		
ENR 02/06/2015 15:22:33	MALOT	BDUCAD03
E3557		
ENR 02/06/2015 15:22:33	MALOT	BDUCAD03
3558		
AOSCLS 02/06/2015 15:23:02	BRUNR	BDUCAD02
Place Request Record Closed for CADRequestID BDU06.001		DDHOLD AA
ROSCLS 02/06/2015 15:23:02	BRUNR	BDUCAD02
Place Request Record Closed for CADRequestID BDU06.002		



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

ROSCLS 02/06/2015 15:23:02 BRÜNR	BDUCAD02	
Place Request Record Closed for CADRequestID BDU06.004		
RÖSCLS 02/06/2015 15:23:02 BRUNR	BDUCAD 02	
Place Request Record Closed for CADRequestID BDU06.005		
ROSCLS 02/06/2015 15:23:02 BRUNR	BDUCAD 02	
Place Request Record Closed for CADRequestID BDU06.006		
ROSCLS 02/06/2015 15:23:02 BRUNR	BDUCAD 02	å termed i
Place Request Record Closed for CADRequestID BDU06.007		
ROSCLS 02/06/2015 15:23:02 BRUNR	BDUCAD02	
Place Request Record Closed for CADRequestID BDU06.003		
ROSCLS 02/06/2015 15:23:04 BRUNR	BDUCAD02	
Place Request Record Closed for CADRequestID BDU06.008		
ROSCLS 02/06/2015 15:23:04 BRUNR	BDUCAD02	
Place Request Record Closed for CADRequestID BDU06.009		
STATUSX 02/06/2015 15:23:38		
Unit E3564 Status timer expired after 20 MIN		
FREQA 02/06/2015 15:23:43 BRUNR	BDUCAD 02	_
Command: CDF CMD 1:2 Primary Tactical: CDF TAC 3 Alternate Tactical: (none)	Air to Air:AIR TAC 6 A	Ai;
to Ground:CDF ATG Victor:VICTOR FAT		
DE 02/06/2015 15:23:44 BRUNR	BDUCAD 02	
B3514A (BAT)		
DE 02/06/2015 15:25:28 BRUNR	BDUČAD02	_
DOZ3540 (DOZ2)		
FREQA 02/06/2015 15:25:28 BRUNR	BDUCAD02	
Command: CDF CMD 1:2 Primary Tactical: CDF TAC 3 Alternate Tactical: (none)	Air to Air:AIR TAC 6 A	Aiı
o Ground:CDF ATG Victor:VICTOR FAT		
STATUSX 02/06/2015 15:27:29		
Unit B3518 Status timer expired after 5 MIN		
STATUSX 02/06/2015 15:27:29		
Unit B3516 Status timer expired after 5 MIN		
STATUSX 02/06/2015 15:27:35		
Unit E3578 Status timer expired after 5 MIN		
STATUSX 02/06/2015 15:27:35		
Unit E3568 Status timer expired after 5 MIN STATUSX 02/06/2015 15:27:35		
Unit E3560 Status timer expired after 5 MIN STATUSX 02/06/2015 15:27:35		
Unit E3557 Status timer expired after 5 MIN		
STATUSX 02/06/2015 15:27:35		
Unit E3558 Status timer expired after 5 MIN		
STATUSX 02/06/2015 15:28:48		
Unit B3514A Status timer expired after 5 MIN		
STATUSX 02/06/2015 15:30:31		
Unit DOZ3540 Status timer expired after 5 MIN		
CACPT 02/06/2015 15:33:08 BRUNR	BDUCAD02	
[1604 BLK GORGE RD , ROUND VALLEY AREA] ==> []	2000002	
CHNG 02/06/2015 15:33:08 BRUNR	BDUCAD02	
Remarks Entered;	2004202	
CHNG 02/06/2015 15:34:07 BRUNR	BDUCAD02	
Remarks Entered;		
CENG 02/06/2015 15:53:29 BRUNR	BDUCAD02	
'emarks Entered;		
CHNG 02/06/2015 16:26:10 BRUNR	BDUCAD02	_
Remarks Entered;		
CHNG 02/06/2015 16:34:02 BRUNR	BDUCAD02	
Remarks Entered;		



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

ONS 02/06/2015 16:58:22 Overide: 2/6/1	15 16:00 BRUNR	BDUCAD02
B3514A Override		
STATUSX 02/06/2015 16:58:26		_
Unit B3514A Status timer expired after 20 MIN		
ROSRFR 02/06/2015 16:58:40	BRUNR	BDUCAD 02
Fill requests sent for: B3514A		
PLCREQ 02/06/2015 16:58:40	BRUNR	BDUCAD 02
Req#:TBA. Temporary ID:BDU06.010. Item:CHFO. Catalog	g: CHIEF OFFICER (CALIFORNIA ON	LY). When
Needed: 02/06/2015-16:58:32. Agency preference: Place	2017/2017	
ONS 02/06/2015 16:58:50	BRONR	BDUCAD 02
D3505		
PLCRNUM 02/06/2015 16:58:55	CISWKS	CISWKS
Req#:0-0007 assigned to temporary ID:BDU06.010.		
CAD-CIS 02/06/2015 16:58:55		POLLROSI
Event Identifiers: CAD: BDU, Agc: CABDU, Event #:150		
Kind/Type needed:, Qual. needed:, Cat descr: , Cat l		
User Agc:, Req. User:, Fill resource Ros ID: , Ros 1 AIO 02/06/2015 16:58:59	Name: , Res ETD:, Res ETA:, Ce BRUNK	BDUCAD02
AIQ 02/06/2015 16:58:59	BRONK	BD0CAD02
STATUSX 02/06/2015 17:18:55		
Unit D3505 Status timer expired after 20 MIN		
CENG 02/06/2015 17:20:05	BRUNR	BDUCAD02
Remarks Entered;	BROWN	DD COM CZ
CENG 02/06/2015 17:53:44	BRUNR	BDUCAD02
Remarks Entered:		2000202
NS 02/06/2015 19:11:01	MALOT	BDUCAD03
£3558		
ONS 02/06/2015 19:11:01	MALOT	BDUCAD03
E3560		
ONS 02/06/2015 19:11:01	MALOT	BDUCAD03
E3557		
ONS 02/06/2015 19:11:08	MALOT	BDUCAD03
E3578		
ENR 02/06/2015 19:11:13	MALOT	BDUCAD03
E3558		
STATUSX 02/06/2015 19:16:15	sī.	
Unit E3558 Status timer expired after 5 MIN		
STATUSX 02/06/2015 19:31:03		<u> </u>
Unit E3560 Status timer expired after 20 MIN		-
STATUSX 02/06/2015 19:31:03		<u>10, 10 0</u> 0
Unit E3557 Status timer expired after 20 MIN		
STATUSX 02/06/2015 19:31:09		
Unit E3578 Status timer expired after 20 MIN	BAITIT.	DEFASE
ONS 02/06/2015 19:45:29	BRUNR	BDUCAD02
P3522	Daram	DOMANDA
ONS 02/06/2015 19:45:33	BRUNR	BDUCAD02
B3518 ONS 02/06/2015 19:45:33	param	BDUCAD02
ONS 02/06/2015 19:45:33 B3516	BRUNR	BDUCADUZ
CLOC 02/06/2015 19:45:55	BRUNR	BDUCAD02
B3516[STL 9350C]	BRUNK	BUUCADUZ
CLOC 02/06/2015 19:46:02	BRUNR	BDUCAD 02
A3518[STL 9350C]	DAUMA	DUCADUZ
CLOC 02/06/2015 19:46:12	ERUNR	EDUCAD02
E3557[ST 9350C]	DIVOTE	
CLOC 02/06/2015 19:46:16	BRUNR	BDUCAD02
E3558[ST 9350C]		
- Augustican - Compility 2-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1		



Incident Number: 15-CABDU 001662

Incident Name: ROUND Event Number: 15002006

CLOC 02/06/2015 19:46:20	BRUNR	BDUCAD02	
E3560[ST 9350C]			Fr
CLOC 02/06/2015 19:46:28	BRUNR	BDUCAD02	
E3568[ST 9350C]			
CLOC 02/06/2015 19:46:33	BRUNR	BDUCAD02	
E3578[ST 9350C]			
DE 02/06/2015 19:46:50	BRUNR	BDUCAD02	
PLT1 (CRW1) PLT2 (CRW1) PLT3 (CRW1) PLT4 (CRW1)			
FREQA 02/06/2015 19:46:50	BRUNR	BDUCAD02	
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical	: (none)	Air to Air:AIR TAC 6	Ai
to Ground:CDF ATG Victor:VICTOR FAT	DDIMID	DD1701500	
ONS 02/06/2015 19:47:04	BRUNR	BDUCAD02	
ONS 02/06/2015 19:47:04	BRUNR	BDUCAD02	
E3558	BRONK	BD0CAD02	
CLOC 02/06/2015 19:47:36	BRUNR	BDUCAD 02	
E3558[ST 9350C]	BRUNK	BD0CAD02	
CLOC 02/06/2015 19:47:52	BRUNR	BDUCAD02	
B3514B[ROUND IC]	LINOIR	DDOCAD02	
CLOC 02/06/2015 19:48:04	BRUNR	BDUCAD02	
E3568[ST 9350C]		DUO CADOZ	
CLOC 02/06/2015 19:49:14	BRUNR	BDUCAD02	
PLT3[ST 9370G]		2000000	
CLOC 02/06/2015 19:49:26	BRUNR	BDUCAD02	
PLT4[ST 9370G]			
TIOC 02/06/2015 19:50:26	BRUNR	BDUCAD02	
LT1[ST 9371G]			
CLOC 02/06/2015 19:50:30	BRUNR	BDUCAD02	<u> </u>
PLT2[ST 9371G]			
DE 02/06/2015 19:50:49	BRUNR	BDUCAD02	
FCY3 (CRW1)			
FREQA 02/06/2015 19:50:49	BRUNR	BDUCAD02	
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical	: (none)	Air to Air:AIR TAC 6	Aiı
to Ground:CDF ATG Victor:VICTOR FAT			
FREQA 02/06/2015 19:50:54	BRÜNR	BDUCAD02	
Command: CDF CMD 1:2 Primary Tactical: CDF TAC 3 Alternate Tactical	: (none)	Air to Air:AIR TAC 6	Ai:
to Ground:CDF ATG Victor:VICTOR FAT			
DE 02/06/2015 19:50:55	BRUNR	BDUCAD 02	
FCY6 (CRW1)		-	
CLOC 02/06/2015 19:51:17	BRUNR	BDUCAD02	
FCY3[ST 9385G]			
CLOC 02/06/2015 19:51:21	BRUNR	BDUCAD02	
FCY6[ST 9385G]			
STATUSX 02/06/2015 19:51:50			
Unit PLT1 Status timer expired after 5 MIN STATUSX 02/06/2015 19:51:50			
Unit PLT2 Status timer expired after 5 MIN			
STATUSX 02/06/2015 19:51:50			
Unit PLT3 Status timer expired after 5 MIN			
STATUSX 02/06/2015 19:51:50			
Unit PLT4 Status timer expired after 5 MIN			
ROSCLS 02/06/2015 19:54:56	BRUNR	BDUCAD02	
lace Request Record Closed for RequestNumber 0-0007			
STATUSX 02/06/2015 19:55:53			
Unit FCY3 Status timer expired after 5 MIN			
STATUSX 02/06/2015 19:55:54			
Unit FCY6 Status timer expired after 5 MIN			
		i.h	



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

GENERAL AND	
STATUSX 02/06/2015 20:05:31	
Unit P3522 Status timer expired after 20 MIN STATUSX 02/06/2015 20:05:38	
TANANTANAN AND AND THE PROPERTY OF A PROPERT	
Unit B3516 Status timer expired after 20 MIN STATUSX 02/06/2015 20:05:38	
Unit B3518 Status timer expired after 20 MIN	
STATUSX 02/06/2015 20:07:09	
Unit E3558 Status timer expired after 20 MIN	
STATUSX 02/06/2015 20:07:09	
Unit E3568 Status timer expired after 20 MIN	
ONS 02/06/2015 20:36:17 FELDJ	BDUCAD01
DOZ3540	
STATUSX 02/06/2015 20:56:20	
Unit DOZ3540 Status timer expired after 20 MIN	
FREQA 02/06/2015 21:10:29 BRUNR	BDUCAD02
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical:(none)	Air to Air: AIR TAC 6 Ai
to Ground:CDF ATG Victor:VICTOR FAT	
DE 02/06/2015 21:10:29 BRUNR	BDUCAD02
PDO1 (CRW1) PDO4 (CRW1)	
STATUSX 02/06/2015 21:15:30	
Unit PDO4 Status timer expired after 5 MIN	
STATUSX 02/06/2015 21:15:30	
Unit PDO1 Status timer expired after 5 MIN	
ONS 02/06/2015 21:19:33 WILSE	BDUCAD04
FCY3	
NS 02/06/2015 21:19:33 WILSE	BDUCAD04
FCY6	
CLOC 02/06/2015 21:19:58 WILSE	BDUCAD04
FCY3[ST9385G]	
CLOC 02/06/2015 21:19:58 WILSE	BDUCAD04
FCY6[ST9385G]	
CLOC 02/06/2015 21:21:44 BRUNE	BDUCAD02
FCY6[ST 9385G]	
CLOC 02/06/2015 21:21:47 BRUNE	BDUCAD02
FCY3[ST 9385G]	
CLOC 02/06/2015 21:26:14 FELDJ	BDUCAD01
D3505[ROUND IC]	
CLOC 02/06/2015 21:26:47 FELDJ	BDUCAD01
B3514B[DEP ROUND IC]	
CHNG 02/06/2015 21:27:56 FELDS	BDUCAD01
Remarks Entered;	
STATUSX 02/06/2015 21:39:38	
Unit FCY3 Status timer expired after 20 MIN	
STATUSX 02/06/2015 21:39:38	-
Unit FCY6 Status timer expired after 20 MIN	
DSP 02/06/2015 22:35:13 BRUNE	BDUCAD02
PDO2 (CRW1) PDO3 (CRW1)	
FREQA 02/06/2015 22:35:13 BRUNF	BDUCĂD02
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical:(none)	ALL CO ALL: MIR TAC 6 AL)
to Ground:CDF ATG Victor:VICTOR FAT ACK 02/06/2015 22:35:17 BRUNF	BDUCAD02
DO3	DD CADOZ
ACK 02/06/2015 22:35:17 BRUNF	BDUCAD02
PD02	BUCKEUZ.
ONS 02/06/2015 23:15:17 WILSE	BDUCAD04
PD04	PDOCWD04
EDVT	



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

ONS 02/06/2015 23:15:17	WILSF	BDUCAD04
PDO1		
CLOC 02/06/2015 23:15:33	WILSF	BDUCAD04
PDO4[ST9384G]		
CLOC 02/06/2015 23:15:33	WILSF	BDUCAD04
PD01[ST9384G]		
STATUSX 02/06/2015 23:35:20		
Unit PD01 Status timer expired after 20 MIN		
STATUSX 02/06/2015 23:35:20		
Unit PD04 Status timer expired after 20 MIN		
The state of the s	*****	
CHNG 02/06/2015 23:36:46	WILSF	BDUCAD04
Remarks Entered;		
CHNG 02/06/2015 23:45:40	WILSF	BDUCAD04
Remarks Entered;		
ENR 02/07/2015 0:55:47	LOESB	BDUCAD03
PDO2		
ENR 02/07/2015 0:55:47	LOESB	BDUCAD03
PDO3		
CLOC 02/07/2015 0:56:17	LOESB	BDUCAD03
PD02[ST9380G]		
CLOC 02/07/2015 0:56:17	LOESB	BDUCAD03
PD03[ST9380G]		
STATUSX 02/07/2015 1:00:49		
Unit PDO2 Status timer expired after 5 MIN		
STATUSX 02/07/2015 1:00:49		
nit PDO3 Status timer expired after 5 MIN		
ONS 02/07/2015 7:34:23	BRUNR	BDUCAD 02
PLT2	BROKK	BD0CAD02
35 To Table 101 To		200000000000000000000000000000000000000
ONS 02/07/2015 7:34:23	BRUNR	BDUCAD02
PDO2		
ONS 02/07/2015 7:34:23	BRUNR	BDUCAD02
PDO3		
ONS 02/07/2015 7:34:23	BRUNR	BDUCAD02
PLT1		
ONS 02/07/2015 7:34:23	BRUNR	BDUCAD02
PLT3		
ONS 02/07/2015 7:34:23	BRUNR	BDUCAD02
PLT4		
CLOC 02/07/2015 7:36:46	BRUNR	BDUCAD02
PLT3[ST 9370G]		
CLOC 02/07/2015 7:36:53	BRUNR	BDUCAD02
PLT4[ST 9370G]		
CLOC 02/07/2015 7:37:57	BRUNR	BDUCAD02
PLT2[ST 9371G]		
CLOC 02/07/2015 7:38:01	BRUNR	BDUCAD02
PLT3[ST 9371G]		DOUBLUZ.
	ропир	DDDCADA
CLOC 02/07/2015 7:38:25	BRUNR	BDUCAD 02
PLT3[ST 9370G]	**************************************	200000
CLOC 02/07/2015 7:38:32	BRUNR	BDUCAD02
PLT1[ST 9371G]		
CLOC 02/07/2015 7:39:48	BRUNR	BDUCAD02
DO2[ST 9380G]		
JLOC 02/07/2015 7:39:52	BRUNR	BDUCAD02
PD03[ST 9380G]		
FREQA 02/07/2015 7:50:46	WILKJ	BDUCAD01
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tactical:	(none) Air to Air	:AIR TAC 6 Ai
to Ground:CDF ATG Victor:VICTOR FAT	2000 Telegraph (2000)	



Incident Number: 15-CABDU 001662

Incident Name: ROUND Event Number: 15002006

DOS 02/07/2015 7:50:46	WILKJ	BDUCAD01	_
D3502 (DCH)		2000201	
STATUSX 02/07/2015 7:54:26			
Unit PDO2 Status timer expired after 20 MIN			
STATUSX 02/07/2015 7:54:26			
Unit PLT1 Status timer expired after 20 MIN			
STATUSX 02/07/2015 7:54:26			_
Unit PD03 Status timer expired after 20 MIN			
STATUSX 02/07/2015 7:54:26			
Init PLT2 Status timer expired after 20 MIN			
STATUSX 02/07/2015 7:54:26			
Unit PLT3 Status timer expired after 20 MIN			
STATUSX 02/07/2015 7:54:26			
Unit PLT4 Status timer expired after 20 MIN			
STATUSX 02/07/2015 8:10:51		:	
Unit D3502 Status timer expired after 20 MIN	_		
FREQU 02/07/2015 8:15:41	WILKJ	BDUCAD01	
VICTOR: VICTOR FAT (Tx:128.475 Rx:128.475) => <none></none>			
FREQU 02/07/2015 8:15:41	WILKJ	BDUCAD01	
AIR-TO-AIR: AIR TAC 6 (Tx:151.310 Rx:151.310) => AIR TAC 5 (Tx	and the second and the second		
DE 02/07/2015 8:15:46	BRUNR	BDUCAD02	
TREQA 02/07/2015 8:15:46	BRUNR	BDUCAD02	
The Control of Control			
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tact	ical:(none) Air	to Air: AIR TAC 5 A	Ai
o Ground:CDF ATG Victor:NULL_NAME SI 02/07/2015 8:16:33	WILKJ	BDUCAD01	
ncident sent to ROS.	MITTER	BDUCADUI	
FREQU 02/07/2015 8:19:42	WILKJ	BDUCAD01	
VICTOR: <none> ==> VICTOR BISHOP (Tx:135.975 Rx:135.975)</none>	WITHOU	BD0CAD01	
RSI 02/07/2015 8:19:50	WILKJ	BDUCAD 01	
Incident sent to ROS.	WILLO	BDOCADUI	
STATUSX 02/07/2015 8:20:48		_	_
Unit H305 Status timer expired after 5 MIN			
SUPP 02/07/2015 9:08:02	WILKJ	BDUCAD01	_
RSI 02/07/2015 9:08:06	WILKJ	BDUCAD01	_
Incident sent to ROS.			
CHNG 02/07/2015 10:04:08	BRUNR	BDUCAD02	
Remarks Entered;			
CHNG 02/07/2015 10:26:13	BRUNR	BDUCAD02	_
demarks Entered;			
ONS 02/07/2015 11:30:10	BRUNR	BDUCAD02	_
1305			
STATUSX 02/07/2015 11:50:11	-		-
Unit H305 Status timer expired after 20 MIN			
SUPP 02/07/2015 12:41:03	WILKJ	BDUCAD01	
AIQ 02/07/2015 21:48:30	BRUNR	BDUCAD02	_
3561 E3564			
DSP 02/08/2015 9:21:49	WILSF	BDUCAD03	
J3581 (UTL)			
FREQA 02/08/2015 9:21:49	WILSF	BDUCAD03	3.5
Command:CDF CMD 1:2 Primary Tactical:CDF TAC 3 Alternate Tact	ical: (none) Air	to Air:AIR TAC 5 A	Αi
to Ground:CDF ATG Victor:VICTOR BISHOP			
ACK 02/08/2015 9:21:57	WILSF	BDUCAD03	
73581			



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

ATO	02/08/2015	17.20.20		BRUNR	BDUCAD02	
AIQ U3581	02/08/2015	17:32:32		BRUNK	BDUCADU2	
DOS	02/09/2015	8:32:57		WILSF	BDUCAD02	
C3500 (CHF)	02/00/2020	0.02.0.			2200202	
FREQA	02/09/2015	8:32:57	<u></u> *	WILSF	BDUCAD02	
	CMD 1:2 Pri	mary Tactica	1:CDF TAC 3	Alternate Tactical: (none)	Air to Air:AIR TAC 5	Air
		r:VICTOR BIS				
STATUSX	02/09/2015			.		
Unit C3500	Status timer	expired afte	r 20 MIN			
AOS	02/09/2015	9:58:25		WILSF	BDUCAD02	
B3514A						
RTQ	02/09/2015	12:20:26		SREIBO	DLD BDUCAD03	
DOZ3540						
STATUSX	02/09/2015					
		er expired af	ter 25 MIN			
AIQ	02/09/2015	17:21:26		WILSF	BDUCAD02	
DOZ3540	A0 / 60 / 60 = =	10.00.00				
AIQ	02/09/2015	18:03:08		WILSF	BDUCAD02	
PDO2 PDO3	02/09/2015	10.10.57		WILSF	BDUČAD02	
A1Q D3502	02/09/2015	10:10:57		WILSE	BDUCAD02	
RTQ	02/09/2015	18-11-02		WILSF	BDUCAD02	
C3500	02/03/2013	20.22.02		#1135	DD OCAD 02	
STATUSX	02/09/2015	18:36:02				
		expired afte	r 25 MIN			
IQ	02/10/2015			WILSF	BDUCAD02	-
C3500						
RTQ	02/10/2015	9:11:51		WILSF	BDUCAD 02	
FCY3						
RTQ	02/10/2015	9:11:51		WILSF	BDUCAD02	
FCY6						
STATUSX	02/10/2015	9:36:53				
		expired after	25 MIN			
STATUSX	02/10/2015		Statement of Transports			
		expired after	25 MIN			
RTQ	02/10/2015	11:56:14		WILSF	BDUCAD02	
PLT4	******	14 52 11				
RTQ	02/10/2015	11:56:14		WILSF	BDUCAD02	
PLT3 STATUSX	02/10/2015	12.21.12				
	7	12:21:16 expired after	25 MTN			
STATUSX	02/10/2015		ZJ FIIN			
		expired after	25 MIN			
RTQ	02/10/2015			WILSF	BDUCAD02	
PDO4						
RTQ	02/10/2015	14:44:58		WILSF	BDUCAD02	
PD01						
RTQ	02/10/2015	14:52:02	-	WILSF	BDUCAD02	
н305						
STATUSX	02/10/2015	15:09:59				
Unit PD01 S	tatus timer e	expired after	25 MIN			
STATUSX	02/10/2015	15:10:00				
Jnit PD04 S	tatus timer e	expired after	25 MIN			
STATUSX	02/10/2015	15:17:05	-			
Tai+ #305 G	tatus timer e	wnired after	25 MTN			
OHIC HOOD S		sapried arcer	20 1111	WILKJ	BDUCAD01	



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

, and the second	<u></u>	
AIQ 02/10/2015 16:27:28	WILKJ	BDUCAD01
н305		
AIQ 02/10/2015 17:14:44	WILSF	BDUCAD02
PLT3 PLT4		
AIQ 02/10/2015 17:14:49	WILSF	BDUCAD02
PD01 PD04		
AIQ 02/10/2015 17:15:51	WILSF	BDUCAD02
FCY3 FCY6	W1201	2200202
DOS 02/11/2015 8:00:00	WILSF	BDUCAD02
	MITSE	BD0CAD02
B3520 (BAT)		
FREQA 02/11/2015 8:00:00	WILSF	
그가 있으면 그렇게 하는 것으로 한테막기에도 말시하는 그는 그 학생들이 되는 그는 그를 하는 것이 없었다. 그는 그 것이 없었다. 그는 그 것이 없었다.	1:CDF TAC 3 Alternate Tactical: (none)	Air to Air: AIR TAC 5 Air
to Ground:CDF ATG Victor:VICTOR BIS	HOP	
STATUSX 02/11/2015 8:20:03	-	-
Unit B3520 Status timer expired after	r 20 MIN	
TAO 02/11/2015 12:16:14	WILSF	BDUCAD 02
6537 //02-10-2015 F/3425 S/3112 (com	mand: TAO)	
AOS 02/12/2015 8:06:40	BRUNR	BDUCAD02
B3514B		
RTQ 02/12/2015 10:09:34	WILKJ	BDUCAD01
B3518	MITIKO	DOGADOL
0.—32—3263669		
STATUSX 02/12/2015 10:34:38	Sales indifferential	
Unit B3518 Status timer expired after		1
CLOCX 02/12/2015 12:43:41	BRUNR	BDUCAD02
E3557[=L(37.453267,-118.581767) ,ROU	ND_VALLEY_AREA }	
LOCX 02/12/2015 12:43:45	BRUNR	BDUCAD02
£3568[=L(37.453267,-118.581767) ,ROU	ND_VALLEY_AREA]	
RTQ 02/12/2015 12:44:03	BRUNR	BDUCAD02
E3558		
RTO 02/12/2015 12:44:03	BRÜNR	BDUCAD 02
E3560		
RTO 02/12/2015 12:44:03	BRUNR	BDUCAD02
E3578		DD Can Ca
AIQ 02/12/2015 12:44:51	BRUNR	POMANO
	BRONK	BDUCAD02
E3578		
AIQ 02/12/2015 12:51:40	AMOEB	US BDUCAD03
E3560		
SPCON 02/12/2015 12:52:28	AMOEB1	US BDUCAD03
E3558[2-0 STAFFED]		
STATUSX 02/12/2015 13:09:04	<u> </u>	-7
Unit E3558 Status timer expired after	r 25 MIN	
ATQ 02/12/2015 14:10:20	BRUNR	BDUCAD02
B3518		,
AIQ 02/12/2015 14:21:36	WILKJ	BDUCAD01
E3558	WILKO	BOUCADUI
CC19960 (AMARKA)		
CHNG 02/12/2015 15:56:20	BRUNR	BDUCAD02
1	07:00 Fire Status: <empty> => CONT;</empty>	20.00
CHNG 02/12/2015 16:43:10	WILKJ	BDUCAD01
Remarks Entered; ContainDate: 02/12/2	$015-07:00 \implies 02/12/2015-06:00;$	
AIQ 02/13/2015 7:39:53	BRUNR	BDUCAD02
DOZ3543		
NIQ 02/13/2015 7:39:59	BRUNR	BDUCAD02
JVY1 OVY2 OVY4		
RTQ 02/13/2015 8:51:21	BRUNR	BDUCAD02
E3568	DROIN	DD O ORD VZ
- 1	KAMA	DIMANA
RTQ 02/13/2015 8:51:21	BRUNR	BDUCAD02
E3557		



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

	0 51 04	-	_			
RTQ 02/13/2015	8:51:21			BRUNR	BDUCAD 02	
PLT1						
RTQ 02/13/2015	8:51:21			BRUNR	BDUCAD 02	
PLT2						
STUDIOS CONTRACOS SONOS ESTADOS CONTRACOS DE CONTRACTOR DE	9:16:22	1645-056-056				
Unit PLT2 Status timer	Sector Matheway and and Astronomy Astronomy Astronomy Section 2017	25 MIN				
	9:16:22	HONE SINCE IN PROCESSION IN		-		
Unit PLT1 Status timer		25 MIN				
	9:16:22	Marie I.C.		-		
Unit E3568 Status time	a table common common	r 25 MIN				
STATUSX 02/13/2015	9:16:22				-	
Unit E3557 Status time	r expired afte	r 25 MIN				
AIQ 02/13/2015	13:46:07			AMOEBI	US BDUCAD03	801 822 8
PLT1 PLT2						
AUTPRE 02/13/2015	16:24:22			BRUNR	BDUCAD02	
B3514B						
AIQ 02/13/2015	16:28:20			BRUNR	BDUCAD02	
в3516						
FREQA 02/13/2015	16:38:04			BRUNR	BDUCAD02	
Command: CDF CMD 1:2 P	rimary Tactica	1:CDF TAC 3	Alternate	Tactical: (none)	Air to Air:AIR TAC 5	Aiı
to Ground:CDF ATG Vic						
	16:38:05			BRUNR	BDUCAD02	
B3516 (BAT)						
FREQA 02/13/2015	16:39:59			BRUNR	BDUCAD02	
Command:CDF CMD 1:2 P	rimary Tactica	1:CDF TAC 3	Alternate	Tactical: (none)	Air to Air:AIR TAC 5	Aiı
o Ground: CDF ATG Vic	CAN- AND COMPANY TO SERVICE SERVICES				no the value of the contract of the state of the	079-28
	16:39:59			BRUNR	BDUCAD02	
B3514B (BAT)						
AOS 02/13/2015	16:40:03			BRUNR	BDUCAD 02	
B3514B						
STATUSX 02/13/2015	16:58:09				*	
Unit B3516 Status time	r expired afte	r 20 MIN				
	18:15:54			BRUNR	BDUCAD02	
OVY3 OVY5						
AIQ 02/13/2015	19:55:25			AMOEBI	US BDUCADO3	
E3557 E3568						
ATQ 02/13/2015	20:40:05			BRUNR	BDUCAD02	
B3520	15-17-0-10-10-10-10-10-10-10-10-10-10-10-10-1					
	20:41:46			BRUNR	BDUCAD02	
P3522					V4_	
	10:46:16			WILKJ	BDUCAD02	
B3516						
	11:11:22					
Unit B3516 Status time		r 25 MIN				
	14:27:50			WILKJ	BDUCAD02	0
B3516					2000000	
IS NO DESCRIPTION DESCRIPTION NAMED IN THE PROPERTY OF THE PRO	17:06:10			WILKJ	BDUCAD02	
B3514B				***************************************	22000202	
5	17:46:48			WILKJ	BDUCAD02	
B3514A				WIIIW	DUCADUZ	
E-1-marketana	19:40:29			WILKJ	BDUCAD02	/
\3504A (BOT)	13.70.23			WITH	BD0CAD02	
	19:40:29			WILKJ	BDUCAD02	
		1.000 000	-1			
Command: CDF CMD 1:2 P			Alternate	Tactical: (none)	Air to Air: AIR TAC 5	All
to Ground: CDF ATG Vic		HOP		*****	DAMASAA	
in a potential manual and a second se	19:40:33			WILKJ	BDUCAD 02	
D3504A						



Incident Number: 15-CABDU 001662

Incident Name: ROUND
Event Number: 15002006

	02/15/2015	15:00:22	WILSF	BDUCAD02
AIQ	02/15/2015	15:00:22	WILSF	BDUCAD 02
D3505				
CLOSE	02/15/2015	15:00:30	WILSF	BDUCAD02
ROPEN	02/15/2015	18:01:52	WILSF	BDUCAD02
SUGG	02/15/2015	18:01:59		
		+[ENG3]#1,	E3564.+[ENG3]#4, INFE41[ENG3]#5, OVY5[CRW	1]#6, USFS[OTH]#99,
D3504A[BO	02/15/2015	10.01.50		
5.00 Fig. 100	3555 [ENG3] #4	10.01.39		
SUGDEF	02/15/2015	18:01:59		
Level 1,	Path: G 1 ENG*	CDF, Path:	G 1 DOZ, Path: A 1 HEL, Path: G 1 ENG*USF	S or ENG+CDD
SUGG	02/15/2015	18:02:41		
Primary:	B3514A, E3561.	+[ENG3]#1,	E3564.+[ENG3]#4, INFE41[ENG3]#5, OVY5[CRW	1]#6, USFS[OTH]#99,
D3504A[B0	T]#99			
SUGG	02/15/2015	18:02:41		
Nearby: E	3555 [ENG3] #4			
SUGDEF	02/15/2015			
			G 1 DOZ, Path: A 1 HEL, Path: G 1 ENG*USF	S or ENG+CDD
		CDF, Path:	G 1 DOZ, Path: A 1 HEL, Path: G 1 ENG*USF WILSF	S or ENG+CDD BDUCAD02
Level 1,	Path: G 1 ENG*(02/15/2015	CDF, Path:		<u> </u>
Level 1,	Path: G 1 ENG*(02/15/2015	CDF, Path: 18:02:58		<u> </u>
Level 1, DSP USFS (OTH	Path: G 1 ENG*(02/15/2015 02/15/2015	CDF, Path: 18:02:58	WILSF	BDUCAD02 BDUCAD02
Level 1, DSP USFS (OTH FREQA ommand:C	Path: G 1 ENG*(02/15/2015 02/15/2015	CDF, Path: 18:02:58 18:02:58 imary Tacti	WILSF cal:CDF TAC 3 Alternate Tactical:(none)	BDUCAD02 BDUCAD02
Level 1, DSP USFS (OTH FREQA ommand:C	Path: G 1 ENG*(02/15/2015) 02/15/2015 DF CMD 1:2 Pr	CDF, Path: 18:02:58 18:02:58 imary Tacti or:VICTOR E	WILSF cal:CDF TAC 3 Alternate Tactical:(none)	BDUCAD02 BDUCAD02
Level 1, DSP USFS (OTH FREQA ommand:C	Path: G 1 ENG*(02/15/2015) 02/15/2015 DF CMD 1:2 Pr:	CDF, Path: 18:02:58 18:02:58 imary Tacti or:VICTOR E	WILSF cal:CDF TAC 3 Alternate Tactical:(none) BISHOP	BDUCAD02 BDUCAD02 Air to Air:AIR TAC 5 Ai;
Level 1, DSP USFS (OTH FREQA ommand:C to Ground	Path: G 1 ENG*(02/15/2015) 02/15/2015 DF CMD 1:2 Pr:	18:02:58 18:02:58 18:02:58 imary Taction:VICTOR E 18:03:00	WILSF cal:CDF TAC 3 Alternate Tactical:(none) BISHOP	BDUCAD02 BDUCAD02 Air to Air:AIR TAC 5 Ai;
Level 1, DSP USFS (OTH FREQA ommand:C to Ground AIQ USFS	Path: G 1 ENG*(02/15/2015 0) 02/15/2015 DF CMD 1:2 Pr: 02/15/2015	18:02:58 18:02:58 18:02:58 imary Taction:VICTOR E 18:03:00	WILSF Cal:CDF TAC 3 Alternate Tactical:(none) BISHOP WILSF	BDUCAD02 BDUCAD02 Air to Air: AIR TAC 5 Ai; BDUCAD02
Level 1, DSP USFS (OTH FREQA ommand: C to Ground AIQ USFS AAC CHNG	Path: G 1 ENG*(02/15/2015 02/15/2015 DF CMD 1:2 Pr: 02/15/2015 02/15/2015 02/15/2015	18:02:58 18:02:58 18:02:58 imary Taction:VICTOR E 18:03:00 18:03:00	WILSF cal:CDF TAC 3 Alternate Tactical:(none) SISHOP WILSF WILSF	BDUCAD02 BDUCAD02 Air to Air: AIR TAC 5 Ai; BDUCAD02 BDUCAD02 BDUCAD02
Level 1, DSP USFS (OTH FREQA ommand: C to Ground AIQ USFS AAC CHNG	Path: G 1 ENG*(02/15/2015 02/15/2015 DF CMD 1:2 Pr: 02/15/2015 02/15/2015 02/15/2015	18:02:58 18:02:58 18:02:58 imary Taction:VICTOR E 18:03:00 18:03:00 8:05:23 > 02/16/201	WILSF cal:CDF TAC 3 Alternate Tactical:(none) BISHOP WILSF WILSF	BDUCAD02 BDUCAD02 Air to Air: AIR TAC 5 Ai; BDUCAD02 BDUCAD02 BDUCAD02
Level 1, DSP USFS (OTH FREQA ommand:C to Ground AIQ USFS AAC CHNG ControlDa	Path: G 1 ENG*(02/15/2015 02/15/2015 DF CMD 1:2 Pr: 02/15/2015 02/15/2015 02/15/2015 02/16/2015 ate: <empty> ==:</empty>	18:02:58 18:02:58 18:02:58 imary Taction:VICTOR E 18:03:00 18:03:00 8:05:23 > 02/16/201	WILSF .cal:CDF TAC 3 Alternate Tactical:(none) BISHOP WILSF WILSF WILSF WILSF S-07:00 Fire Status: <empty> CONT => CTRL</empty>	BDUCAD02 BDUCAD02 Air to Air:AIR TAC 5 Ai; BDUCAD02 BDUCAD02 BDUCAD02

10.7 - CALFIRE CAIRS Incident Report

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	0
Basic	ажининоручучуч ⁴	dahdadakkisinikkeuuuuu	ИН ИЧ	TOTAL CONTRACTOR OF THE STREET	
Incident Type	MANAGEMENT AND THE STATE OF THE			AAAAA AAAAA AAAAAAAAAAAAAAAAAAAAAAAAAA	
	Brush, o	brush and grass mix	ture fire		
Incident Aid					
Aid Given or Rec	eived: None				
Incident Dates					
A	Alarm: 02-06-20	15 14:07:00			
A	rrival: 02-06-20	15 14:16:00			
CAD Reported Con	tained Time: 02-12-20:	15 06:00:00			
Actual Contained	Time: 02-12-20	15 06:00:00			
Contr	rolled: 02-12-20	15 06:00:00			
Last Unit Cl	eared: 02-15-20	15 15:00:00	W 19090		
Shifts & Alarms					
Shift or Pla	atoon:				
A	larms:				
Di	strict: B4				
Actions Taken					
	l: Coutain	fire (wildland)			
Resources					
	Apparatus		Perso	nnel	
` ^	ession: 100		450		
	EMS: 0		0		
ı	Other: 0		0		
	Resource	e counts do not includ	le aid received in	resources.	***************************************
Losses			7. 6	No. 4	
n	Losses			re Value	
	operty: 13476560 ontent: 2335000		1347 2335		
***************************************	Micit. 2503008	**************************************	Sa Fee Egent.	200	######################################
Casualties	Deaths		Injuri	60°	
Fire Se	ervice: 0		nyan O	wu u	
Civilian/Other Se			0		
Other Information	hhhhhuruvuraaaaa			MAAARPHYYYY	
Detector Alerted Occu	pants;				
Hazardous Ma	-				
	eased:				
Mixed Use Pro	perty:				
	y Use: Open lan				

Location Type: Intersection

Lat/Long: 37.453267 / -118.581767 Street Address: Lower Rock Creek Road

Apt./Suite/Room:

City: Bishop
State: California
ZipCode: 93514

Cross Street or Directions: Approximately 1 mile North of

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: 04-19-2015

Remarks

On February 6, 2015, at 2:07 P.M., E3561 was dispatched as part of a wildland dispatch, to a reported vegetation fire on Lower Creek Rd approximately 1 mile North of Gorge Rd. Upon arrival, I observed approximately 2-3 acres of vegetation burning with an approimately 70 MPH South to South East wind pushing the fire in a Northerly direction. I observed numerous trees down in the area of the fire origin. E3561 engaged in fire supression activity, and was unable to complete a preliminary fire investigation. Investigation was completed by P3522 TOMINAGA.

Wildland Fire

Area Type: Rural, including farms > 50 acres

CalFile Fire Cause: Undetermined

Fire Cause Subcategory 1: Fire Cause Subcategory 2:

Wildland Fire Cause: Undetermined

Area Type: Rural, including farms > 50 acres

Wildland Fire Cause: Undetermined

Human Factors Contributing To Ignition

1: None

Factors Contributing to Ignition:

1: None

Fire Suppression Factors:

1: None

Heat Source: Undetermined Mobile Property Type: Equipment Involved: Weather Infomation Weather Station ID: CA49F1 Weather Type: Clear, less than 1/10 cloud cover Wind Direction: Shifting winds Wind Speed MPH: 14 Air Temperature: 74 Relative Humidity: 5 Fuel Moisture: Fire Danger Rating: Number of Buildings Ignited: 53 Number of Buildings Threatened: Federal Responsibility Area 3575.00 Acres Burned: State Responsibility Area 3425.00 Acres Burned: Local Responsibility Area Acres Burned: Total Acres Burned: 7000.00 **Primary Crops Damaged** Property Management Property Ownership at fire Undetermined origin: Fed Agency Code: Percentage of the total acres burned for each ownership type. Ownership % of Total Acres Burned Undertimed: 0 Private - Tax Paying: 0 Private - Non tax Paying: 0 Public - City, town, village, local: Public - County or parish: 0 Public - State or province: 48 Public - Federal: 52 Public - Foreign: 0 Public - Military: 0 Public - Other: 0 NFDRS Fuel Model At Undetermined Origin: Person Responsible for Fire Person involved: Gender: Age: Activity: Right of Way Horizonal distance from ROW: Type of ROW:

Fire Behavior

Elevation: 4500

Relative Position on Slope: Valley Bottom

Aspect: None

Flame Length: 20

Rate of Spread (Chains per Hour): 4

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	1
Basic					<u> </u>
Incident Type		_			
	Building	fire			
Incident Aid					
Aid Given or Rece	eived: None				
Incident Dates					
A	larm: 02-06-20	15 14:07:00			
Ar	rival: 02-06-20	15 14:16:00			
CAD Reported Cont	tained Time:				
Actual Contained	Time:				
Contr	olled:				
Last Unit Cle	eared: 02-15-20	15 15:00:00			
Shifts & Alarms		-			
Shift or Pla	atoon:				
Al	arms:				
Di	strict:				
Actions Taken					
	1: Action ta	ken, other			
Resources					, tel.
	Apparatus		Perso	nnel	
Suppre	ssion: 0		0		
	EMS:		0		
(Other: 0		0		
	Resource	counts do not includ	le aid received in	resources.	
Losses					
	Losses			e Value	
	perty: 367123		3671		
	ontent: 50000		5000	0.	
Casualtics					
E: 0-	Deaths ervice: 0		Injuri A	es	
Civilian/Other Se			0		
	TVICE: U		U		
Other Information					
Detector Alerted Occup					
	eased:				
Mixed Use Pro	150				
D	Use: 1 or 2 far	nile dwalling			

Location Type: Street address

Lat/Long: 37.510367 / -118.633967

Street Address: 11 Wilson Road

Apt./Suite/Room:

City: Bishop
State: California
ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: 02-06-2015

Remarks

Structure fire was the result of being an exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

]: None

2; 3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: I

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): I

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

AES Failure Reason:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	2
Basic					
Incident Type					
	Building	fire			
Incident Aid					
Aid Given or Rec	eived: None				
Incident Dates					
A	Alarm: 02-06-20	15 14:07:00			
A	rrival: 02-06-20	15 14:16:00			
CAD Reported Con	tained Time:				
Actual Contained	Time:				
Contr	rolled:				
Last Unit Cl	eared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pl	atoon:				
A	larms:				
D	istrict:				
Actions Taken					
	1: Action to	iken, other			
Resources					
	Apparatus		Perso	nnel	
	ession: 0		0		
	EMS:		0		
9	Other: 0		0		
	Resource	e counts do not inclu	de aid received in	resources.	
Losses					
	Losses		55 50 50 50	e Value	
	perty: 135980		1359		
	ontent: 70000		7000	0	
Casualties	D		¥*		
Fire C	Deaths ervice: 0		Injuri 0	es	
Civilian/Other Se			0		
Other Information	CIVICC. V				
Detector Alerted Occu	nants:				
Hazardous Ma					
	eased:				
Mixed Use Pro					

Location Type: Street address

Lat/Long: 37.511333 / -118.633883

Street Address: 45 Pine Drive

Apt./Suite/Room:

City: Bishop
State: California
ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: **02-06-2015**

Remarks

House and detached garage burned due to exposure tothe Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

None
 2:

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First

Undetermined

Ignited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: I

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

AES Failure Reason:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	3
Basic	<u></u>	***************************************	**************************************	**************************************	***************************************
Incident Type		www.mm.nndadadadadadadadadadadadadadadadadadad		***************************************	
	Building	fire			
Incident Aid					
Aid Given or Rec	eived: None				
Incident Dates					
	Alarm: 02-06-20	15 14:07:00			
A	arrival: 02-06-20	15 14:16:00			
CAD Reported Cor	ntained Time:				
Actual Contained	Time:				
Cont	rolled:				
Last Unit C	leared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pl	latoon:				
Α	larms:				
D	district:		****		
Actions Taken					
	1: Action to	ken, other			
Resources					
	Apparatus		Perso	nnel	
Suppr	ession: 0		0		
	EMS:		0		
	Other: 0		0		
	Kesourc	e counts do not includ	ie aid received in	resources.	***************************************
Losses	Losses		n. C.	re Value	
D _{r:}	operty: 215109		2151		
	ontent: 50000		5000		
Casualties	Ollin, Company			*	00044
was war tres	Deaths		Injuri	es	
Fire S	ervice: 0		0		
Civilian/Other S	ervice: 0		0		
Other Information				**************************************	
Detector Alerted Occu	ipants:				
Hazardous Ma	_				
Mixed Use Pro					
	y Use: 1 or 2 fai	nily dwelling			

Location Type: Street address

Lat/Long: 37.505933 / -118.627500

Street Address: 55 Pinon Drive

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

2:

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited: Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1

stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Indetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

AES Failure Reason:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	4
3asic					
Incident Type					
	Building	fire			
Incident Aid					1881
Aid Given or Rece	ived: None				
Incident Dates					
Al	arm: 02-06-20	15 14:07:00			
Ап	rival: 02-06-20	15 14:16:00			
CAD Reported Conta	nined `ime:				
Actual Contained T	ìme:				
Contro	olled:				
Last Unit Cle	ared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pla	toon:				
Ala	ırms:				
Dis	trict:				
Actions Taken	•				
	1: Action ta	ken, other			
Resources					·····
	Apparatus		Perso	nnel	
Suppres			0		
Į	EMS:		0		
C	Other: 0		0		
	Resource	e counts do not includ	le aid received in	resources.	
Losses					
	Losses			e Value	
•	perty: 250561		2505		
	ntent: 100000		1000	00 	
Casualties					
ro: O	Deaths		lnjari	es	
Fire Ser Civilian/Other Ser			0		
	vice: 0		0		
Other Information					
Detector Alerted Occup					
Hazardous Mate Rele					
Mixed Use Prop					
	Use: 1 or 2 far	nily dwelling			
rioperty	USU. 1 UI & REI	mil aucmug			

Location Type: Street address

Lat/Long: 37.509683 / -118.633950 Street Address: 59 Valley View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House and detached garage burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

[None

None

2. 3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

Ignited:

Cause of Ignition: Other

Factors Coutributing To Ignitiou

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: I

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

AES Failure Reason:

FDID	Star	te	Date	Station	Incident No	Exposure
14555	California		02-06-2015	\mathbf{BDU}	000 1662	-
	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	мишенимишеним иррофорфурация» ««		**************************************		***************************************
Incident Type			19991941AAAAAAAA			
	1	Building fi	ire			
Incident Aid	***************************************		The second secon		TO THE	
Aid Given or I	Received: 1	Vone				
Incident Dates				***************************************		
	Alarm: ()2-06-201	5 14:07:00			
	Arrival: ()2-06-2015	5 14:16:00			
CAD Reported C	Contained Time:					
Actual Contain	ed Time:					
Ce	ontrolled:					
Last Unit	: Cleared: ()2-15-201:	5 15:00:00			
Shifts & Alarms		***************************************		· · · · · · · · · · · · · · · · · · ·		***************************************
Shift or	Platoon:					
	Alarms:					
	District:					
Actions Taken	***************************************	***************************************		PHI A THE TOTAL	***************************************	
	1: /	Action tak	en, other			
Resources		***************************************				***************************************
	A	Apparatus		Perso	nnel	
Sur	pression: (0		0		
	EMS:			0		
	Other: (0		
·······		Resource	counts do not inclue	le aid received in	resources.	
Losses						
		osses			re Value	
	Property: 4			4575		
	Content: 5	50000		5000	0	
Casualties	7	Janileo		F		
Liter	۱ Service: (Deaths D		Injuri 0	C3	
Civilian/Othe				0		
Other Information	***************************************		уургичүүрин калалалаган калалаган калалага кал	***************************************	Ahlihi	***************************************
Detector Alerted O						
Hazardous	-					
	Released:					
Mixed Use	Property:					

Location Type: Street address

Lat/Long: 37.512317 / -118.637517 Street Address: 67 Valley View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due toexposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

2.

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1
stories below grade: 0

Main Floor Size

Total square feet: 1800

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR nuable to determine

Detectors Un

Automatic Extingnishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

AES Failure Reason:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	\mathbf{BDU}	000 1662	6
3asic	<u> </u>		***************************************	***************************************	A CONTRACTOR OF THE PERSON NAMED OF THE PERSON
Incident Type	A CONTRACTOR OF THE PROPERTY O	**************************************			ALL MARKET PROPERTY OF THE PRO
	Buildir	ıg fire			
Incident Aid					***************************************
Aid Given or I	Received: None				
Incident Dates	***************************************	CONTRACTOR OF THE PROPERTY OF	***************************************	THE STATE OF THE S	**************************************
	Alarm: 02-06-2	2015 14:07:00			
	Arrival: 02-06-2	2015 14:16:00			
CAD Reported (Contained Time:				
Actual Contain	red Time:				
C	ontrolled:				
Last Uni	Cleared: 02-15-2	2015 15:00:00			
Shifts & Alarms		**************************************	NAME OF THE PROPERTY OF THE PR	NAME OF THE OWNER OWNER OWNER OWNER OWNER OWNER OWNER OWNER	
Shift o	r Platoon:				
	Alarms:				
	District:				
Actions Taken					W
	1: Action	taken, other			
Resources					
	Apparatu	s	Perso	nnel	
Suj	opression: 0		0		
	EMS:		0		
	Other: 0		0		
	Resout	rce counts do not includ	le aid received in	resources.	
Losses					
	Losses		, , , , , ,	re Value	
	Property: 469988		4699		
	Content: 50000	AIPPPPPPMW22MWW22MWW22D40000000000000000000000000000000000	5000	<u> </u>	MATRICE
Casualties	The sales		r · ·		
Eí.	Deaths e Service: 0		Injuri O	(62	
Civilian/Othe			0		

Other Information					
Detector Alerted O Hazardous					
	Materiais Released:				
Mixed Use					
IMIXCU UNC	LIOURITY.				

Location Type: Street address

Lat/Long: 37.512467 / -118.636517 Street Address: 72 Valley View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vgetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

I: None

None

Ignition

Area of fire Origin: Undetermined

2. 3:

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

Ignited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: 2000

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

AES Failure Reason:

FDID	Sta	ite	Date	Station	Incident No	Exposure
14555	California		02-06-2015	BDU	000 1662	7
3asic						
Incident Type		THE PROPERTY OF THE PROPERTY O				
	1	Building f	īre			
Incident Aid						***************************************
Aid Given or R	eceived:	None				
Incident Dates						
	Alarm: 4	02-06-201	5 14:07:00			
	Arrival:	02-06-201	5 14:16:00			
CAD Reported C						
Actual Containe	Time:					
	ea 11me: ntrolled:					
		02-15-201	5 15:00:00			
Shifts & Alarms	Cicuros.		w servery		ADADA TARA TARA TARA TARA TARA TARA TARA	
	Platoon:					
Shirt Oi	Alarms:					
	District:					
Actions Taken	***************************************	***************************************		· · · · · · · · · · · · · · · · · · ·		**************************************
I BULLY AND WELL WILL	1:.	Action tal	ken, other			
Resources						
-	1	Apparatus		Perso	nnel	
Sup	pression:	0		0		
	EMS:			0		
	Other:	0		0		
		Resource	counts do not includ	le aid received in	resources.	
Losses						
		Losses			re Value	
	Property:			2037		
	Content:	1000	MANANA	5000	0	
Casualties						
***	Service:	Deaths		Injuri 0	es	
r ne Civilian/Other				0		
	Service:			·····		
Other Information Detector Alerted Oc	egne ppy verne hom s					
Hazardous N						
	viaicitais (eleased:					
Mixed Use I						
WHACO USE I	rioperty.					

Location Type: Street address

Lat/Long: 37.512700 / -118.637467 Street Address: 75 Valley View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House sustained 10-25% exterior and interior damage due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

2:

1: None

3

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Ignited:

Type of Material First

Undetermined

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 2

stories below grade: 0

Main Floor Size

Total square feet: 2000

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 2

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 0

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	8
Basic				<u> </u>	
Incident Type					
	Building	fire			
Incident Aid					
Aid Given or Rec	eived: None				
Incident Dates					
A	Alarm: 02-06-20	15 14:07:00			
A	rrival: 02-06-20	15 14:16:00			
CAD Reported Con	tained Time:				
Actual Contained	Time:				
Contr	rolled:				
Last Unit Cl	eared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pl	atoon:				
A	larms:				
D	istrict:				
Actions Taken	· · · · · · · · · · · · · · · · · · ·				
	1: Action ta	ken, other			
Resources					
	Apparatus		Perso	nnel	
Suppre	ession: 0		0		
	EMS:		0		
	Other: 0		0		
	Resource	e counts do not includ	de aid received in	resources.	
Losses					
_	Losses			re Value	
	operty: 140000		1400		
	ontent: 50000		5000		
Casualties	D 4		6.33		
Time C	Deaths ervice: 0		Injuri O	ies	
Civilian/Other Se			0		
	ervice. o				
Other Information	monte:				
Detector Alerted Occu Hazardous Ma					
	eased:				
Mixed Use Pro					
Mixed Use Pro	DCILY.				

Lat/Long: 37.510000 / -118.635617

Street Address: 89 Wilson Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

2.

3

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1
stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Indetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	9
Basic			_		
Incident Type					
	Building	fire			
Incident Aid					
Aid Given or Re	ceived: None				
Incident Dates					
	Alarm: 02-06-20	15 14:07:00			
A	Arrival: 02-06-20	15 14:16:00			
CAD Reported Co.	ntained Time:				
Actual Contained	l Time:				
Con	trolled:				
Last Unit C	Cleared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or P	latoon:				
A	Alarms:				
Γ	District:				
Actions Taken					
	1: Action ta	ken, other			
Resources	-				
	Apparatus		Perso	nnel	
Supp	ression: 0		0		
	EMS:		0		
	Other: 0		0		
	Resource	e counts do not includ	le aid received in	resources.	
Losses					
	Losses		Prefir	e Value	
	operty: 132721		1327	21	
C	Content: 100000		1000	00	
Casualties					
_1 1	Deaths		Injuri	es	
	Service: 0		0		
Civilian/Other S	Service: 0		0		
Other Information					
Detector Alerted Occ					
Hazardous M Re	aterials eleased:				
N.C. LITT D	onerty.				
Mixed Use Pr	operty.				

Lat/Long: 37.513383 / -118.639033 Street Address: 94 Mountain View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House and detached garage burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

2:

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Ignited:

Type of Material First Undetermined

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 2 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: I

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-49%): 0

Heavy damage (50-85%): 0

Extreme damage (75-100%): 2

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	\mathbf{BDU}	000 1662	10
Basic	***************************************	166-44- <u>еким</u> ичеричероги простинения наказанская на выбальных выпубликами по выстранительного выпубликами по выпубликами по выпубликами по выстранительного выстранительного выстранительного выстранительного выпубликами по выстранительного выстранительного выстранительного выстранительного выстранительного выстранительного выстранительного выстранительного выпубликами по выстранительного выст	hkikikikikikikikikи кипили		иминины миниканы маррары нароган нароган нарога
Incident Type		MARARARA PRESIDENTAL PROPERTY OF THE PROPERTY			
	Building	fire			
Incident Aid	***************************************		A STATE OF THE STA		
Aid Given or Rece	ived: None				
Incident Dates					
A	larm: 02-06-20	15 14:07:00			
Ar	riyal: 02-06-20 .	15 14:16:00			
CAD Reported Cont	ained Cime:				
Actual Contained 1	Րime։				
Contro	olled:				
Last Unit Cle	ared: 02-15-20	15 15:00:00			
Shifts & Alarms			\$4.44 F.F.F.R.H.H.H.H.H.H.H.H.H.H.H.H.H.H.H.H.	***************************************	·
Shift or Pla	toon:				
Ala	arms:				
Dis	strict:				
Actions Taken					·
	1: Action ta	ken, other			
Resources			***************************************	***	
	Apparatus		Perso	nnel	
Suppres	ssion: 0		0		
)	EMS:		0		
(Other: 0		0		
	Resource	counts do not includ	le aid received in	resources.	
Losses					
	Losses			e Value	
	perty: 177602		1776		
***************************************	ntent: 50000	***************************************	5000	0	
Casualties					
	Deaths		lnjuri	es	
	rvice: 0		0		
Civilian/Other Set	rvice: 0		0	**************************************	
Other Information					
Detector Alerted Occup					
Hazardous Mat					
	ased:				
Mixed Use Prop		matha atres atres a			
Property	Use: 1 or 2 far	nny awemag			

Lat/Long: 37.508783 / -118.634550 Street Address: 97 Valley View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units în

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

2:

1: None

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors Undeterm

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	St	ate	Date	Station	Incident No	Exposure
14555	Calif	ornia	02-06-2015	BDU	000 1662	11
Basic					-	
Incident Type		3:-				
		Building	fire			
Incident Aid						
Aid Given or l	Received:	None				
Incident Dates						
	Alarm:	02-06-201	15 14:07:00			
	Arrival:	02-06-201	15 14:16:00			
CAD Reported (Contained Time:					
Actual Contain	ned Time:					
C	ontrolled:					
Last Unit	t Cleared:	02-15-201	15 15:00:00			
Shifts & Alarms			7.			
Shift or	r Platoon:					
	Alarms:					
	District:					
Actions Taken				***		
	l:	Action ta	ken, other			
Resources						
		Apparatus		Perso	nnel	
Sup	pression:	0		0		
	EMS:			0		
	Other:			0		
		Resource	counts do not includ	le aid received in	resources.	
Losses						
	D .	Losses		7.7.7.0	e Value	
	Property:			3373 5000		
	Content:	50000		5000		
Casualties		Deaths		f., :	<u>.</u>	
Fir	e Service:			Injuri 0	es	
Civilian/Othe				0		
Other Information			_			
Detector Alerted O						
Hazardous						
i iazai uous	Released:					
	Neicaseu.					
Mixed Use						

Lat/Long: 37.504100 / -118.631850

Street Address: 105 Sierra Wave

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

2:

None

Ignition

Area of fire Origin: Undetermined

3:

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1

stories below grade: 0

Main Floor Size

Total square feet: 2000

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): I

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	12
Basic		-			
Incident Type		-			
	Building	fire			
Incident Aid					
Aid Given or Rec	eived: None				
Incident Dates					
	Alarm: 02-06-20				
	rrival: 02-06-20	15 14:16:00			
CAD Reported Con	tained Time:				
Actual Contained	Time:				
Cont	rolled:				
Last Unit Cl	leared: 02-15-20	15 15:00:00			
Shifts & Alarms		_	,		
Shift or Pl	atoon:				
A	larms:				
D	istrict:				
Actions Taken			- 140		
	1: Action ta	iken, other			
Resources		-			1
	Apparatus		Perso	nnel	
Suppre	ession: 0		0		
	EMS:		0		
	Other: 0		0		
	Resource	e counts do not inclu	de aid received in	resources.	
Losses					
	Losses			e Value	
	operty: 30000		6985		
3000	ontent: 1000		1000	00	
Casualties			72.00		
F: C	Deaths		Injuri	es	
Civilian/Other S	ervice: 0		0		
	ervice: 0		V.		
Other Information	Secretic #2.5				
Detector Alerted Occu	-				
Hazardous Ma Rel	iterials leased:				
Mixed Use Pro					
	3 Am	mily dwelling			
Propert	y Use: 1 or 2 far	mily dwelling			

Lat/Long: 37.508300 / -118.635867 Street Address: 130 Valley View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

Exterior and interior bouse damage due to exposure to Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

2: 3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First

Undetermined

ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: I

stories below grade: 0

Main Floor Size

Total square feet: 3000

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 1

Significant damage (25- 0

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 0

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors Une

Automatic Extingnishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	13
Basic		***************************************			
Incident Type					
	Building	fire			
Incident Aid			***************************************		
Aid Given or Rece	ived: None				
Incident Dates					
A	larm: 02-06-20	I5 14:07:00			
An	rival: 02-06-20	15 14:16:00			
CAD Reported Conta	ained (ime;				
Actual Contained T	Time:				
Contro	oll e d:				
Last Unit Cle	ared: 02-15-20	15 15:00:00			
Shifts & Alarms					,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,
Shift or Pla	toon:				
Ala	arms:				
Dis	strict:				
Actions Taken	· · · · · · · · · · · · · · · · · · ·				
	1: Action to	ken, other			
Resources					
	Apparatus		Perso	nnel	
Suppres	ssion: 0		0		
Ì	EMS:		0		
C	Other: 0		0		
	Resource	e counts do not includ	le aid received in	resources.	
Losses					
	Losses			re Value	
	perty: 331956		3319		
	ntent: 50000		5000	10 	
Casualties					
State of the	Deaths		Injur	ies	
	rvice: 0		0		
Civilian/Other Ser	rvice: 0		Ů		***************************************
Other Information					
Detector Alerted Occup					
Hazardous Mate	erials ased:				
Mixed Use Prop					
roperty	Use: 1 or 2 far	mny amening			

Lat/Long: 37.508900 / -118.639650

Street Address: 140 Willow Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

2.

None

Ignition

Area of fire Origin: Undetermined

3:

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: I500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-49%): 0

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	14

Incident Type		The second secon		A CONTRACTOR OF THE CONTRACTOR	******
	Building	fire			
Incident Aid	***************************************	- Control of the Cont	WWW.WARRISHM.WARRISHM.WARRISH.e.		
Aid Given or Rec	eived: None				
Incident Dates	***************************************	300			
Å	Alarm: 02-06-20	15 14:07:00			
Α	rrival: 02-06-20	15 14:16:00			
CAD Reported Con	itained Time:				
Actual Contained	Time:				
Cont	rolled:				
Last Unit Cl	eared: 02-15-20	15 15:00:00			
Shifts & Alarms		hidabhildahil 1999 W	WWw.asseconderes	and the state of t	
Shift or Pl	atoon:				
A	larms:				
D	istrict:				
Actions Taken					V V V V V V V V V V V V V V V V V V V
	1: Action to	iken, other			
Resources					
	Apparatus		Perso	nnel	
Suppre	ession: 0		0		
	EMS:		0		
	Other: 0		0		
	Resource	e counts do not includ	le aid received in	resources.	
Losses					
Tr	Losses			re Value	
	operty: 295000 ontent: 50000		2950 5000		
	JILGIIL, JVUVV		2000	· · · · · · · · · · · · · · · · · · ·	W
Casualties	Deaths		Injuri	i.e.c	
Fire Si	ervice: 0		0	w _i z	
Civilian/Other S			0		
Other Information	***************************************	27979999999999999999999999999999999999		and and a supply of the supply	
Detector Alerted Occu	ipants:				
Hazardous Ma	-				
	eased:				
Mixed Use Pro	operty:				
	y Use: 1 or 2 fai				

Lat/Long: 37.510950 / -118.646433 Street Address: 153 Foothill Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

1: None

2: 3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building Building Status: In normal use

Building Height

stories at or above grade: 1
stories below grade: 0

Main Floor Size

Total square feet: 1800

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	\mathbf{BDU}	000 1662	15
Basic	************************************	кимина в в в в в в в в в в в в в в в в в в в	чесерич икомникасыны алына	***************************************	
Incident Type		***************************************	The state of the s		
	Building	fire			
Incident Aid	***************************************				
Aid Given or Rece	eived: None				
Incident Dates					
Α	larm: 02-06-20	15 14:07:00			
At	rival: 02-06-20	15 14:16:00			
CAD Reported Cont	ained Time:				
Actual Contained	Time:				
Contr	olled:				
Last Unit Clo	eared: 02-15-20	15 15:00:00	***************************************	***************************************	
Shifts & Alarms					
Shift or Pla					
	arms:				
Dì	strict:	***************************************			
Actions Taken					
	1: Action to	iken, other			
Resources					
	Apparatus		Perso	nnel	
	ssion: 0		•		
	EMS:		0		
*	Other: 0		()		
	Resource	e counts do not includ	e ald received in	resources.	***************************************
Losses	1 40000		Des Co	re Value	
Deno	Losses perty: 249566		2495	re Value	
	ntent: 50000		5000		
Casualties	TIPOTEC DAGA	44444		V	***************************************
Vasuames	Deaths		(njur)	ies	
Fire Se	ervice: 0		0		
Civilian/Other Se			0		
Other Information		женномження женномження с	THE STATE OF THE S	SERVICE STREET, SERVICE STREET	
Detector Alerted Occur	pants:				
Hazardous Mat					
	eased:				
Mixed Use Pro	perty:				
2.10.110					

Lat/Long: 37.506183 / -118.637983

Street Address: 159 Willow Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

2:

None

Ignition

Area of fire Origin: Undetermined

3:

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	16
Basic	кишинабаааааааааааааааааааааааааааааааааа	римического о о о о о о о о о о о о о о о о о о	MENINGA	BOUNG.coccoccocc <u>cccccc</u> pppppppppppppppppppppp	
Incident Type		and a second	1111		
	Building	fire			
Incident Aid					
Aid Given or R	eceived: None				
Incident Dates				***************************************	
	Alarm: 02-06-20	15 14:07:00			
	Arrival: 02-06-20	15 14:16:00			
CAD Reported Co	ontained Time:				
Actual Containe	d Time:				
Cor	ntrolled:				
Last Unit	Cleared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or 1	Platoon:				
	Alarms:				
	District:				
Actions Taken	>1000000000000000000000000000000000000				
	l: Action ta	ken, other			
Resources				The second secon	***************************************
	Apparatus		Perso	nnel	
Supp	ression: 0		0		
	EMS:		0		
	Other: 0		0		
	Resource	counts do not includ	le aid received in	resources.	······································
Losses					
	Losses			e Value	
	roperty: 122585		1225		
	Content: 50000		5000		
Casualties	Y9. 11				
Dina.	Deaths Service: 0		Injuri 0	es	
Civilian/Other			0		
	XIVE Y ENGL. V	1444141111 SERVICE SER	4.5	AAAAAAAA TITTI TIT	
Other Information	Prima inter				
Detector Alerted Och Hazardous M	-				
R	eleased:				
Mixed Use P	=				
20%	rty Use: 1 or 2 far	mile devalling			

Lat/Long: 37.512767 / -118.635700

Street Address: 171 Pine Drive

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

2:

None

Ignition

Area of fire Origin: Undetermined

3:

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building Building Status: In normal use

Building Height

stories at or above grade: 1
stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet: WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): J

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	17
Basic			Минисиничний менений применений (1886) (188		иминести перестипнати предотрудования предотру
Incident Type		***************************************	PPPPPIIINIAAAAAAAAAAAAAAAAAAAAAAAAAAAAA		
	Buildin	g fire			
Incident Aid					
Aid Given or Rec	eived: None				
Incident Dates					
į,	Alarm: 02-06-20	015 14:07:00			
A	rrival: 02-06-20	015 14:16:00			
CAD Reported Con	tained Time:				
Actual Contained	Time:				
Cont	rol led :				
Last Unit C	leared: 02-15-20	015 15:00:00			
Shifts & Alarms	000000000000000000000000000000000000000				
Shift or Pl	atoon:				
A	larms:				
D	istrict:				
Actions Taken					
	1: Action (aken, other			
Resources					
	Apparatus		Perso	nnel	
Suppr	ession: 0		0		
	EMS:		0		
	Other: 0		0		
	Resour	ce counts do not inclu	de aid received in	resources.	
Losses					
m	Losses			re Value	
	operty: 136474		1364		
	ontent: 50000		5000	V	
Casualties	Phys. dk.		1	·	
Dina C	Deaths ervice: 0		Injuri O	es	
Civilian/Other S			0		
Other Information	CAVICC. V		***************************************		
	tank de en fret t				
Detector Alerted Occu Hazardous Ma					
Re	eased:				
Mixed Use Pro					
Propert	y Use: 1 or 2 fr	mily dwelling			

Lat/Long: 37.511017 / -118.646950

Street Address: 175 Foothill Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

(D: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House and outbuilding burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

2.

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 2 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 2

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	18
			***************************************		· · · · · · · · · · · · · · · · · · ·
Incident Type					
	Building	fire			
Incident Aid			***************************************		***************************************
Aid Given or Rec	eived: None				
Incident Dates			**************************************		***************************************
	Marm: 02-06-20	15 14:07:00			
A	rrival: 02-06-20	15 14:16:00			
CAD Reported Con	tained Time:				
Actual Contained	Time:				
Contr	rolled:				
Last Unit Cl	eared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or PI	atoon:				
A	larms:				
D	istrict:				
Actions Taken					
	1: Action ta	ken, other			
Resources		anteriorista de la companie de la c			***************************************
	Apparatus		Perso	mel	
Suppre	ession: 0		0		
	EMS:		0		
	Other: 0		0		
	Resource	e counts do not includ	le aid received in	resources.	
Losses					
D.	Losses			re Value	
	pperty: 40000		1602 5009		
***************************************	ontent: 10000	en kriterin	2000	U	
Casualties	Deaths		lnjuri	inc	
Fire C	ervice: 0		0	E.S.	
Civilian/Other S			0		
Other Information	NE FINNE			***************************************	
Detector Alerted Occu	mants [,]				
Hazardous Ma					
	eased:				
Mixed Use Pro					
	y Use: 1 or 2 fai				

Lat/Long: 37.510800 / -118.647367

Street Address: 193 Footbill Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

TD: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House had exterior and interior damage due toexposure to the Round vegetation fire. Second single family structure on the property was completely destroyed due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1. None

None

Ignition

Area of fire Origin: Undetermined

2: 3:

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Ignited:

Type of Material First Undetermined

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 2

stories below grade: 0

Main Floor Size

Total square feet: 1800

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 1

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	19
Basic					
Incident Type					
	Building	g fire			
Incident Aid					
Aid Given or R	eceived: None				
Incident Dates					
	Alarm: 02-06-20	015 14:07:00			
	Arrival: 02-06-20	015 14:16:00			
CAD Reported Co	ontained Time:				
Actual Containe					
	ntrolled:				
	Cleared: 02-15-20	015 15:00:00			
Shifts & Alarms	The second secon				
Shift or	Platoon:				
	Alarms:				
	District:				
Actions Taken					
	1: Action t	aken, other			
Resources	- 1000.00 800.000.000.000.000.000.000.000.0				
	Apparatus		Perso	nnel	
Supp	pression: 0		0		
	EMS:		0		
	Other: 0		0		
	Resource	ce counts do not includ	le aid received in	resources.	
Losses				1	
	Losses		Prefir	e Value	
	Property: 360000		3600	00	
	Content: 50000		5000	0	
Casualties					
	Deaths		Injuri	es	
	Service: 0		0		
Civilian/Other	Service: 0		0		
Other Information					
Detector Alerted Oc					
Hazardous N R	Naterials eleased:				
Mixed Use P	roperty:				

Lat/Long: 37.506183 / -118.630483 Street Address: 255 Rimrock Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Meterial

Material Storage Use

1: None

2:

None

Ignition

Area of fire Origin: Undetermined

3:

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: I # stories below grade: 0

Main Floor Size

Total square feet: 2000

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: I

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-49%): 0

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	20
Basic					
Incident Type					
	Building	fire			
Incident Aid					
Aid Given or Rece	eived: None				
Incident Dates					
A	larm: 02-06-20	I5 14:07:00			
Aı	rival: 02-06-20	15 14:16:00			
CAD Reported Cont	ained Fime:				
Actual Contained	Time:				
Contr	olled:				
Last Unit Cle	eared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pla	itoon:				
Al	arms:				
Di	strict:				
Actions Taken					
	1: Action ta	ken, other			
Resources					
	Apparatus		Perso	nnel	
Suppre	ssion: 0		0		
	EMS:		0		
(Other: 0		0		
	Resource	e counts do not includ	le aid received in	resources.	
Losses					
	Losses			re Value	
	perty: 310735		3107		
	ntent: 50000		5000	0	
Casualties					
r: c	Deaths		Jnjuri 0	es	
Civilian/Other Se	rvice: 0		0		
	rvice: v		0		
Other Information					
Detector Alerted Occup					
Hazardous Mat Rele	erials eased:				
Mixed Use Pro					
	perty. [,] Use: 1 or 2 fa 1	mily dwalling			
rioperty	USU. 1 UI & 1271	my whening			

Lat/Long: 37.503567 / -118.625050

Street Address: 280 Pinon Drive

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

Ou-Site Materials or Products

On-Site Material

Material Storage Use

None

1: None

2: 3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building Building Status: In normal use

Building Height

stories at or above grade: 2 # stories below grade: 0

Main Floor Size

Total square feet: 1800

OR

Length in feet: WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-49%): 0

Heavy damage (50-85%): 0

Extreme damage (75-100%): 2

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	21
asic					
Incident Type					
	Building	fire			
Incident Aid					
Aid Given or Reco	eived: None				
Incident Dates				-	
A	larm: 02-06-20	I5 14:07:00			
At	rrival: 02-06-20	15 14:16:00			
CAD Reported Cont	tained Time:				
Actual Contained	Time:				
Contr	olled:				
Last Unit Clo	eared: 02-15-20	15 15:00:00			
Shifts & Alarms	-				
Shift or Pla	atoon:				
Al	larms:				
Di	strict:				
Actions Taken					
	1: Action ta	ken, other			
Resources		÷			
	Apparatus		Perso	nnel	
	ession: 0		0		
	EMS:		0		
•	Other: 0		0		
	Resource	counts do not includ	le aid received in	resources.	
Losses				122.2	
n	Losses			re Value	
	operty: 330615 ontent: 50000		3306 5000		
	oment: 50000		3000		
Casualties	Deaths		Injuri	iec.	
Fire Se	ervice: 0		0		
Civilian/Other Se			0		
Other Information	en e		82,00		
Detector Alerted Occu	pants:				
Hazardous Mai					
	eased:				
Mixed Use Pro	perty:				
	y Use: 1 or 2 fai				

Lat/Long: 37.506067 / -118.629733 Street Address: 301 Rimrock Drive

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

1: None 2:

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building Building Status: In normal use

Building Height

stories at or above grade: 1
stories below grade: 0

Main Floor Size

Total square feet: 1800

OR

Length in feet: WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

ndetermined

Automatic Extinguishmeut System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID		ate	Date	Station	Incident No	Exposure
14555	Calif	ornia	02-06-2015	\mathbf{BDU}	000 1662	22
Basic						
Incident Type						
		Building fi	ire			
Incident Aid						
Aid Given or R	leceived:	None				
Incident Dates						
	Alarm:	02-06-2015	5 14:07:00			
	Arrival:	02-06-2015	5 14:16:00			
CAD Reported C	ontained Time:					
Actual Contain	ed Time:					
Co	ntrolled:					
Last Unit	Cleared:	02-15-2015	5 15:00:00			
Shifts & Alarms						
Shift or	Platoon:					
	Alarms:					
	District:					
Actions Taken						-vv4
	1:	Action tak	en, other			
Resources						
		Apparatus		Perso	nnel	
Sup	pression:	0		0		
	EMS:			0		
	Other:			0		
		Resource	counts do not inclu	de aid received in	resources.	
Losses						
	n .	Losses			re Value	
	Property:			3728		
B AGEN	Content:	20000		5000	0	
Casualties				a. 1. 18	r.	
E:	Service:	Deaths		Injuri 0	ies	
Civilian/Other				0		
(N	6 YA 7481 USS 24	IV.		·		
Other Information						
Detector Alerted Od Hazardous I	15					
	Materiais Released:					
F	CCICANCII					
H Mixed Use I						

Lat/Long: 37.513433 / -118.642600 Street Address: 320 Mountain View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House got minor exterior damage due to exposure to the Round vegetation fire. The detached garage was destroyed due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

1: None

2: 3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Uudetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Ignited:

Undetermined

Cause of Ignition: Other

Factors Contributing To Ignition

I: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 2

stories below grade: 0

Main Floor Size

Total square feet: 500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 1

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	23
Basic					
Incident Type					
	Building	fire			
Iucident Aid		· · · · · · · · · · · · · · · · · · ·			
Aid Given or Rece	eived: None				
Incident Dates					
A	larm: 02-06-20	15 14:07:00			
Aı	rrival: 02-06-20	15 14:16:00			
CAD Reported Cont	tained Time:				
Actual Contained	Time:				
Contr	olled:				
Last Unit Cle	eared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pla	atoon:				
Al	arms:				
Di	strict:				m
Actions Taken		•			
	1: Action ta	ken, other			
Resources			,,		
	Apparatus		Perso	nnel	
	ession: 0		0		
	EMS:		0		
(Other: 0		0		
	Resource	counts do not inclu	de aid received in	resources.	_
Losses			727 720	802 ¥	
'n	Losses			re Value	
	perty: 452449 entent: 50000		4524 5000		
1579-15	mient, 30000		5000		
Casualties	Deaths		Injuri	ion.	
Fire Se	ervice: 0		0	ics .	
Civilian/Other Se			0		
Other Information			172		
Detector Alerted Occur	nants:				
Hazardous Mat					
	eased:				
Mixed Use Pro	nerty:				
Wilked Cac 110	Porty.				

Lat/Long: 37.505950 / -118.636617 Street Address: 346 Valley View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House and detached garage burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

2: 3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: 2000

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-49%): 0

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

: 02-06-20	02-06-2015 fire 15 14:07:00 15 14:16:00 15 15:00:00	BDU	000 1662	24
: None : 02-06-20 : 02-06-20 : : : : : 02-15-20	15 14:07:00 15 14:16:00 15 15:00:00			
: None : 02-06-20 : 02-06-20 : : : : : 02-15-20	15 14:07:00 15 14:16:00 15 15:00:00			
: None : 02-06-20 : 02-06-20 : : : : : 02-15-20	15 14:07:00 15 14:16:00 15 15:00:00			
: 02-06-20 : 02-06-20 : : : : 02-15-20	15 14:16:00 15 15:00:00			
: 02-06-20 : 02-06-20 : : : : 02-15-20	15 14:16:00 15 15:00:00			
: 02-06-20	15 14:16:00 15 15:00:00			
: 02-06-20	15 14:16:00 15 15:00:00			
d : : : : : : : : : : : : : : : : : : :	15 15:00:00			
: 02-15-20				
: 02-15-20 : :				
: 02-15-20				
:				
: -	aken, other			
: -	aken, other			
•	aken, other			
	aken, other			
: Action ta	aken, other			
: Action ta	aken, other			
Apparatus		Perso	nnel	
: 0		0		
h:		0		
0		0		
Resource	e counts do not includ	de aid received in	resources.	
Losses			re Value	
: 500000		5000		
:: 100000	<u> </u>	1000	00	,,,,,
Deaths		Jnjuri A	es	
;, v 		· · · · · · · · · · · · · · · · · · ·		
-				
5	e: 0 e: 0 ss: ss: ds:	e: 0 s: ls d:	e: 0	e: 0

Lat/Long: 37.504950 / -118.628867 Street Address: 370 Rimrock Drive

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House, detached garage and pump house burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

2:

1: None

3:

1gnition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined Ignited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment lavolved in

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 2

stories below grade: 0

Main Floor Size

Total square feet: 2000

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	25
Basic					*
Incident Type	da Ar da				
	Building	fire			
Incident Aid					
Aid Given or Rece	eived: None				
Incident Dates					
A	larm: 02-06-20	15 14:07:00			
Aı	rival: 02-06-20	15 14:16:00			
CAD Reported Conf	ained Time:				
Actual Contained	Time:				
Contr	olled:				
Last Unit Cle	eared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pla	itoon:				
Al	arms:				
Di	strict:				
Actions Taken					
	1: Action ta	iken, other			
Resources					
	Apparatus		Perso	onnel	
	ssion: 0		0		
	EMS:		0		
(Other: 0				
	Resource	e counts do not includ	le aid received in	resources.	
Losses	· · · · · · · · · · · · · · · · · · ·		20. 20	99.9	
n -	Losses			re Value	
	perty: 218342 intent: 50000		2183 5000		
47,99000	intent. 30000		3000		
Casualties	Deaths		Injur	ies	
Fire Se	ervice: 0		0	***	
Civilian/Other Se			0		
Other Information					
Detector Alerted Occu	pants:				
Hazardous Mar	7.				
	eased:				
Mixed Use Pro	perty:				
	Use: 1 or 2 far				

Lat/Long: 37.504067 / -118.628400 Street Address: 460 Rimrock Drive

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bisbop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure tothe Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

2:

1: None

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-49%): 0

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	26
Incident Type					
	Building	fire			
Incident Aid					
Aid Given or Rece	ived: None				
Incident Dates					
A	larm: 02-06-20	I5 14:07:00			
Ar	rival: 02-06-20	15 14:16:00			
CAD Reported Cont	ained Гіте:				
Actual Contained	Гіте:				
Contro					
Last Unit Cle	eared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pla	toon:				
Al	arms:				
Dis	strict:				
Actions Taken					
	l: Action ta	ken, other			
Resources					
	Apparatus		Perso	nnel	
Suppre	ssion: 0		0		
	EMS:		0		
(Other: 0		0		
	Resource	e counts do not includ	le aid received in	resources.	
Losses					
	Losses		Prefir	re Value	
	perty: 226872		2268		
Со	ntent: 100000		1000	00	
Casualties					
unte	Deaths		Injuri	es	
	rvice: 0		0		
Civilian/Other Se	rvice: 0		0		
Other Information					
Detector Alerted Occup					
Hazardous Mat	erials ased:				
Mixed Use Prop		milu dwellin-			
Property	Use: 1 or 2 far	nny uwening			

Lat/Long: 37.512417 / -118.645417 Street Address: 461 Mountain View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

Detached garage and 3 vehicles burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings 0

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

1: None 2:

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved Ia

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: I
stories below grade: 0

Main Floor Size

Total square feet: 500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Jadetermiaed

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	St	ate	Date	Station	Incident No	Exposure
14555	Calif	fornia	02-06-2015	BDU	000 1662	27
Basic						
Incident Type			14444			
		Building	fire			
Incident Aid						
Aid Given or R	eceived:	None				
Incident Dates	***************************************				400004000000000000000000000000000000000	
	Alarm:	02-06-201	5 14:07:00			
	Arrival:	02-06-201	5 14:16:00			
CAD Reported Co	ontained Time:					
Actual Containe	ed Time:					
Co	ntrolled:					
Last Unit	Cleared:	02-15-201	5 15:00:00			
Shifts & Alarms						
Shift or	Platoon:					
	Alarms:					
	District:					
Actions Taken						остинения в подражения в при в п
	1:	Action ta	ken, other			
Resources						14.44
		Apparatus		Perso	nne)	
Supp	oression:	0		0		
	EMS:			0		
	Other:			0		
***************************************		Resource	counts do not includ	le aid received in	resources.	
Losses						
_	_	Losses			e Value	
	roperty:			2741		
	Content:	50000		5000	0	
Casualties		*				
r:i.a	Service:	Deaths		Injuri O	ēs —	
Civilian/Other				0		
	JULYIUU.	***************************************		U	**************************************	
Other Information	arenen en her:					
Detector Alerted Oc Hazardous N						
#1272F(10US N						
	eleasen.					
	eleased:					

Lat/Long: 37.504050 / -118.637050

Street Address: 507 Willow Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC Assignment: Bishop Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

2.

1: None

3

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1
stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet: WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%): '

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	28
Basic					
Incident Type					
	Building	fire			
Incident Aid					
Aid Given or Rece	ived: None				
Incident Dates					***
Al	arm: 02-06-201	15 14:07:00			
Arr	rival: 02-06-201	15 14:16:00			
CAD Reported Conta	ined ime:				
Actual Contained T	ime:				
Contro	olled:				
Last Unit Cle	ared: 02-15-20	15 15:00:00			
Shifts & Alarms		<u> </u>			
Shift or Plan	toon:				
Ala	ırms:				
Dis	trict:				
Actions Taken		-			y
	1: Action ta	ken, other			
Resources					
	Apparatus		Perso	nnel	
Suppres	sion: 0		0		
	EMS:		0		
C	Other: 0		0		
	Resource	e counts do not includ	de aid received in	resources.	
Losses					
	Losses		500,000	re Value	
31 VIII	erty: 223596		2235		
	ntent: 50000		5000	0	
Casualties	20		gs = 10		
Di O.	Deaths		injuri 0	es	
Fire Ser Civilian/Other Ser			0		
	Vice: 0		U		
Other Information					
Detector Alerted Occup					
Hazardous Mate Rele					
Mixed Use Prop					
	Use: 1 or 2 far	nily dwelling			
Floperty	OSC. I OI Z lai	nay awening			

Lat/Long: 37.503467 / -118.638350

Street Address: 519 Willow Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House and 2 barns burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

2:

None

Ignition

Area of fire Origin: Undetermined

3:

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First

Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet: WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-49%): 0

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	29
Basic		*			
Incident Type					-
	Building	fire			
Incident Aid					
Aid Given or Rece	ived: None				
Incident Dates					
Al	larm: 02-06-20	15 14:07:00			
An	rival: 02-06-20	15 14:16:00			
CAD Reported Conta	ined ime:				
Actual Contained T	ime:				
Contro	olled:				
Last Unit Cle	ared: 02-15-20	15 15:00:00			
Shifts & Alarms					y
Shift or Plan	toon:				
Ala	ırms:				
Dis	trict:				
Actions Taken					
	1: Action ta	ken, other			
Resources		,			
	Apparatus		Perso	nnel	
Suppres			0.		
	EMS:		0		
C	Other: 0		0		
	Resource	e counts do not includ	de aid received in	resources.	,
Losses					
	Losses			e Value	
₹	perty: 271190		2711		
	ntent: 50000		5000	0	
Casualties			(4)		
Fire Ser	Deaths		Injuri 0	es	
Civilian/Other Ser			0		
	vice. 0	<u> </u>	<u> </u>		
Other Information	onto:				
Detector Alerted Occup Hazardous Mate					
Hazardous Mate					
Mixed Use Prop					
	Use: 1 or 2 far	nily dwelling			
Topolty					

Lat/Long: 37.511367 / -118.649517 Street Address: 739 Mountain View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure tothe Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

Ignition

Area of fire Origin: Undetermined

2: 3:

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

Ignited:

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1

stories below grade: 0

Main Floor Size

Total square feet: 1800

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-0

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Indetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	30
Basic	-				· · · · · · · · · · · · · · · · · · ·
Incident Type					
	Building	fire			
Incident Aid				 	
Aid Given or Rec	eived: None				
Incident Dates					
A	Marm: 02-06-20	15 14:07:00			
A	rrival: 02-06-20	15 14:16:00			
CAD Reported Con	tained Time:				
Actual Contained	Time:				
Contr	rolled:				
Last Unit Cl	eared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pl	atoon:				
A	larms:				
D	istrict:				
Actions Taken				,	
	1: Action to	ken, other			
Resources					0
	Apparatus		Perso	nnel	
Suppre	ession: 0		0		
	EMS:		0		
	Other: 0		0		
	Resource	e counts do not includ	le aid received in	resources.	
Losses					
	Losses			re Value	
	perty: 110000		4354		
	ontent: 60000		1000	00	
Casualties					
<i>T</i> . 0	Deaths		Injuri	es	
	ervice: 0		0		
Civilian/Other Se	ervice: 0		0		
Other Information					
Detector Alerted Occu	- A P. D.				
	eased:				
Mixed Use Pro					
D	y Use: 1 or 2 fai	O			

Lat/Long: 37.512583 / -118.648233 Street Address: 788 Mountain View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House sustained structural exterior and interior damage dueto exposure to the Round vegetation fire. The detached garage and a vehicle were destroyed due to exposure tot he Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

1: None

2:

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined Type of Material First Undetermined

(gnited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 2

stories below grade: 0

Main Floor Size

Total square feet: 3000

OR

Length in feet;

WIDTH in feet:

Fire Origin

Story of fire origin: I

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 1

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	31
 Basic	***************************************				
Incident Type				**************************************	
	Building	fire			
Incident Aid					
Aid Given or Rece	eived: None				
Incident Dates					
Α	larm: 02-06-20	15 14:07:00			
Ar	rival: 02-06-20	15 14:16:00			
CAD Reported Cont	ained Гime:				
Actual Contained	Γime:				
Contro	olled:				
Last Unit Cle	eared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pla	itoon:				
Al	arms:				
Di	strict:				
Actions Taken					
	1: Action to	ken, other			
Resources					
_	Apparatus		Perso	mnel	
	ssion: 0		0		
	EMS:		0		
(Other: 0	4. 145 1 .	0		
_	Resource	e counts do not inclu	le aid received in	resources.	
Losses	Y		p., 6:	tr-b	
Dro	Losses perty: 125567		1255	e Value	
	ntent: 50000		5000		
Casualties	MILOCIE. 20000			·····	
Casuamies	Deaths		Injuri	ies	
Fire Se	rvice: 0		0		
Civilian/Other Se			0		
Other Information					
Detector Alerted Occup	pants:				
Hazardous Mat	='				
	eased:				
Mixed Use Pro	perty:				
	Use: 1 or 2 far	** > ***			

Lat/Long: 37.513000 / -118.648200 Street Address: 818 Mountain View Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

2: 3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 2 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet: WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatie Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	32
Basic	***************************************				иносминикоминикоминикоминикоминикоминикоминикоминикоминикоминикоминикоминикоминикоминикоминикоминикоминикомини
Incident Type		4466-440000			
	Building	fire			
Incident Aid					
Aid Given or Rece	eived: None				
Incident Dates					
A	darm: 02-06-20	15 14:07:00			
Aı	rrival: 02-06-20 :	15 14:16:00			
CAD Reported Cont	ained Time:				
Actual Contained	Time:				
Contr	olled:				
Last Unit Clo	eared: 02-15-20	15 15:00:00			
Shifts & Alarms				SARAMAAAAAAAAAAAAAAAAAAAAAAAAAAAAAAAAAA	
Shift or Pla	atoon:				
Al	arms:				
Di	strict:				
Actions Taken					-
	1: Action ta	ken, other			
Resources					
	Apparatus		Perso	mnel	
· -	ssion: 0		0		
	EMS:		0		
•	Other: 0		0		
	Resource	counts do not includ	le aid received in	resources.	
Losses			<u></u>		
**	Losses			re Value	
	perty: 295419		2954		
	ontent: 50000		5000	······································	***************************************
Casualties	Deaths		ئد.دئيرا	iae	
Tira Ca	Dealns ervice: 0		Injuri O	ius	
Civilian/Other Se			0		
Other Information					***************************************
Detector Alerted Occup	nants:				
Hazardous Mat					
Mixed Use Pro					
	/ Use: 1 or 2 far	nily dwelling			
rioporty	: 150°10'94') 24. 36°3 36°3 36°3 36°3 36°3 36°3 36°3 36°	KERNAT SE TO WIGHTER	•		

Lat/Long: 37.511317 / -118.634467 Street Address: 826 Swall Meadows Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

1: None

2: 3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1
stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	33
3asic			akkikasaakkikasakkikasakkik <u>keennoneennoneennonee</u>	annakadadadadadadadadadadadadadadadadada	······································
Incident Type					
	Baild	ing fire			
Incident Aid			****		V
Aid Given or Re	eceived: None				
Incident Dates					
	Alarm: 02-06-	-2015 14:07:00			
	Arrival: 02-06	-2015 14:16:00			
CAD Reported Co	ontained Time:				
Actual Containe	d Time:				
	ntrolled:				
Last Unit (Cleared: 02-15-	-2015 15:00:00			
Shifts & Alarms		***************************************			
Shift or l	Platoon:				
,	Alarms:				
,	District:				
Actions Taken			V		VIII. 17000000000000
	1: Action	n taken, other			
Resources			***************************************	***************************************	
	Apparat	us	Perso	nnel	
Supp	oression: 0		0		
	EMS:		0		
	Other: 0		0		
	Resou	irce counts do not inclu	de aid received in	resources.	***************************************
Losses					
	Losses			e Value	
	roperty: 35922		3592		
***************************************	Content: 10000		1000	0	
Casualties	200		* .	٠.	
1775	Deaths Service: 0		injuri a	es	
Civilian/Other			0		
····	DVIYIVE. V	***************************************	¥		***************************************
Other Information	marana mahar				
Detector Alerted Occ Hazardous M					
	raterials eleased:				
r K					
Mixed Use P					

Lat/Long: 37.511317 / -118.634467 Street Address: 926 Sky Meadows Road

Apt./Suite/Room:

City: Bishop
State: California
ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: **02-06-2015**

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: **02-06-2015**

Remarks

House burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 1

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

2:

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 2

stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 2

Material Coutributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	\mathbf{BDU}	000 1662	34
Basic					
Incident Type					
	Building	fire			
Incident Aid					
Aid Given or Rece	ived: None				
Incident Dates					
A	larm: 02-06-20	15 14:07:00			
Ar	rival: 02-06-20	15 14:16:00			
CAD Reported Conta	ained Cime:				
Actual Contained	Cime:				
Contro	olled:				
Last Unit Cle	ared: 02-15-20	15 15:00:00			
Shifts & Alarms					
Shift or Pla	toon:				
Ala	arms:				
Dis	strict:				
Actions Taken					
	1: Action to	ken, other			
Resources					
	Apparatus		Perso	nnel	
	ssion: 0		0		
	EMS:		0		
(Other: 0		0		
28	Resource	e counts do not inclu	le aid received in	resources.	
Losses	7		- Table 1984	- V-1	
n	Losses perty: 161508		Prefir 1615	e Value	
4 100 11 11 11	ntent: 50000		5000		
	ment. 30000				
Casualties	Deaths		Injuri	es	
Fire Se	rvice: 0		0		
Civilian/Other Se			0		
Other Information					
Detector Alerted Occup	ants:				
Hazardous Mat					
	ased:				
Mixed Use Prop	perty:				
	Use: 1 or 2 far				

Lat/Long: 37.511233 / -118.636567 Street Address: 931 Swall Meadows Road

Apt./Suite/Room:

City: Bishop
State: California
ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: **02-06-2015**

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burneddue to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

1: None

2:

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined

Ignited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25- 0

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	\mathbf{BDU}	000 1662	35
		ментини и при при при при при при при при при	и формун и менения мен		
Incident Type		MMAX.		WWW.	
	Building	fire			
Incident Aid					
Aid Given or Re	ceived: None				777
Incident Dates					
	Alarm: 02-06-20,	15 14:07:00			
P	Arrival: 02-06-20	15 14:16:00			
CAD Reported Cor	ntained Time:				
Actual Contained	Time:				
Con	trolled:				
Last Unit C	leared: 02-15-20	15 15:00:00			
Sbifts & Alarms					
Shift or P	latoon:				
A	Marms:				
Ľ.	District:	W			***************************************
Actions Taken					
	1: Action ta	iken, other			
Resources					
_	Apparatus		Perso	nnel	
Suppr	ession: 0		0		
	EMS:		()		
	Other: 0	, to the second	0		
	Kesource	e counts do not includ	le aid received in	resources.	***************************************
Losses	¥		,	. Y1t.	
D	Losses		Prefir 2 600	e Value	
	operty: 260000 ontent: 100000		2000 1000		
	Olicelle, rozoon	***************************************	1000	<u></u>	
Casualties	Deaths		Injurí	es	
Fire S	Service: 0		0		
Civilian/Other S			0		
Other Information			***************************************		***************************************
Detector Alerted Occ	upants:				
Hazardous Ma	•				
	leased:				
Mixed Use Pr	operty:				

Lat/Long: 37.512117 / -118.638750 Street Address: 1046 Swall Meadows Road

Apt./Suite/Room:

City: Bishop
State: California
ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: **02-06-2015**

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: **02-06-2015**

Remarks

House, detached garage and outbnilding burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

None

2:

1: None

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Ignited:

Undetermined

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: I

stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	BDU	000 1662	36
Basic					
Incident Type					
	Building	fire			
Incident Aid					
Aid Given or Rece	eived: None				
Incident Dates					
A	Jarm: 02-06-20	15 14:07:00			
Ar	rival: 02-06-20	15 14:16:00			
CAD Reported Cont	ained Гіme:				
Actual Contained	Γime:				
Contro	olled:				
Last Unit Cle	eared: 02-15-20	15 15:00:00			
Shifts & Alarms			*		
Shift or Pla	itoon:				
Al	arms:				
Dis	strict:				
Actions Taken			2-3-3-320000000000000000000000000000000	New Maria Caracteristics	
	1: Action ta	ken, other			
Resources					
	Apparatus		Perso	nnel	
Suppre	ssion: 0		0		
	EMS:		0		
(Other: 0		0		
	Resource	e counts do not includ	le aid received in	resources.	
Losses					
	Losses			re Value	
	perty: 116761		1367		
	ntent: 50000		6000		
Casualties	D 1		v 93	P	
Pira Ca	Deaths rvice: 0		Injuri 0	ies	
Civilian/Other Se			0		
	tvice. v		•		
Other Information Detector Alerted Occup	nants:				
Hazardous Mat	53				
	eased:				
Mixed Use Prop					
	Use: 1 or 2 far	nily dwelling			
T					

Lat/Long: 37.511900 / -118.642717 Street Address: 1274 Swall Meadows Road

Apt./Suite/Room:

City: Bishop State: California ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: Bishop FFS Date Signed Off: 02-06-2015

Remarks

House burned due to exposure to the Round vegetation fire. Single wide mobile home sustained damage due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in 2

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Muterials or Products

On-Site Material

Material Storage Use

1: None

2: 3: None

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First Undetermined ignited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building

Building Status: In normal use

Building Height

stories at or above grade: 1

stories below grade: 0

Main Floor Size

Total square feet: 1000

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 1

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads:

FDID	State	Date	Station	Incident No	Exposure
14555	California	02-06-2015	\mathbf{BDU}	000 1662	37
Basic			***************************************		
Incident Type	vvvviii in territoria de la companya				
	Building	fire			
Incident Aid					***************************************
Aid Given or Rece	ived: None				
Incident Dates					
A	larm: 02-06-2 0	15 14:07:00			
Ar	rival: 02-06-20 :	15 14:16:00			
CAD Reported Control	ained Γime:				
Actual Contained	Гime:				
Contro	olled:				
Last Unit Cle	ared: 02-15-20.	15 15:00:00			
Shifts & Alarms					***************************************
Shift or Pla	toon:				
Ale	arms:				
Dis	strict:				
Actions Taken					
	1: Action ta	ken, other			
Resources					
	Apparatus		Perso	nnel	
= =	ssion: 0		0		
	EMS:		0		
(Other: 0		0		
***************************************	Resource	e counts do not inclue	le aid received in	resources.	***************************************
Losses					
Б.,	Losses			re Value	
	perty: 326077 ntent: 50000		3260 5000		
	ment: soom		2000	U	
Casualties	Deaths		Jnjuri	inc	
Fire Ca	rvice: 0		mjuri O	ua	
Civilian/Other Se			0		
Other Information					***************************************
Detector Alerted Occup	nants:				
Hazardous Mat					
Mixed Use Pro					
	Use: 1 or 2 far	nily dwelling			
TIODOITA	COC. A DI WILL	ALIAY BART BERABAK			

Lat/Long: 37.511933 / -118.645300

Street Address: 1430 Swall Meadows Road

Apt./Suite/Room:

City: Bishop
State: California
ZipCode: 93514

Officer in Charge

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: **02-06-2015**

Reporter

ID: 1003454

Name: Matthew J Franklin

Position or rank: FC

Assignment: **Bishop FFS**Date Signed Off: **02-06-2015**

Remarks

House and detached garage burned due to exposure to the Round vegetation fire.

Fire

Property Details

Number of Living Units in

Bldg of Orgin:

Number of buildings

involved:

Acres burned (outside fires):

On-Site Materials or Products

On-Site Material

Material Storage Use

1: None

None

2:

3:

Ignition

Area of fire Origin: Undetermined

Heat Source: Undetermined

Confined to Object of Origin: No

Item First Ignited: Undetermined

Type of Material First

Undetermined

lgnited:

Cause of Ignition: Other

Factors Contributing To Ignition

1: Exposure fire

Human Factors Contributing To Ignition

Estimated Age of Person

Involved:

Sex of Person Involved:

Equipment Involved In

Ignition

Equipment Involved: None

Fire Suppression Factors

1: Urban-Wildland Interface Area

Mobile Property Involved:

Mobile Property: None

Local Use (Reports):

Prefire Plan Available: No

Reports Attached None Specified

Structure

Structure Type: Enclosed building Building Status: In normal use

Building Height

stories at or above grade: 2 # stories below grade: 0

Main Floor Size

Total square feet: 1500

OR

Length in feet:

WIDTH in feet:

Fire Origin

Story of fire origin: 1

Fire Spread: Beyond building of origin

Number of Stories Damaged By Flame

Minor damage (<25%): 0

Significant damage (25-

49%):

Heavy damage (50-85%): 0

Extreme damage (75-100%): 2

Material Contributing Most To Flame Spread

No flame spread OR Same as material first ignited OR unable to determine

Detectors

Undetermined

Automatic Extinguishment System(AES)

Type of AES:

AES Operation:

Number of Sprinkler Heads: